

**3<sup>rd</sup> Quarter Inspection Report**  
**Crandall Canyon**  
**04.03.06 to 06.28.06**  
**42-01715**

1. Mine Activity Data (Event Sheet); 4/3/2006 to 6/28/2006; 23 citations, 1 safeguard; event sheet signed by Michael Shumway, AR #23807 who was an AR since 1996. (Page 83).
2. 2000-86 Form dated 4.18.06, MMU 009-0 (pillar section) had 33,848 to 34,003 CFM over the miner (Pages 18, 19 and 28) and 23,180 CFM in LOXC (Pages 1 – 2, 4.7.06).
3. No inadequate examination citation issued for accumulation of combustible material. Accumulation was not reported on pre-shift. See Page 37.
4. Purchase order (4.4.06) for 200 CSE SR-100s
5. Purchase order (3.9.06) for 94 lifelines, 50 spools and 3500 hangers.
6. Purchase order (4.21.06) for 150 CSE SR-100s
7. Purchase order (3.8.06) for 25 nylon cases for CSE SR-100s; 20 leather cases for CSE SR-100s; 250 CSE SR-100s; 10 SCSR-100 Training Units
8. Purchase order (3.8.06) for 30 lifelines and 14 split cone kits.
9. On 6.1.06 training pertaining to donning of SCSR took place for 3 miners.
10. Twelve CSE SR-100s checked by MSHA on 6.14.06. No citations written.
11. No. 4 belt had a total of six bottom rollers turning in accumulations. One top middle roller was turning on the roller shaft with the bearings gone, and the roller frame was very warm to the touch. Accumulations of coal existed from cross cut 90 to 73 a distance of about 3450 feet for a total of about 621 rollers. See Page 36.

## 12. Summary of all Citations

<u>Citation # /S&amp;S</u>	<u>Date/Time Issued</u>	<u>Date/Time Abated</u>	<u>Section of Reg and brief description</u>
7282925/N	4.11.06/0900A	4.11.06/0940A	75.514 Shuttle car cable, worn cover exposing inner leads
7282926/N	4.11.06/0930A	4.12.06/0700A	75.400 Accumulations of oil and oil soaked coal
7282927/Y	4.11.06/1000A	4.12.06/0705A	75.512 Gap or 0.007 in controller cover, battery scoop
7282928/N	4.11.06/1055A	4.12.0/0645A	75.512 Battery charger switch cover – exposed wires
7282929/N	4.12.06/0920A	4.13.06/0920A	75.333(h) Doors between belt and return damaged
7285564/N	1.24.06/1015	4.17.06/2005P	75.1909 (a)(1) MSHA approval tag not on engine
7282930/N	4.18.06/1530P	4.18.06/1625P	75.362 (a)(2) Miner water spray pressure low
7282931/N	4.18.06/1705P	4.18.06/2045P	75.1712-6 (a) No chemical or paper in chemical toilet; toilet dusty

7282933/N	5.4.06/0720A	5.4.06/1045A	75.1101-1(a) Belt fire deluge system not properly functioning
7282934/N	5.4.06/0910A	5.15.06/0830A	75.333(h) Hole in overcast leaking from intake to belt
7282937/Y	5.15.06/0925A	5.16.06/0950A	75.1725(a) Accumulations in contact with rollers; bad roller
7282938/Y	5.15.06/0925A	5.16.06/0940A	75.1101-1(a) Water fire deluge system not operating properly
7282940/Y	5.23.06/1530P	5.23.06/1545P	75.1911(a)(4) Dry chemical fire suppression nozzle blocked-Eimco 975
7283021/N	5.23.06/1710P	5.23.06/1715P	75.1100-3 Hand held fire extinguisher not examined in required time span
7283022/Y	5.23.06/1720P	6.1.06/1230P	75.1725(a) Sharp edges in several locations on Isuzu pickup
7283023/N	5.23.06/1910P	5.30.06/0905A	75.508 Electrical map not kept current
7283024/Y	5.30.06/0805A	6.1.06/0725	75.1914(a) Employee riding in pickup with door removed and no restraint
7283025/N	5.30.06/0820A	5.30.06/0830A	75.1100-3 Hand held fire extinguisher not examined and tag punched in required time period
7283026/N	5.30.06/0850A	6.1.06/0920A	75.360 (f) Pre shift record for 5.28.06 not signed by examiner
7283029/N	5.30.06/1305P	5.30.06/1320P	75.1914(e) Fire extinguisher not examined in required time period
7283030/N	5.30.06/1325P	5.30.06/1335P	75.1914(e) Inadequate pre-op on pickup
7283031/	5.31.06/0455A	6.23.06/0730A	75.1403 Employees not restrained from being thrown from vehicle; <b>Safeguard issued</b>
7283047/Y	6.23.06/0850A	6.27.06/0800A	77.207 Silo headhouse does not have the required lighting
7283048/Y	6.23.06/1015A	6.27.06/0820A	77.400(a) Moving parts of Komatsu WA 450 engine not properly guarded
7283049/Y	6.23.06/1010A	6.27.06/0830A	77.1104 Oil accumulations on Komatsu WA 450 engine components

# E01 REG SAF.INSP.NOTES

04-03-2006 – 06-28-2006

DAILY COVER SHEET

Date 4-7-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE SHIFT / ONE -

SHIFT / BITS

Accompanied By Company Representative \_\_\_\_\_

STEVE RADMALL

Miners Representative ALONE

AREAS OF INSPECTION ACTIVITY:

SOUTH MAINS SECTION -

MALL - DOOR

2<sup>ND</sup> EAST L.W. SOUTH

CRANDALL CANYON MINE

Inspector's Initials MS TTT 4-11-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 4-7-06

ARRIVED AT MINE -

CONTACTED STEVE & JIM

FRUCE -

DISCUSSED WHAT IS GOING

ON IN MINE, SHIFTS, INJURY

RATES, WHICH IS HIGH, COVERAGE

OF SHIFTS -

ALL REQUIRED MAPS, PLANS

& POSTINGS ARE UP IN

BATHHOUSE / LAMPHOUSE -

CHECKED ESCAPEWAY MAP

POSTED IN BATHHOUSE -

CHECKED ROOMS -

Inspector's Initials MS TTT 4-11-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 2

Date 4-7-06

TRAVELED INTAKE TO SOUTH

MAINS SECTION -

HALLWAY WAY COMPACT -

SOME WET SOME DAMP

CHECKED FACES - NO

ROOF OR RIB HAZARDS

OBSERVED -

DTI'S CURRENT AND IN

PLACE -

ALL AREAS ROCK DUSTED

AND VENTILATED -

LOXC AIR READING -

18' X 6' 10" = 122

Inspector's Initials MS

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

Date 4-7-06

190 CEL = 23180 QUANTITY  
AIR READAL BEHIND CUR-  
TAIN No. 1 FACE -  
3'6" x 7'6" = 26 AREA  
170 CEL = 4420 QUANTITY

PERMISSABILITY ON -

FLETCHER BOLTER 13-1

RECEIVED MESSAGE TO  
GO OUTSIDE AND CALL  
SUPERVISOR -

Inspector's Initials ML 411-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 4

Date 4-7-06

TRAVELED INTO SOUTH  
CRANDALL 2<sup>ND</sup> EAST LANE  
CHECKED LOCATION OF HEAT  
SENSORS ON POWER PACK -  
TEMPERATURE MINIMUM &  
MAXIMUM SETTINGS ON  
SENSOR AS PER COVER ON  
BOX - THERE IS NO PHYSICAL  
WAY TO CHECK SETTINGS OR  
FUNCTION -  
LOOKED AT BLUEPRINT FOR  
WIRING -

LOOK AT BLUEPRINT FOR  
TEMP SENSOR ON TRANS-  
FORMER AND WIRING

Inspector's Initials ML 411-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 5

Date 4-7-06

IF IS WIRED IN -  
TODD LYLE CHRISTENSEN  
ALL LOOKS GOOD TO ME.

TRAVELED OUTSIDE -

HELD PRE-INSPECTION  
CONFERENCE -  
MIKE SHANNON  
STEVE RADMALL - SAFETY  
JACK MARINAS - MINE FOREMAN  
BOBEE ALRED - MINE FOREMAN  
JIM PRUIT - SAFETY

DISCUSSED -  
UPKEEP OF MACHINERY

Inspector's Initials ML 411-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 6

Date 4-2-06

ROADWAYS -  
ACCIDENT RATES -

Inspector's Initials meo

Supervisor's Initials and Date \_\_\_\_\_ Page No. 7

Date 4-7-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials meo

Supervisors Initials and Date \_\_\_\_\_ Page No. 5

DAILY COVER SHEET

Date 4-11-06 Event No. 4176391

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / CM -

SHIFT / BELTS

Accompanied By: Company Representative \_\_\_\_\_

(CLARK ATWOOD)

Miners Representative NONE -

AREAS OF INSPECTION ACTIVITY:

SOUTH MAIN - mm. 009

PERMISSIBILITY -

Inspector's Initials MS

Supervisor's Initials and Date

TF 4-17-06

Date 4-11-06

ARRIVED AT MINE -

CONTACTED JIM & CLARK -

CHECKED BOOKS -

TALKED WITH JACK MARINA

ABOUT PRESSURE REGULATORS

AT FIRE VALVE HOOKUPS -

TRAVELED INTAKE TO SECTION -

SECTION PILLARING -

CHECKED PILLAR AREAS -

NO HAZARDS OBSERVED

DETS IN PLACE -

Inspector's Initials MS

Supervisor's Initials and Date

TF 4-17-06

Date 4-11-06

PERMISS -

JOY MIXER - 5062

SHUTTLE CAR - No 8

SHUTTLE CAR - No 9

A SPLICE ON TRAILING

CABLE WITH THE OUTER

TAPE WORN OFF IN

NUMEROUS PLACES -

INNER LEADS EXPOSED

TO THEIR OUTER JACKETS

NO WIRE LEADS ARE

EXPOSED TO EXPOSE ANY

TO BARE WIRE - THERE

Inspector's Initials MS

Supervisor's Initials and Date

TF 4-17-06

Date 4-11-06

IS NO STANDING WATER  
ON SECTION AND NO  
CH<sub>4</sub> DETECTED -

CITATION ISSUED 0900  
75.514

ROOT CAUSE - NOT RECOGNIZED - CREW DOES NOT HAVE MECHANIC/ELECTRICIAN ON WITH THEM

WILL CHECK PERMITS BOOK -

SHUTTLE CAR WAS REMOVED FROM SERVICE UNTIL SPICE REPAIRED -

Inspector's Initials ms

Supervisor's Initials and Date

Page No. 4Date 4-11-06

STAMLER FEEDER - 2919  
ACCUMULATIONS OF OIL &  
OIL SOAKED COAL - OIL  
LEAKING FROM TRAM  
VALVE BANK WITH OIL &  
OIL SOAKED COAL ON FRAME -  
OIL LEAKING FROM FITTING  
CONNECTIONS ON OFF  
WALKWAY SIDE -  
NO IGNITION SOURCES ARE  
COATED OR IN CONTACT  
WITH ACCUMULATIONS -

CITATION ISSUED - 0930

75.400

CONDITION HAD NOT

Inspector's Initials ms

Supervisor's Initials and Date

Page No. 5Date 4-11-06

BEEN RECOGNIZED BY  
CREW - I ASKED BOSS  
HOW OFTEN OIL W/ ADDR  
AND HE SAID IF IT IS  
DONE THAT THE MAINTAIN  
ENCE PART DOES IT -  
TANK WAS LOW -

SPICE ON SHUTTLE CAR  
CABLE WAS CUT OFF  
AND REPLACED -  
TERM. CUT - 0940

LONG AIRBOX BATTERY  
SCOOP - 17.2 -

A CAP IN THE CONTROLLER

Inspector's Initials ms

Supervisor's Initials and Date

Page No. 6

Date 4-11-06

BOX THAT A FOOT FEELER  
GAUGE WOULD GO INTO  
THE FULL LENGTH OF BLADE  
2 1/2" AND COULD BE SLID  
ALONG GAP IN COVER ABOUT  
2" - THE BATTERY SCOOP  
WAS NIPPED TO BATTERIES  
AND DID HAVE POWER TO  
PUMP & LIGHTS -

CITATION ISSUED 1000

ROOT CAUSE NOT RECOL-  
ORIZED BY CREW AND AT  
THIS TIME DON'T KNOW  
WHEN WEEKLY PERMITS  
WAS LAST DONE

Inspector's Initials MS

Supervisor's Initials and Date

Date 4-11-06

SECTION TRICKLE-DIESEL  
No. 8 -

CHECKED MILLER WELDER  
#3 -

SECTION HEAT LAMP -

SHUTTLE CAR 12-9 IS NOT  
IN SERVICE -

CHECKED SECTION TRANS -  
FORMER NO. 30 -

CHECKED MICROWAVE -

Inspector's Initials MS

Supervisor's Initials and Date

4-17-06  
Page No. 8

Date 4-11-06

CHECKED BATTERY CHARG-  
ING STATION -


THE POWER ON/OFF  
SWITCH LOCATED IN THE  
INTAKE ENTRY TO DIS-  
CONNECT POWER TO THE  
BATTERY CHARGER IN  
CONNECTION WITH THE  
ADX SERIES 1000  
AUTOMATIC DRY CHEMICAL  
FIRE EXTINGUISHER  
UNIT (SILVER BOTTLE)  
DID NOT HAVE A SEALED  
SWITCH COVER - YOU  
COULD LOOK INTO THE

Inspector's Initials MS

Supervisor's Initials and Date

4-17-06  
Page No. 9

Date 4-11-06

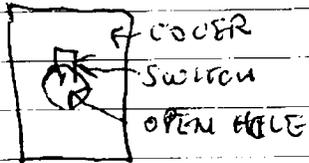

COVER AND SEE THE WIRE AND TERMINAL CONNECTIONS ON THE INSIDE OF BOX - DEAN LACOTTA (SHIFT MAINTENANCE FOREMAN) CAME TO LOOK AT SWITCH AND I ASKED HIM TO CORRECT ME IF I WAS WRONG, BUT THAT LOOKING AT SWITCH COVER I THINK IT

Inspector's Initials MS TOP 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 10

Date 4-11-06

WAS INSTALLED THAT WAY WITH THE OPENING IN THE SWITCH COVER - HE SAID YES IT HAD TO HAVE BEEN INSTALLED THAT WAY -

THIS CHARGING STATION WAS PUT IN THIS XEROX ABOUT A WEEK AGO - CITATION ISSUED 1055  
15.512

ROOT CAUSE - IMPROPER INSTALLATION & POSSIBLY INADEQUATE EXAMINATION -

Inspector's Initials MS TOP 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 11

Date 4-11-06

DID NOT HAVE CREW PULL THE 4 MESS OUT FOR PERMITS BECAUSE OF PILLARING - WILL HAVE TO GET THEM AT A LATER DATE -

TRAVELED OUTSIDE - CHECKED PERMISS. RECORDS FOR SOUTH MAINS SECTION

Inspector's Initials MS TOP 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 12

Date 4-11-06

Except as previously noted, in all areas traveled during today's inspection, DT&I's sufficient and up to date. No low O<sub>2</sub> or CH<sub>4</sub> detected beyond normal range. Roof and Rib support appears adequate. Ventilation Controls in place, Air flowing in the proper direction and Velocities are adequate. Clean up and Rock Dust adequate with no combustible materials present. Fire suppression equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date \_\_\_\_\_ Page No 13

Date: 4-11-06

Citation Number: 7282925

Time violation observed: 0900

What is the violation? PERMANENT SPLICE WITH WART IN COOLER EXPOSING INNER LEADS

Where is the violation located or observed? No 9 SHUTTLE CAR SOLID MAIN MINN-009

Who knew the violation existed? CREW WAS UNAWARE OF CONDITION

How long has the violation existed? COULD NOT DETERMINE LAST EXAM. 4-3-06

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  No Lost Work days |  Lost Workday Or Restricted Duty |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely  Occurred

Why? NO EXPOSED WIRE CONDUCTORS NO METHANE, NO WATER ON ROADWAY

Inspector Initials: MS Page No. 14

Date: 4-11-06

Citation Number: 7282926

Time violation observed: 0930

What is the violation? OIL LEAKS AND ACCUMULATION OF OIL AND OIL SOAKED CABS.

Where is the violation located or observed? SOLID MAIN MINN-009 FEEDER BREAKER

Who knew the violation existed? SUPERVISOR STATED HE DID NOT KNOW OF CONDITION

How long has the violation existed? COULD NOT DETERMINE - LAST EXAM 4-3-06

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  No Lost Work days |  Lost Workday Or Restricted Duty |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely  Occurred

Why? NO IGNITION SOURCES IN CONTACT

Inspector Initials: MS Page No. 15

Date: 4-11-06  
Citation Number: 7282927  
Time violation observed: 1000

What is the violation? GAP OF .007 IN  
CONTROLLER COVER BATTERY  
SCOOP NO. 17-2

Where is the violation located or observed? SOUTH  
MAIN MINE .009

Who knew the violation existed? MACHINE OPERATOR  
DID NOT KNOW -

How long has the violation existed? COULD NOT  
DETERMINE - LAST EXAM  
4-2-06

How many people are exposed to the condition? 6

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dut.  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? THIS SCOOP USED INBY LOCK  
CONDITION COULD POSSIBLY  
IGNITE FLOAT COAL DUST

Inspector Initials: MJ

Page No 16

Date: 4-11-06  
Citation Number: 7282928  
Time violation observed: 1055

What is the violation? ON/OFF POWER  
SWITCH COVER WITH A  
1/2 DIAMETER HOLE IN MIDDLE -  
EXPOSING CONDUCTING POINTS  
TO ATMOSPHERE.

Where is the violation located or observed? CHARGE  
STATION SOUTH MAIN MINE  
009

Who knew the violation existed? FOREMAN STATED  
HE DID NOT KNOW

How long has the violation existed? COULD NOT  
DETERMINE - LAST EXAM  
4-2-06

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dut.  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? NO METHANE DETECTED,  
NO FLOAT COAL DUST  
NORMALLY IN AREA

Inspector Initials: MJ

Page No 17

4-12-06 4476331

PRE-SHIFT / ON-SHIFT / WEEKLY HAZARDS

CLARK ATWOOD

NONE

SOUTH MAINS - mmu-009  
E01 -  
RESPIRABLE DUST - COULD NOT DO, MINER DOWN

SOUTH MAIN & MAIN WEST  
RETURN - SECONDARY ESCAPE-WAY TO PORTAL

MS

TTF 4-17-06

1

Date 4-12-06

PREPARED PUMPS / CHECKED FOR CAIS & FLOW AT OFFICE -

ARRIVED AT MINE - CONTACTED JACK MARINAS ABOUT PILLAR SECTION PRODUCING - HE SAID THAT THE GRAVEYARD SUEP HAD STARTED CHANGING THE CAIS & PLANETARIES ON THE CONTINUOUS MINER LAST NIGHT, HE HADN'T HEARD YET THIS MORNING WHERE JOB IS AT - HE CAME BACK TO ME

Inspector's Initials MS TTF 4-17-06  
Supervisor's Initials and Date Page No. 2

Date 4-12-06

IN A FEW MINUTES AND SAID THAT THE PLANETARIES ARE NOT EVEN OUT YET SO SECTION WILL NOT PRODUCE TODAY - CANNOT RUN RESPIRABLE DUST ON SECTION TODAY -

TALKED TO DEAN LOCATA ABOUT CONDITIONS CITED YESTERDAY HE SAID HE HOPES BUT IS NOT SURE IF EVERYTHING GET DONE BECAUSE OF OTHER MAINT. PROBLEMS - TALKED WITH HIM &

Inspector's Initials MS TTF 4-17-06  
Supervisor's Initials and Date Page No. 3

Date 4-12-06

JIM PRUITT ABOUT ACTION TO TERM CUTS AND THAT CITED CONDITIONS BECOME PRIORITY UNTIL CORRECTED - STATED TO THEM THAT I WOULDN'T HESITATE TO ISSUE FAILURE TO ABATE WITH-OUT JUSTIFIED CIRCUM- STANCES - THAT IT IS RESPONSIBILITY OF COMPANY TO CORRECT WHETHER OR NOT THERE IS A MECHANIC ASSIGNED TO SECTION OR NOT -

Inspector's Initials ms 4-17-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 4

Date 4-12-06

TRAVELED INTERIOR TO SECTION -  
LOOKED ON ONE/OFF SWITCH HAS BEEN REPLACED -  
TERM CUT - 0645  
CHECKED STAMLER FEEDER - REPAIRS HAVE BEEN DONE AND OIL CLEARED OFF -  
TERM CUT - 0700  
CHECKED BATTERY SCUMPS GAP IN COVER HAS BEEN CLOSED -  
TERM CUT - 0705

Inspector's Initials ms 4-17-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 5

Date 4-12-06

TALKED WITH THE MECHANIC ON GRAVEYARD - CONDITIONS CITED YESTERDAY WERE NOT CORRECTED UNTIL ON THE GRAVEYARD SHIFT -  
ENTERED RETURN SECONDARY ESCAPEWAY X-CUT 15 OFF SECTION -  
WALKED TO 9th WEST SEALS -  
16.1 -  
2102 OCO 070044  
16.2 -  
2102 OCO 070044

Inspector's Initials ms 4-17-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 6

Date 4-12-06

No. 3 -  
20.9 oz 0 cc 0% CH4

8th WEST SEALS -

No. 1 -  
20.9 oz 0 cc 0% CH4

No. 2 -  
20.9 oz 1 cc 0% CH4

No. 3 -  
20.9 oz 1 cc 0% CH4

AIR READING AT REGULATOR  
FOR SOUTH INMANS -

AREA - 6.6

VEL - 1754

QUANTITY - 11576  
(BOTTOM REG)

Inspector's Initials MS 4/17/06

Supervisor's Initials and Date Page No. 7

Date 4-12-06

AREA - 6.7

VEL - 2539

QUANTITY - 17011  
(TOP REGULATOR)

28587 TOTAL

MAIN WEST RETURN -  
MET WITH WEEKLY EXAMINER  
AT JUNCTION OF SOUTH  
MAIN & MAIN WEST -  
TRAVELING WITH AND  
CLARK -

1st NORTH SEALS -

No. 1 -  
20.9 oz 3 cc 0% CH4

Inspector's Initials MS 4/17/06

Supervisor's Initials and Date Page No. 8

Date 7-12-06

No. 2 -  
20.9 oz 3 cc 0% CH4

No. 3 -  
20.9 oz 3 cc 0% CH4

No. 4 -  
20.9 oz 2 cc 0% CH4

AT X-CUT 50 MAIN WEST  
THE SET OF DOORS (DOUBLE)  
CLOSEST TO THE RETURN  
ENTRY WERE DAMAGED  
BY A JEREMY DUSTING  
MACHINE. THIS SET OF  
DOORS IS BETWEEN  
THE BELT ENTRY AND  
RETURN - THE WEEKLY

Inspector's Initials MS 4/17/06

Supervisor's Initials and Date Page No. 9

Date 4-12-06

EXAMINER TOLD ME  
 THAT HE HAD REPORTED  
 THIS AREA AS NEEDING  
 ROCK DUST ON HIS WEEKLY  
 ON 4-5-06, AND THAT  
 IT WAS DUSTED ON  
 THE GRAVEYARD SHIFT  
 FOR 04-06-06 - ESTAB -  
 USUALLY HOW LOW  
 CONDITION HAS EXISTED  
 EVIDENTLY THE MACHINE  
 OPERATOR DID NOT  
 REPORT DAMAGE -  
 CIT. ISSUED - 0920  
 75333(h)  
 ROOT CAUSE - NOT

Inspector's Initials MS ACT 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 12

Date 4-12-06

BEING REPORTED

NORTH MAIN RETURN  
SEALS -

No. 1 -  
 20.902 Occ 0%CHY

No. 2 -  
 20.902 Occ 0%CHY

No. 3 -  
 20.902 1cc 0%CHY

No. 4 -  
 20.902 Occ 0%CHY

OLD EAST SEALS -

No. 1 -  
 20.802 Occ 0%CHY

Inspector's Initials MS ACT 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 11

Date 4-12-06

No. 2 -  
 20.902 Occ 0%CHY

No. 3 -  
 20.902 Occ 0%CHY

No. 4 -  
 20.702 Occ 0%CHY

WALKED OUT TO MAIN  
 RETURN PORTAL -

Inspector's Initials MS ACT 4-17-06  
 Supervisor's Initials and Date \_\_\_\_\_ Page No. 12

MSHA Form 7000-10k, June 93 (revised)

Date 4-12-06

Except as previously noted, in all  
areas traveled during today's  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place. Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date \_\_\_\_\_ Page No 13

\*U.S. Government Printing Office: 1995-609-287

Date: 4-12-06

Citation Number: 7282929

Time violation observed: 0920

What is the violation? DAMAGED SET  
OF DOUBLE DOORS BET-  
WEEN BELT ENTRY &  
MAIN RETURN.

Where is the violation located or observed? X-CURT  
50 MAIN WEST

Who knew the violation existed? AREA ON  
WEEKLY - EXAMINED WITH  
ME WHEN OBSERVED

How long has the violation existed? ABOUT 6  
DAYS

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? ONE OF THE TWO SETS  
OF DOORS WAS INTACT  
NOT A NORMAL TRAVEL  
AREA

Inspector Initials: MS

Page No 14

Date 4-13-06

X-cut 45 SEAL -  
2102 100 07004  
X-cut 46 seal -  
2102 000 07004

CHECKED Sunflow Pump  
#1 x-cut 46 -

CHECKED 150 hp Pumps  
X-cut 45 -

WENT TO X-cut 50  
MAIN WERT -  
THE INSIDE SET OF DOORS  
HAS BEEN PUT BACK IN  
PLACE

TERM. CUT - 0920

Inspector's Initials MS 4/17/06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 4

Date 4-13-06

TRAVELED OUT TO RETURN  
FAN PORTAL, TOOK AIR  
READING & BOTTLE SAMPLE -

HELD WEEKLY CLOSURE  
WITH JIM PRUITT &  
CLARK ATWOOD

Inspector's Initials MS 4/17/06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 5

4-13-06  
100' INBY RETURN  
FAN  
113  
1985  
224305  
M4656  
070  
-

MS  
4/17/06

MSHA Form 7000-10k, June 93 (revised)

Date 4-13-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustibile  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date \_\_\_\_\_ Page No 7

\*U.S. Government Printing Office: 1995-609-287

16

COPY

DAILY COVER SHEET

DATE 4-17-06

EVENT NO. 4476331

ARRIVED AT THE MINE \_\_\_\_\_ DEPARTED FROM THE MINE \_\_\_\_\_

LIST RECORD BOOKS CHECKED South CRANDALL MAINS PRE Shift, CRANDALL MAI  
SOUTH, 2ND EAST, CRANDALL BELTS, South CRANDALL PRE-SHIFT, South CRANDALL  
GENERAL MINE, CRANDALL GENERAL MINE - PRE/ON Shift - No HAZARDS LIST

ACCOMPANIED BY: COMPANY REP. Clark Atwood

MINERS REP. \_\_\_\_\_

AREAS OF INSPECTION ACTIVITY:

Checked Terra Pro # 1 to abate citation 7285564  
Machines were in the shop and had a MSHA engine  
approval tag 07-ENAO40001 for engine number  
46370404 confirmed this number with the  
one stamped on the block and it matched 46370404.  
Citation will be abated

Abated  
20:05

PAGE NO \_\_\_\_\_ INSP INITIAL \_\_\_\_\_ SUPERVISOR D&I \_\_\_\_\_

Respirable Dust Sampling and Monitoring Data

U.S. Department of Labor  
Mine Safety and Health Administration



1. Type of Inspection:  Regular  Technical  Monitoring 2. Date: 4-18-06 3. Field Office Code: 0905-01

4. Mine I. D.: 42-01715 5. Mine Name: CRANDALL CANYON MINE 6. Company Name: GENERAL RESOURCES LMC.

7. MMU/DA/SA: 009-0 8. Times Entry/Mine Cited for Excessive Dust Last 12 Months: 0

Signature

Number: 23807

Signature

9. Mining Method:  A. Longwall  B. Continuous  C. Conventional

10. Cut Sequence:  i. Tail-Head  ii. Head-Tail  iii. Both

11. Other (specify):

12. Mining Ht.: 94 in. Inches of Rock Mined: 0

13. Remote Operation of Miner?:  Yes  No

14. Type of Mining:  I. Development  II. Retreating

15. Physical Conditions: Face Area:  Wet  Damp  Dry Roadways:  Wet  Damp  Dry  Compacted

16. Type of Haulage Equipment:  Electric  Battery  Diesel  Other (specify)

17. Roof Bolter Type:  I. Twin Head  II. Single Head  III. Integral Number of Bolters: 1

18. Is Roof Bolter DA Established?  Yes  No

A. Ventilation: PILLAR SECTION - AIR GOING CUT INTO GOB

I. Operates on Separate Split of Air:  Yes  No

II. Operates on Return-Side of DO:  Yes  No

C. Type of Dust Control:  I. Wet Head  II. Dust Collector

18. Dust Control Parameters - Ventilation System:

A. Method of Face Ventilation:  I. Blowing  II. Exhausting  III. Both

B. Face Ventilation Device:  I. Curtain  II. Tubing  III. Both

C. Line Curtain/Tubing Distance: \_\_\_\_\_ ft.

D. Is Face Area Ventilated with Belt Air?  Yes  No

E. If, Yes, Quantity in Belt Entry: \_\_\_\_\_ cfm

F. Air Quantity: Longwall (Between 50 and 100 feet of Headgate and Tailgate)

Location	Quantity (Q), cfm	
	Plan	Observed
Headgate		
Tailgate		

Location	Velocity (V), fpm	
	Plan	Observed
Headgate		
Tailgate		

Continuous/Conventional/Handloading

	Plan		Observed	
	Quantity (Q)	Velocity (V)	Quantity (Q)	Velocity (V)
OVER MINER	33848			
MEAV (V)				
Scrubber				

Respirable Dust Sampling and Monitoring Data

U.S. Department of Labor  
Mine Safety and Health Administration



1. Type of Inspection:  Regular  Technical  Monitoring  
 2. Date: 4-18-06  
 3. Field Office Code: 0905-01  
 4. Mine I. D.: 42-01715  
 5. Mine Name: CRANDALL CANYON MINE  
 6. Company Name: GENUINE RESOURCES INC.  
 7. MMU/DA/SA: 009-0  
 8. Times Entity/Mine Cited for Excessive Dust Last 12 Months: 0

9. AR Signature: **Signature**  
 AR Number: 23807  
 10. Supervisor Signature: **Signature**

A. Longwall  
 I. Single Drum  
 II. Double Drum  
 III. Plow  
 Cut Sequence  
 i. Tail-Head  
 ii. Head-Tail  
 iii. Both  
 B. Continuous  
 I. Ripper  
 II. Auger  
 III. Borer  
 C. Conventional  
 Other (specify):  
 12. Mining Mt.: 94 in.  
 Inches of Rock Mined: 0  
 13. Remote Operation of Miner?:  
 Yes  
 No

14. Type of Mining  
 I. Development  
 II. Retreating  
 15. Physical Conditions:  
 Face Area:  Wet  Damp  Dry  
 Roadway:  Wet  Damp  Dry  Compacted

16. Type of Haulage Equipment:  
 Electric  Battery  Diesel  Other (specify):

17. Roof Bolter Type: Number of Bolters: 1  
 I. Twin Head  
 II. Single Head  
 III. Integral  
 B. Is Roof Bolter DA Established?  Yes  No  
 A. Ventilation: PILLAR SECTION - AIR GOING OUT INTO COB  
 I. Operates on Separate Split of Air:  Yes  No  
 II. Operates on Return-Side of DO:  Yes  No  
 C. Type of Dust Control:  I. Wet Head  II. Dust Collector

18. Dust Control Parameters - Ventilation System:  
 A. Method of Face Ventilation:  
 I. Blowing  
 II. Exhausting  
 III. Both  
 B. Face Ventilation Device:  
 I. Curtain  
 II. Tubing  
 III. Both  
 C. Line Curtain/Tubing Distance: PILLAR SECTION  
 D. Is Face Area Ventilated with Belt Air?  Yes  No  
 E. If, Yes, Quantity in Belt Entry: cfm

F. Air Quantity: Longwall (Between 50 and 100 feet of Headgate and Tailgate)

Quantity (Q), cfm

Location	Observed
Headgate	
Tailgate	

Velocity (V), fpm

Location	Plan	Observed
Headgate		
Tailgate		

Continuous/Conventional/Handloading

	Plan	Observed
MEAV (M)	34,003	
Scrubber*		

OVER MINER

Dust Data Card

1. Cassette Number **57 622762**

2. Mine ID Number **42 01715** 3. Contractor Code

4. Mine Name **CRANDALL CANYON MINE**

5. Company Name **GENVAL RESOURCES INC.**

6. Date Sampled **04 18 06** 7A. Sampling Start Time **14**  
Mo. Da. Yr. (24 hr. clock)

7B. Sampling Time (min) **480** 8. Tons This Shift **00648**

9. Type of Sample (select one) **1**  
(1) designated occ (ug)  
(2) nondesignated occ (ug)  
(3) designated area (ug)  
(4) designated work position (sur)  
(5) part 90 miner

10. MMU DA/SA **0090** 11. Occ Code **036**

12. Part 90 Miner Sampled  
SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN **(b) (7)(C)**

**Signature**

Initial Weight

Weighed By  OSP Checked By  Void Code

Date Processed

KEEP THIS FOR YOUR RECORDS **0905-01**

Dust Data Card

1. Cassette Number **57 622693**

2. Mine ID Number **42 01715** 3. Contractor Code

4. Mine Name **CRANDALL CANYON MINE**

5. Company Name **GENVAL RESOURCES INC.**

6. Date Sampled **04 18 06** 7A. Sampling Start Time **14**  
Mo. Da. Yr. (24 hr. clock)

7B. Sampling Time (min) **480** 8. Tons This Shift **00648**

9. Type of Sample (select one) **2**  
(1) designated occ (ug)  
(2) nondesignated occ (ug)  
(3) designated area (ug)  
(4) designated work position (sur)  
(5) part 90 miner

10. MMU DA/SA **0090** 11. Occ Code **012**

12. Part 90 Miner Sampled  
SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN **(b) (7)(C)**

**Signature**

Initial Weight

Weighed By  OSP Checked By  Void Code

Date Processed

KEEP THIS FOR YOUR RECORDS **0905-01**

Dust Data Card

1. Cassette Number  
57 622765

2. Mine ID Number  
42 01715  
3. Contractor Code

4. Mine Name  
CRANDALL CANYON MINE

5. Company Name  
GENERAL RESOURCES INC.

6. Date Sampled  
04 18 06  
Mo. Da. Yr.  
7A. Sampling Start Time  
14  
(24 hr. clock)

7B. Sampling Time (min)  
480  
8. Tons This Shift  
00648

9. Type of Sample (select one)  
(1) designated occ (ug)  
(2) nondesignated occ (ug)  
(3) designated area (ug)  
(4) designated work position (sur)  
(5) part 90 miner  
2

10. MMU DA/SA  
0090  
11. Occ Code  
073

12. Part 90 Miner Sampled  
SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN (b) (7)(C)

Signature

Weighed By  
OSP Checked By  
Void Code  
Date Processed

KEEP THIS FOR YOUR RECORDS  
0905-07

Dust Data Card

1. Cassette Number  
57 622769

2. Mine ID Number  
42 01715  
3. Contractor Code

4. Mine Name  
CRANDALL CANYON MINE

5. Company Name  
GENERAL RESOURCES INC.

6. Date Sampled  
04 18 06  
Mo. Da. Yr.  
7A. Sampling Start Time  
14  
(24 hr. clock)

7B. Sampling Time (min)  
480  
8. Tons This Shift  
00648

9. Type of Sample (select one)  
(1) designated occ (ug)  
(2) nondesignated occ (ug)  
(3) designated area (ug)  
(4) designated work position (sur)  
(5) part 90 miner  
2

10. MMU DA/SA  
0090  
11. Occ Code  
050

12. Part 90 Miner Sampled  
SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN (b) (7)(C)

Signature

Initial Weight  
Weighed By  
OSP Checked By  
Void Code  
Date Processed

KEEP THIS FOR YOUR RECORDS  
0905-07

Dust Data Card

1. Cassette Number 57 622670

2. Mine ID Number 42 01715 3. Contractor Code

4. Mine Name CRANDALL CANYON MINE

5. Company Name GENWAL RESOURCES INC.

6. Date Sampled 04 18 06 7A. Sampling Start Time 14 (24 hr. clock)

7B. Sampling Time (min) 480 8. Tons This Shift 00648

9. Type of Sample (select one) (1) designated occ (ug) (2) nondesignated occ (ug) (3) designated area (ug) (4) designated work position (sur) (5) part 90 miner 2

10. MMU DA/SA 0090 11. Occ Code 054

12. Part 90 Miner Sampled SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN (b) (7)(C)

Signature

Initial Weight

Weighed By OSP Checked By Void Code Date Processed

KEEP THIS FOR YOUR RECORDS 0905-01

Dust Data Card

1. Cassette Number 57 622671

2. Mine ID Number 42 01715 3. Contractor Code

4. Mine Name CRANDALL CANYON MINE

5. Company Name GENWAL RESOURCES INC.

6. Date Sampled 04 18 06 7A. Sampling Start Time 14 (24 hr. clock)

7B. Sampling Time (min) 480 8. Tons This Shift 00648

9. Type of Sample (select one) (1) designated occ (ug) (2) nondesignated occ (ug) (3) designated area (ug) (4) designated work position (sur) (5) part 90 miner 7

10. MMU DA/SA 0090 11. Occ Code

12. Part 90 Miner Sampled SSN

13. Certified Person: NOTICE - Knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN (b) (7)(C)

Signature

Initial Weight

Weighed By OSP Checked By Void Code Date Processed

KEEP THIS FOR YOUR RECORDS 0905-01

Card  
Number **57 622672**

2. Mine ID Number **42 01715** 3. Contractor Code

(min)

4. Mine Name

5. Company Name

6. Date Sampled **04 18 06** 7A. Sampling Start Time   
Mo. Da. Yr. (24 hr. clock)

7B. Sampling Time (min)  8. Tons This Shift

9. Type of Sample (select one) **9**  
(1) designated occ (ug)  
(2) nondesignated occ (ug)  
(3) designated area (ug)  
(4) designated work position (sur)  
(5) part 90 mm

10. MMU DA  11. Occ Code

12. Part 90 MM Sampled  
SSN

13. Certified Person **(b) (7)(C)** knowingly making any false statement, representation, or certification on this document is a violation of the federal criminal code which may be punished by a fine or by imprisonment or both.

SSN

**Signature**

Initial Weight

Weighed By	OSP Checked By	Void Code
<input type="text"/>	<input type="text"/>	<input type="text"/>

Date Processed

KEEP THIS FOR YOUR RECORDS

**0905.01**

4-18-06

4476331

PRE-SHIFT / ON -  
SHIFT / BELTS

BENNY ALBERT

CLARK AFWOOD -  
ALONE

SOUTH MAINS - mmu - 009  
RESP. DUST - E01

MS

OT 4-19-06

MSHA Form 7000-10K, June 93 (revised)

Date 4-18-06

CHECKED PUMPS FOR CAUSE  
AND CHARGE AT OFFICE -

ARRIVED AT MINE - CHECKED  
WITH JACK MARINIS TO  
SEE IF SOUTH MAINS SECTION  
WOULD BE PRODUCING, WILL  
PUT DUST PUMPS ON CREW -

CHECKED BOOKS -

TURNED PUMPS ON AND  
ASSIGNED TO CREW AT  
1430

RODE INTO SECTION WITH

Inspector's Initials MS  
Supervisor's Initials and Date RT 4-19-06 Page No. 2

GPO U.S. GOVERNMENT PRINTING OFFICE: 2005-541-054/20910

MSHA Form 7000-10K, June 93 (revised)

Date 4-18-06

CREW ON MAINS  
PLACED INTAKE PUMP -

PARAMETERS ON MINER  
SOL 2 -

REQUIRED SPRAYS - 46  
OBSERVED SPRAYS - 46  
REQUIRED PSI - 75  
OBSERVED PSI - 75

WHEN SPRAY PRESSURE ON  
MINER WAS CHECKED  
AT START OF THIS CREW  
SHIFT WHEN ARRIVING ON  
SECTION THE WATER PRESSURE  
ON THE TOP RIGHT BANK

Inspector's Initials MS  
Supervisor's Initials and Date RT 4-19-06 Page No. 3

GPO U.S. GOVERNMENT PRINTING OFFICE: 2005-541-054/20910

DAILY COVER SHEET

Date 4-13-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ON-SHIFT

Accompanied By: Company Representative \_\_\_\_\_

CLARK ATWOOD

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

MAIN WEST X-CUT 50  
RETURN PORTAL AIR READING  
AND BOTTLE SAMPLE M4656

~~ADVERSE~~ - 3<sup>RD</sup> EAST INTAKE

2<sup>ND</sup> EAST & 1<sup>ST</sup> EAST SEALS

X-CUT 67 (1)

1<sup>ST</sup> EAST OUTBY (2)

Inspector's Initials MS OFF 4-17-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 4-13-06

ARRIVED AT MINE -

CONTACTED CLARK -

CHECKED BOOKS -

TRAVELED INTAKE TO 3<sup>RD</sup> EAST

INTAKE SEALS -

No. 1 -

2102 Oco O70cny

No. 2 -

2102 Oco O70cny

No. 3 -

2102 Oco O70cny

2<sup>ND</sup> EAST SEALS -

No. 1 -

2102 lco O70cny

Inspector's Initials MS OFF 4-17-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 2

Date 4-13-06

No. 2 -

2102 Oco O70cny

No. 3 -

2102 Oco O70cny

1<sup>ST</sup> EAST SEALS -

No. 1 -

2102 lco O70cny

No. 2 -

2102 lco O70cny

No. 3 -

2102 Oco O70cny

MAIN WEST X-CUT 67 SEAL -

2102 Oco O70cny

Inspector's Initials MS OFF 4-17-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

Date 4-18-06

BANK OF SPRAYS AND THE  
TOP LEFT BANK WOULD  
ONLY READ 70 PSI -  
THIS LOW WATER PSI IS  
5 LBS BELOW MINIMUM  
REQUIRED - THE DAY SHIFT  
CREW HAD BEEN PRODUCING  
WHEN THEY LEFT THE  
MINER WHERE IT WAS  
PARKED -

AFTER CLEANING OUT THE  
SPRAYS AND RECHECKING  
THE PSI IT WOULD STILL  
ONLY READ 70 PSI -

CITATION ISSUED 1530  
75.3W(a)(2)

Inspector's Initials MS

4/17/06

Supervisor's Initials and Date

Page No. 4

Date 4-18-06

TOOK AIR READING OVER  
MINER - (SEE CARD)

ROOT CAUSE OF VIOLATION  
COULD BE -  
NOT BEING RECOGNIZED,  
NOT CORRECTED IF REPORTED

THE SPRAY FILTERS WERE  
CLEANED AND THE SYSTEM  
FLUSHED WATER PRESSURE  
WAS AT 75 PSI -

TERM. CIT. 1625

TOOK INTAKE AIR READING  
CHECKED PUMPS 1635

Inspector's Initials MS

4/19/06

Supervisor's Initials and Date

Page No. 5

Date 4-18-06

CHECKED -  
COMMUNICATION  
FIRST AID EQUIPMENT  
PORTABLE WATER  
HEAT LAMP / MICROWAVE  
ESCAPEWAY MAP -

THE CHEMICAL TOILET  
WAS IN THE FIRST AID  
STATION TRAILER IT DID  
NOT HAVE ANY CHEMICAL  
IN IT OR WITH IT AND  
NO PAPER - THE TOILET  
WAS DIRTY WITH  
DUST -

CITATION ISSUED 1705  
75.17(a)(2)

Inspector's Initials MS

4/19/06

Supervisor's Initials and Date

Page No. 6

Date 4-18-06

CHECKED SECTION POWER  
CENTER No. 30 -  
NO DIESEL FUEL STORED  
ON SECTION -

CHECKED OIL STORAGE -  
NO BOOSTER PUMP -  
NO AUX. FAN -  
NO GENL. -  
NO WELDER -  
NO EXPLOSIVES -  
ALL FIRE PROTECTION  
REQUIRED ON SECTION -

CHECKED SUPPLEMENTAL  
ROOF SUPPORT MATERIAL

Inspector's Initials ms

Supervisor's Initials and Date

OTF 4-19-06Page No. 7Date 4-18-06

CHECKED PUMPS - 1850

ALL DTI'S ON SECTION  
CURRENT AND IN PLACE

CHECKED ISUZU MANTRIP  
NO. 18 -

PARAMETERS ON MINER  
SPRAYS OBSERVED - 46  
PSI OBSERVED - 75

OBSERVED MINING -

NO ROOF BOLTING TAKING  
PLACE ON THIS SHIFT

Inspector's Initials ms

Supervisor's Initials and Date

OTF 4-19-06Page No. 8Date 4-18-06

A CLEAN CHARGED TOLLET  
WAS SUPPLIED ON SECTION -  
TERM CIT - 2045

WALKED WITH EXAMINER  
ON PREMISES FOR THE  
GRAVEYARD SHIFT -

ALL AREAS OF SECTION  
ADEQUATELY ROCK DUSTED

AIR QUALITY -  
20.902 Dco 070 ckt

GATHERED PUMPS - TRANCED  
OUTSIDE. TURNED PUMPS  
OFF AT 2230

Inspector's Initials ms

Supervisor's Initials and Date

OTF 4-19-06Page No. 9

4-18-06

JULIA MAINS - MMU-009

B1	622762	036	MINE	1430	1635	1850	2230
B2	693	012	BUTTE	1430	1635	1850	2230
B3	765	073	INTRATE	1430	1635	1850	2230
B4	769	050	DEP. STONS	1430	1635	1850	2230
B5	670	054	INTRATE	1430	1635	1850	2230
B6	671	7	SCOOP	1430	1635	1850	2230
C	622672						

12

4-18-06

No. 5 ENTRY OVER MINE

19'6"	
7'9"	2%
<del>151</del> 151	
225	
34,003	

ms

011 4-18-06

4-18-06

No. 6 ENTRY X-CUT 18  
OVER MINE

19'10"	
7'10"	0%
155	
218	
33848	

INTAKE No. 2 BETWEEN

14 + 15 x-cut	
20'	
7'6"	0%
150	
330	
49,500	

ms

010 4-18-06

Date 4-18-06

Except as previously noted, in all areas traveled during today's inspection, DT&I's sufficient and up to date. No low O<sub>2</sub> or CH<sub>4</sub> detected beyond normal range. Roof and Rib support appears adequate. Ventilation Controls in place. Air flowing in the proper direction and Velocities are adequate. Clean up and Rock Dust adequate with no combustible materials present. Fire suppression equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date \_\_\_\_\_ Page No 13

Date: 4-18-06

Citation Number: 7282930

Time violation observed: 1530

What is the violation? MINIMUM PSI ON MINER SPRAY NOT BEING MAINTAINED.

Where is the violation located or observed? SOUTH MAIN MMU-009

Who knew the violation existed? CREW COMING ON SHIFT + CM1 FOUND CONDITION

How long has the violation existed? PREVIOUS SHIFT HAD BEEN CUTTING AND DON'T KNOW HOW LONG

How many people are exposed to the condition? 6

If an accident should occur how serious would it be?  No Lost Work days |  Lost Workday Or Restricted Duty |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely |  Occurred

Why? AIR WAS EXHAUSTING INTO COB (NO DUST ON CREW) AND NO CH<sub>4</sub> DETECTED.

Inspector Initials: MS

Page No 14

Date: 4-18-06

Citation Number: 7282931

Time violation observed: 1705

What is the violation? TOILET NOT BEING MAINTAINED READY FOR USE.

Where is the violation located or observed? SOUTH MAIN - MMU-009

Who knew the violation existed? SAFETY + FIRE-MAN NOTED DIDN'T KNOW IT HAD TO BE READY FOR USE

How long has the violation existed? COULD NOT DETERMINE

How many people are exposed to the condition? 6

If an accident should occur how serious would it be?  No Lost Work days |  Lost Workday Or Restricted Duty |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood |  Unlikely  Reasonably Likely |  Highly Likely |  Occurred

Why? HUMAN WASTE BEING LEFT ON MINE FLOOR IF CONTACTED POSSIBLE EXPOSURE TO DISEASE.

Inspector Initials: MS

Page No 15

5-4-06

4476331

PRE-SHIFT / ON-SHIFT / BELTS / FIRE DRILL RECORD

STEVE RADMALL  
NONE

SOUTH MAINS - BELT

RECORDS - FIRE DRILL  
YEARLY FUNCTIONAL TEST  
AUTOMATIC WARNING FIRE  
SENSOR FUNCTIONAL TEST

MS TOF 5/8/06

Date 5-4-06

ARRIVED AT MINE -  
CONTACTED STEVE -  
CHECKED BOOKS -

TRAVELED TO X-MIN 15  
SOUTH MAINS -  
WALKED BELT - NO  
PROBLEMS OBSERVED AT  
TAILPIECE TO DRIVE -

CHECKED FIRE SUPPRESSION  
AT DRIVE -  
6 SPRAYS DID NOT HAVE  
SUFFICIENT WATER PRESSURE  
OR WERE PLUGGED KNOWING  
THAT THE STRAY CAPS

Inspector's Initials MS TOF 5/8/06  
Supervisor's Initials and Date Page No. 2

Date 5-4-06

WERE NOT BLOWING OFF  
OF SPRAYS - THAT LEAVE  
6 AREAS THAT WERE  
NOT SUFFICIENTLY COVERED  
HOWEVER THE SPRAYS ARE  
ONLY ABOUT 6 FEET APART  
BOTH SPRAYS OVER THE  
DRIVE MOTORS, BELT  
ROLLERS, AND GEAR BOXES  
DID OPERATE -

CITATION ISSUED 0720  
75.1101-1(a)

ROOT CAUSE - SYSTEM INC-  
STALLED CORRECTLY -  
WEEKLY VISUAL BOOK IS  
CURRENT

Inspector's Initials MS TOF 5/8/06  
Supervisor's Initials and Date Page No. 3

Date 5-4-06

CONDITION NOT RECAL-  
ZED -  
WILL CHECK YEARLY  
FUNCTIONAL TEST BOOK  
OUTSIDE -

HOW LONG OR WHO  
KNEW AT THIS POINT  
CANNOT BE DETERMINED

THE MAN WORKING ON  
THE SPRAY SYSTEM FOUND  
A LEAK IN THE HOSE  
BETWEEN THE DRIVE  
AND HEAD ROLLER SPRAY  
THAT PROBABLY ACCOUNTS

Inspector's Initials mf  
Supervisor's Initials and Date mf 5/8/06 Page No. 4  
GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054/20910

Date 5-4-06

FOR THE MALFUNCTION  
OF THE SPRAYS -  
THE BELT WAS REMOVED  
FROM SERVICE UNTIL  
CONDITION CORRECTED -

NO OTHER PROBLEMS  
OBSERVED ON BELT -

A SLOPPILY REPAIRED  
OVERCAST WALL AT X-CORNER  
90 BELT ENTRY WHERE  
A 4" PIPE GOES THROUGH  
WALL IS LEAKING AIR  
BACK INTO BELT ENTRY

Inspector's Initials mf  
Supervisor's Initials and Date mf 5/8/06 Page No. 5  
GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054/20910

Date 5-4-06

FROM SOUTH MAINS IN-  
TAKE -  
THE HOLE WAS REPAIRED  
WITH SPRAY FOAM WHICH  
HAS SHRUNK AND HAS  
LEFT GAPS - 2910  
CITATION ISSUED ~~2910~~  
75.333(h)

ROOT CAUSE -  
IMPROPER INSTALLATION  
COULD NOT DETERMINE  
HOW LONG CONDITION  
HAS EXISTED OR WHO  
KNEW -

THE LEAKING HOSE

Inspector's Initials mf  
Supervisor's Initials and Date mf 5/8/06 Page No. 6  
GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054/20910

Date 5-4-06

WAS REPLACED AND  
SPRAYS WERE CLEANED.  
THE SYSTEM WAS SET  
OFF AGAIN AND DID  
FUNCTION PROPERLY  
TEAM CIT. 0720

TRAVELED OUTSIDE -

CHECKED YEARLY FIRE  
SUPPRESSION DEVICE FUNCTION  
TEST RECORD -

THE SOUTH MAIN DRIVE,  
TAKEUP, & HEADROLLER  
DELUGE SYSTEM WAS  
LAST CHECKED 12-10-05

Inspector's Initials MS ATF 5/8/06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 7

Date 5-4-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustibile  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials MS  
Supervisors Initials and Date \_\_\_\_\_ Page No. 8

Date: 5-4-06  
Citation Number: 7282933  
Time violation observed: 0720

What is the violation? BELT FIRE DELUGE  
SYSTEM NOT PROPERLY  
FUNCTIONING CORRECTLY

Where is the violation located or observed? ~~ROOF~~  
SOUTH MAIN BELT DRIVE,  
TAKEUP

Who knew the violation existed? LAST FUNCTIONAL  
TEST 12-10-05

How long has the violation existed?: COULD NOT  
DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? 10 SPRAYS INADEQUATE  
IF WORKING CORRECTLY, BELT  
WET NO ACCUMULATIONS

Inspector Initials: MS Page No. 9

Date: 5-4-06

Citation Number: 7282934

Time violation observed: 0910

What is the violation? OVERCAST LEAKING  
FROM INTAKE TO BELT  
WHERE 4" PIPE GOES  
THROUGH IT

Where is the violation located or observed? X CUT  
90 SOUTH MAIN INTAKE  
TO BELT

Who knew the violation existed? COULD NOT  
DETERMINE

How long has the violation existed?: COULD NOT  
DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? NO HAZARD DUE TO  
VIOLATION

Inspector Initials: MJ

Page No 10

DAILY COVER SHEET

Date 5-15-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ON-SHIFT /

BELTS - BOTH MINES

Accompanied By: Company Representative \_\_\_\_\_

JACK MARINAS

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY

SOUTH MAIN - BELT  
#4 BELT  
} CRANWAL

Inspector's Initials ml TOP 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 5-15-06

ARRIVED AT MINE -

CONTACTED TIM PRUIT -

CHECKED BOOKS -

NOT WITH STAFF TO TRAVEL  
IN MINE, PRUIT HAS TO  
LEAVE PROPERLY -

TRAVELLED TO X-CUT 9D

SOUTH MAIN TO CHECK ON  
CITED CONDITION -

THE OVERCAST WALL HAS  
BEEN PROPERLY REPAIRED  
TEAM, CIT. - 0830

STARTED WALKING NO. 4  
BELT AT X-CUT 93

Inspector's Initials ml TOP 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 2

Date 5-15-06

TAILPIECE -

LOCAL ACCUMULATIONS ON  
TOP ROLLER ASSEMBLIES  
FROM TRANSFER OF SOUTH  
MAIN BELT TO X-CUT  
88 IN CONTACT WITH TURNING  
ROLLERS - 5 BOTTOM ROLLER  
TURNING IN CONTACT WITH  
ACCUMULATIONS BETWEEN  
88 + 89 X-CUT -  
1 MIDDLE TOP ROLLER X-  
CUT & 1 BEARING COMPLETELY  
GONE ROLLER TURNING  
ON SHAF IN CONTACT  
WITH OPERATING BELT

Inspector's Initials ml TOP 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

34

Date 5-15-06

ROLLER FRAME WARM TO TOUCH -

ACCUMULATIONS ON ROLLER ASSEMBLIES FROM X-CUT 90 TO 72 THESE X-CUTS ARE 150 FEET IN LENGTH WITH TIE ROLLERS EVERY 5' WITH ALMOST ALL MANUAL ACCUMULATIONS -

ANOTHER BOTTOM ROLLER IN CONTACT WITH ACCUM. X-CUT 72 -

ACCUMULATIONS AGAIN

Inspector's Initials ME OFF 5-30-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 4

Date 5-15-06

ON TOP ROLLER FRAMES WITH ROLLERS IN CONTACT BETWEEN 71 & 72 X-CUTS -

AT NO. 4 BELT-DRIVE & TAKEUP TESTED WATER DELUGE FIRE SUPPRESSION SYSTEM - 10 OF THE SPRAYS DID NOT BLOW THE RUBBER CAPS OFF OF THE SPRAY HEAD FOR THE SPRAYS TO FUNCTION PROPERLY -

CITATION ISSUED - 0925  
75.1101-1 (4)

AT DRIVE I INFORMED JACK THAT I WAS CIT-

Inspector's Initials ME OFF 5-30-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 5

Date 5-15-06

THIS BELT AND WENT OVER NOTES TO DETAIL WHY WITH HIM AND TOLD HIM IT NEEDED TO BE SHUT DOWN AND NOT PUT BACK IN SERVICE UNTIL CONDITIONS CORRECTED -

JACK CALLED OUT AND TOLD THEM TO TURN BELTS OFF AND NOT TO RUN THEM.

ACCUMULATIONS ON ROLLER FRAMES FROM X-CUT 90

Inspector's Initials ME OFF 5-30-06  
Supervisor's Initials and Date \_\_\_\_\_ Page No. 6

Date 5-15-06

TO HEADROLLER AT X-445  
 67 A TOTAL OF 23 X-CUTS  
 AT 150 FEET IS 3450  
 FEET WITH OVER 90%  
 OF TOP ROLLERS HAD  
 ACCUMULATIONS - ABOUT  
 601 ROLLERS WITH CONTACT  
 WITH ACCUMULATIONS - PLUS  
 THE 5 BOTTOM ROLLERS -  
 CITATION ISSUED 0925  
 ROOT CAUSE OF ACCUM.  
 CITATION -  
 DEFICIENT EXAM WITH  
 MAYBE CONDITION NOT  
 BEING RECOGNIZED -  
 COULD NOT DETERMINE

Inspector's Initials mf  
 Supervisor's Initials and Date OTF 5-30-06 Page No. 7  
 GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054:20910

Date 5-15-06

LENGTH OF CONDITION  
 OR WHO KNEW -  
 TALKED WITH JACK ABOUT  
 PROPER EXAMINATIONS -  
 ROOT CAUSE OF CITATION  
 ON FIRE DELUGE -  
 CONDITION NOT RECOGNIZED  
 WILL CHECK RECORD  
 BOOK OUTSIDE -  
 COULD NOT DETERMINE  
 HOW LONG CONDITION  
 WAS EXISTED OR WHO  
 KNEW -

Inspector's Initials mf  
 Supervisor's Initials and Date OTF 5-30-06 Page No. 8  
 GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054:20910

Date 5-15-06

PRE-SHIFT ON THIS BELT  
 AT BOOK AT HEADROLLER  
 WAS 5-15-06 5:23 AM  
 TRAVELED OUTSIDE -  
 CHECKED YEARLY EXAM  
 RECORD FOR NO. 4 BELT  
 DRIVE - IT WAS DONE  
 IN DECEMBER

Inspector's Initials mf  
 Supervisor's Initials and Date OTF 5-30-06 Page No. 9  
 GPO U.S. GOVERNMENT PRINTING OFFICE 2005-541-054:20910

MSHA Form 7000-10k, June 93 (revised)

Date 5-15-06

Except as previously noted, in all areas traveled during todays inspection, DT&I's sufficient and up to date. No low O<sub>2</sub> or CH<sub>4</sub> detected beyond normal range. Roof and Rib support appears adequate. Ventilation Controls in place, Air flowing in the proper direction and Velocities are adequate. Clean up and Rock Dust adequate with no combustible materials present. Fire suppression equipment in place as required.

Inspector Initials ms

Supervisors Initials and Date \_\_\_\_\_ Page No 10

\*U.S. Government Printing Office: 1995-609-287

Date: 5-15-06  
Citation Number: 7282937  
Time violation observed: 0925

What is the violation? ACCUMULATIONS IN CONTACT WITH ROLLERS BAD ROLLER

Where is the violation located or observed? CRANDALL NO. 4 BELT 90 X 100 FT TO 73

Who knew the violation existed? WAS NOT REPORTED ON PRE-SHIFT

How long has the violation existed?: COULD NOT DETERMINE

How many people are exposed to the condition? 7

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Duty  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? NO OF CONTACT POINTS AND NUMEROUS CONDITIONS COULD CAUSE BELT FIRE

Inspector Initials: ms Page No: 11

Date: 5-15-06  
Citation Number: 7282938  
Time violation observed: 0925

What is the violation? WATER FIRE DE-LUGGE SYSTEM WOULD NOT OPERATE PROPERLY

Where is the violation located or observed? CRANDALL NO. 4 BELT DRIVEN TAKEUP

Who knew the violation existed? CONDITIONAL WAS UNKNOWN - LAST CHECKED IN DEC. 05

How long has the violation existed?: COULD NOT DETERMINE

How many people are exposed to the condition? 7

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Duty  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? THIS BELT WAS ALSO CRED FOR ACCUMULATIONS & BAD ROLLER - CONDITIONS COMBINED COULD CONTRIBUTE TO FIRE

Inspector Initials: ms Page No. 12

DAILY COVER SHEET

Date 5-17-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked IRE-SHIFT / ON-SHIFT / BELTS

Accompanied By: Company Representative \_\_\_\_\_

STEVE RADMAU

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

#4 BELT

Inspector's Initials MS 070530-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 5-17-06

ARRIVED AT MINE - CONTACTED STEVE - CHECKED BOOKS -

TRAVELED INTAKE TO X-CUT 89 ENTER BELT ENTRY TO WALK FIRE CITATION TEAM -

WALKED TO No. 4 BELT DRIVE & TAKEUP - SET OFF WATER DELUGE FIRE SUPPRESSION SYSTEM - ALL PARTS OF SYSTEM FUNCTIONED PROPERLY -

TERM. CIT. - 0940

Inspector's Initials \_\_\_\_\_

Supervisor's Initials and Date 07053006 Page No. 2

Date 5-17-06

WALKED TO No. 4 BELT HEADROLLER - CONDITIONS HAVE BEEN CORRECTED TERM. CIT. - 0950

No. 3 BELT - LOOKS GOOD AT TIME OF EXAM, CLEAN, ROCKDUSTED, FIRE QUIETERS, CO JENDERS -

No. 2 BELT - NO PROBLEMS OBSERVED

TRAVELED OUTSIDE -

Inspector's Initials MS 07053006

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

38

MSHA Form 7000-10k, June 93 (revised)

Date 5-17-05

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place. Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date \_\_\_\_\_ Page No 4

\*U.S. Government Printing Office: 1995-609-287

DAILY COVER SHEET

Date 5-23-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ON-

SHIFT / BELTS

Accompanied By: Company Representative \_\_\_\_\_

CLARK ATWOOD

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

DC'S

CUTBY EQUIPMENT

NO 1 BELT -

ELECTRICAL MAP -

Inspector's Initials MS ATF 530-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 5-23-06

ARRIVED AT MINE -

CONTACTED CLARK -

CHECKED BOOKS -

CHECKED EIMCO 975 NO 4 -

EIMCO 975 NO 4 HAD A

1/4" PLATE SOMEONE HAD

PUT ~~BEHIND~~ BETWEEN THE

FILTER COVER AND THE

OPERATOR WHICH BLOCKED

THE DRY CHEMICAL FIRE

SUPPRESSION NOZZLE FOR

THE BATTERY - HAD THE

SYSTEM BEEN NEEDED

THE CHEMICAL COULD NOT

Inspector's Initials MS

Supervisor's Initials and Date ATF 530-06 Page No. 2

Date 5-23-06

HAVE DISCHARGED INTO

THE BATTERY AREA -

THE OPERATOR SAID MAYBE

SOMEONE HAD PUT IT THERE

TO DEFLECT THE HEAT

FROM THE FILTER COVER

AWAY FROM OPERATOR -

HE DIDN'T KNOW WHO

OR HOW LONG IT HAD

BEEN THERE, HE JUST

THOUGHT IT WAS PART

OF EQUIPMENT -

CITATION ISSUED 1530

75.1911(a)(4)

ROOT CAUSE -

IMPROPER INSTALLATION

Inspector's Initials MS ATF 530-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

40

Date 5-23-06

OF PLATE  
CONDITION NOT RECOGNIZED  
BY THE OPERATOR -

THE PLATE WAS REMOVED  
FROM MACHINE -  
TERM. CIT. - 1545

EIMCO 925 NO. 4 WAS  
BEING OPERATED ON  
NORTH MAINS INSTANCE  
ROADWAY

SOUTH MAINS -  
X-CUT 2  
No. 13 PC -

Inspector's Initials MS

Supervisor's Initials and Date

Page No. 4

Date 5-23-06

MAIN WEST X-CUT #8  
SWITCH GEAR NO. 4

X-CUT 69  
SWITCH GEAR NO. 8 -  
PC 19 -

X-CUT 49 -  
4 1/2" SILOX PRESSURE WASHER -  
PUMP & BOX NO. 5

X-CUT 44 -  
PC No. 9 -

X-CUT 40 -  
CAPACITOR BANK NO. 1  
SWITCH GEAR NO. 3

Inspector's Initials MS

Supervisor's Initials and Date

TRANSFORMER  
No. 1  
D. BOX No. 3

Page No. 5

Date 5-23-06

CHECKED ISUZU PICKUP  
NO. 23 -

HANDHELD FIRE EXTINGUISHER  
HAS NOT BEEN EXAMINED  
BY THE TAG SINCE JULY  
2005 -

CITATION ISSUED 1710  
75.1100-3

EXTINGUISHER EXAMINED ITEM 1715

SHARP EDGES EXIST ON  
TOP OF CAB FROM APPARENT  
CONTACT WITH ROOF -  
SHARP EDGES ON BOTH  
ENDS OF TAILGATE AND  
ACROSS TOP OF TAILGATE  
WITH BED CONTAINING

Inspector's Initials MS

Supervisor's Initials and Date

Page No. 6

Date 5-23-06

BAGGED ROCK DUST  
AND BELT MATERIAL  
THAT WERE NEEDED  
AND REACHED FOR EXPOSE  
PEOPLE TO THESE SHARP  
EDGES -

OPERATOR STATED THAT  
HE WAS AWARE OF  
SHARP EDGES BUT DIDN'T  
THINK THEY WERE A  
PROBLEM -

HE SAID HE HAD DONE  
A PRE-OP AND FILLED  
OUT CARD AND THAT  
IT WAS OUTSIDE -

CITATION ISSUED 1720

Inspector's Initials MS  
Supervisor's Initials and Date CTT 5-23-06 Page No. 7

Date 5-23-06

3<sup>rd</sup> NORTH X-CUT 4 -  
NO. 16 D-BOX -

X-CUT 15 -  
CHECKED BATTERY ROCK  
DUSTER & CHARGER -

2<sup>nd</sup> RIGHT  
X-CUT 0 NO. 14 PC -

3<sup>rd</sup> NORTH  
X-CUT 0 NO. 3 PC

MAIN WEST -  
X-CUT 29 PC NO 8 -  
X-CUT 24 SWITCHGEAR 7 -

Inspector's Initials MS  
Supervisor's Initials and Date CTT 5-23-06 Page No. 8

Date 5-23-06

MAIN WEST  
X-CUT 4 PC. NO. 4  
SWITCHGEAR NO. - 2

NO. 1 BELT

TAILPIECE - DRIVE/TAKEUP  
TO HEAD ROLLER - NO  
PROBLEMS OBSERVED -

CHECKED ELECTRICAL  
MAP LAST DATED  
2-22-06

MAP SHOWS BATTERY  
SCOOP CHARGER LOCATED

Inspector's Initials MS  
Supervisor's Initials and Date CTT 5-23-06 Page No. 9

42

Date 5-23-06

X-cut 14 3<sup>rd</sup> NORTH  
CHARGER ~~HAS~~ IS NOT  
THERE -

#14 POWER CENTER IS  
LOCATED AT O X-CUT  
2<sup>nd</sup> RIGHT MAP DOES  
NOT SHOW ANYTHING  
AT THAT LOCATION

MAP SHOWS AN ELECTRIC  
AIR COMPRESSOR IN  
X-CUT 15 OF 1<sup>st</sup>  
RIGHT GATE, THIS AREA  
WAS SEALED 11-12-05  
CITATION ISSUED - 1910

Inspector's Initials ms

Supervisor's Initials and Date 107 5300 Page No. 10

Date 5-23-06

TALKED WITH THE STOP  
TRUCK MECHANIC ABOUT  
THE VIOLATION OF SHARP  
EDGES ON THE MANTRIP

HAD WEEKLY CONFERENCES  
WITH CLARK.

Inspector's Initials ms

Supervisor's Initials and Date 107 5-30-06 Page No. 11

Date 5-23-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspector's Initials ms

Supervisors Initials and Date \_\_\_\_\_ Page No. 12

43

Date: 5-23-06  
Citation Number: 7282940  
Time violation observed: 1530

What is the violation? A DRY CHEMICAL  
FIRE SUPPRESSION NOZZLE  
BLOCKED FROM THE REQUIRED  
SPRAY AREA

Where is the violation located or observed? Emco  
975 no 4

Who knew the violation existed? OPERATOR SAID  
HE HAD NOT PUT PLACE THERE  
AND DIDN'T NOTICE IT BEING  
SPRAY

How long has the violation existed? COULD NOT  
DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dut.  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? IF FIRE OCCURRED AT  
BATTERY AND SYSTEM ENER-  
GIZED SPRAY COULD NOT GET  
TO BATTERY

Inspector Initials: MS

Page No 13

Date: 5-23-06  
Citation Number: 7283021  
Time violation observed: 1710

What is the violation? HANDHELD FIRE  
EXTINGUISHER NOT  
EXAMINED IN REQUIRED  
TIME SPAN.

Where is the violation located or observed? ISUZU  
PICKUP NO 23

Who knew the violation existed? OPERATOR SAID  
HE DIDN'T KNOW AND DIDN'T  
USUALLY OPERATE THAT VEHICLE

How long has the violation existed? UNCL- 1-06

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dut.  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? EXTINGUISHER WAS  
UNUSABLE

Inspector Initials: MS

Page No 14

Date: 5-23-06  
Citation Number: 7283022  
Time violation observed: 1720

What is the violation? SHARP EDGES IN  
SEVERAL LOCATIONS ON  
PICKUP

Where is the violation located or observed? ISUZU  
PICKUP NO 23

Who knew the violation existed? OPERATOR SAID  
HE KNEW OF CONDITION BUT  
DIDN'T THINK IT WAS A PROBLEM

How long has the violation existed? COULD NOT  
DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dut.  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? ANYONE IN OR ON  
CLOSE VICINITY COULD GET  
CUT

Inspector Initials: MS

Page No 15

Date: 5-23-06

Citation Number: 2283023

Time violation observed: 1910

What is the violation? ELECTRICAL MAP  
NOT KEPT CURRENT

Where is the violation located or observed? MAP AS  
WALK BY FOREMAN'S  
OFFICE

Who knew the violation existed? COULD NOT  
TALK TO ANYONE REGARDING  
GET FOR MAP

How long has the violation existed?: SINCE AT  
LEAST 11/12/05

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut:  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? PAPER VIOLATION NOT  
HAZARD AT PRESENT  
TIME

Inspector Initials: MS

Page No. 16

**West Ridge Resources, Inc.**  
**PO Box 1077**  
**Price, UT 84501**  
**(435) 888-4000**

**To:**  
Vendor No.: 1337  
UNITED CENTRAL INDUSTRIAL SUPP  
  
P.O. BOX 65402  
  
CHARLOTTE NC 28265-0402

**Ship To:**  
WEST RIDGE RESOURCES, INC.  
794 NORTH C CANYON ROAD  
  
EAST CARBON, UT 84520

**PO Number: 021279**  
**PO Date: 04/04/06**

Ship Via: 1 - Truck

Part #	Vendor Part #	Description	Quantity	Unit	Cost	Extended Cost
SR100		SELF RESCUER-SELF CONTAINED	200.0000	Each	650.0000	130,000.00

**Total: 130,000.00**

Approved by: DL 04/04/06  
Requested by: HUBERT 04/04/06  
Ordered by: JW 04/04/06

46



# UNITED CENTRAL INDUSTRIAL SUPPLY COMPANY, L.L.C.

MINING AND INDUSTRIAL SUPPLIES  
 1005 Glenway Ave • P.O. Box 8300  
 BRISTOL, VIRGINIA 24203-8300  
 PHONE (276) 466-0511  
 www.unitedcentral.net

PICK TICKET

PAGE 1

STATE VT	LOC. 81	CUSTOMER ORDER NO 21279	ORDER DATE 4/05/06	DELIVERY DATE	SLSM NO 81	CUST NO WES310	TICKET NO 709527	DATE 4/05/06	PICKING/INVOICE NUMBER 709527-00		
CODE	QTY ORDERED	PRODUCT CODE	DESCRIPTION			INIT/LOC.	U/M	QTY SHIPPED	QTY BACK ORDERED	UNIT PRICE	AMOUNT
2	200	090484	SR100 SCSR W/POUCH Q152000006 EM			C105	EA		200	650.000	.00
TAX ID #	EXTENDED AMOUNT	SALES TAX	SPECIAL CHARGES	PAY THIS AMOUNT ▶				TOTAL			
WESTRIDGE RESOURCES INC. 794 C CANYON ROAD EAST CARBON UT 84520			(SAME AS SOLD TO UNLESS INDICATED BELOW)		WESTRIDGE RESOURCES INC. P O BOX 1077 PRICE UT 84501						

14358884002

5-20-06; 2:04PM; WESTRIDGE OFFICE

CONTROL COPY

RECEIVED BY: \_\_\_\_\_

47

WESTRIDGE RESOURCES, INC.

PO Box 1077  
Price, UT 84501  
(435) 888-4000

To:  
Vendor No.: 1337  
UNITED CENTRAL INDUSTRIAL SUPP  
P.O. BOX 65402  
CHARLOTTE NC 28265-0402

Ship To:  
WEST RIDGE RESOURCES, INC.  
794 NORTH C CANYON ROAD  
EAST CARBON, UT 84520

PO Number: 021279  
PO Date: 04/04/06

Ship Via: 1 - Truck

Part #	Vendor Part #	Description	Quantity	Unit	Cost	Extended Cost
SR100		SELF RESCUER-SELF CONTAINED	200.0000	Each	650.0000	130,000.00

Total: 130,000.00

Approved by: DL 04/04/06  
Requested by: HUBERT 04/04/06  
Ordered by: JW 04/04/06

48



**Fairmont Supply Company**  
 401 Technology Drive  
 Canonsburg, PA 15317  
 (724) 514-3900 FAX (724) 261-5309

**ORDER ACKNOWLEDGEMENT**

UPC VENDOR	ACK DATE	ORDER NO.:
000000	03/09/06	1783067-00
	P.O. NO.	PAGE #
	20958	1

CUST.#: 29120000

SHIP TO: WESTRIDGE RESOURCES  
 794 N C CANYON ROAD  
 EAST CARBON, UT 84520 0000

CORRESPONDENCE TO: Fairmont Supply Company  
 401 Technology Drive  
 Canonsburg, PA 15317

BILL TO: WESTRIDGE RESOURCES  
 PO BOX 1077  
 ATTN: A/P  
 PRICE, UT 84501 0000

INSTRUCTIONS			
SHIP POINT	SHIP VIA	SHIPPED	TERMS
FAIRMONT SUPPLY - PRICE	Our Truck		NET 30 DAYS

LINE NO.	PRODUCT AND DESCRIPTION	QUANTITY ORDERED	QUANTITY S.O.	QTY SHIPPED	QTY U/M	UNIT PRICE	AMOUNT (NET)
1	1002977D ROPE LIF-LINE 1/4IN X 300FT CCAB 938 2-SPOOLS CCAB 938 2-SPOOLS PER BOX W/REFLECTIVE CONES SPACED EVERY 25-FT Cust PO Line #: 1 WITH BLUE REFLECTIVE TAPE	94			EA	82.65564	7769.63
2	1002977D ROPE LIF-LINE 1/4IN X 300FT CCAB 938 2-SPOOLS CCAB 938 2-SPOOLS PER BOX W/REFLECTIVE CONES SPACED EVERY 25-FT Cust PO Line #: 2 WITH RED REFLECTIVE TAPE	50			EA	82.65564	4132.78
3	60437746 HANGER LIFELINE 36-IN CCAB 991 50/BOX FORMERLY 991 50/BOX FORMERLY Cust PO Line #: 3	3500			EA	0.74400	2604.00
3	Lines Total		Qty Shipped Total	3644		Total Taxes Invoice Total	14506.41 906.65 15413.06

Last Page

49

DAILY COVER SHEET

Date 5-21-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / CHAIN-SHIFT / BELTS

Accompanied By: Company Representative \_\_\_\_\_

CLARK ATWOOD

Miners Representative ALONGE

AREAS OF INSPECTION ACTIVITY:

MAIN WEST SEAL -

1<sup>ST</sup> RIGHT SEALS

3<sup>RD</sup> NORTH MAINS

7<sup>TH</sup> RIGHT SEALS

6<sup>TH</sup> RIGHT SEALS

2<sup>ND</sup> RIGHT GATE

1<sup>ST</sup> RIGHT GATE

Inspector's Initials MR 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 1

Date 5-21-06

ARRIVED AT MINE -  
CONTACTED CLARK -  
WENT OVER MAP -

WHILE WALKING UP THE  
HILL TO BATHHOUSE WUZ  
PICKUP NO. 30 LOADED  
TO THE BACK OF THE  
BED WITH THE CREW  
WENT BY ME COMING  
OUT OF SOUTH CRANDALL  
WITHOUT USING ANY RES-  
TRAINS TO MAKE SURE  
THE MEN COULD NOT  
FALL OUT OF BED -  
ANGELO KANAKIS MET

Inspector's Initials MI 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 2

Date 5-21-06

ME ON THE HILL, I ASKED  
HIM IF HE HAD SEEN IT  
HE SAID YES AND GAVE ME  
THE PICKUP NUMBER, HE  
WENT TO TALK TO BOSS  
AND CREW -

CITATION NUMBER: 1440

HE CAME BACK AND  
SAID THAT THE BOSS  
AND CREW HAD BEEN  
TALKED TO AND THE  
CHAIN RESTRAINT FIXED  
TERM CIT. 1500

CHECKED BOOKS -

Inspector's Initials MR 5-30-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

Date 5-21-06

TRAVELED INTAKE MAIN WEST  
TO X-CUT 107 SEAL -  
2102 Oco O70 CH4

MAIN WEST SEALS -

- 1-20.9 02 Oco O70 CH4
- 2-20.9 02 Oco O70 CH4
- 3-20.9 02 Oco O70 CH4
- 4-20.9 02 Oco O70 CH4
- 5-20.9 02 Oco O70 CH4

LAST EXAM. 5-17-06

1<sup>ST</sup> RIGHT SEALS -

- 1-20.9 02 Oco O70 CH4
- 2-20.9 02 Oco O70 CH4
- 3-20.8 02 Oco O70 CH4

Inspector's Initials *MB*  
Supervisor's Initials and Date *MTT 5-30-06* Page No. *4*

Date 5-21-06

WALKED RETURN OUT TO  
X-CUT 91 MAIN WEST -

TRAVELED INTAKE TO 3<sup>RD</sup>  
NORTH MAINS -

7<sup>TH</sup> RIGHT OUTBY SEALS -

- 1-20.9 02 Oco O70 CH4
- 2-20.9 02 Oco O70 CH4

16<sup>TH</sup> RIGHT OUTBY SEALS -

- 1-20.9 02 Oco O70 CH4
- 2-20.9 02 Oco O70 CH4
- 3-20.9 02 Oco O70 CH4

2<sup>ND</sup> RIGHT GATE SEALS -

- 1-20.9 02 Oco O70 CH4

Inspector's Initials *MB*  
Supervisor's Initials and Date *MTT 5-30-06* Page No. *5*

Date 5-21-06

- 2-20.9 02 Oco O70 CH4
- 3-20.8 02 Oco O70 CH4

1<sup>ST</sup> RIGHT GATE SEALS -

- 1-20.9 02 Oco O70 CH4
- 2-20.9 02 Oco O70 CH4
- 3-20.9 02 Oco O70 CH4

WALKED BACK TO MAIN  
WEST RETURN X-CUT 32

COULD NOT CATCH UP WITH  
MANTRIP NO. 30 - SB DID  
NOT DO A TALK WITH CREW.

ROOT CAUSE ACCORDING

Inspector's Initials *MB*  
Supervisor's Initials and Date *MTT 5-30-06* Page No. *6*

Date 5-21-06

TO ANGELO KONAKIS THE  
CREW KNEW BETTER JUST  
DIDN'T TAKE TIME TO  
CORRECT CONDITION -

COULD NOT DETERMINE  
HOW LONG CONDITION  
HAD EXISTED -

NEEDS TO BE CITED UNDER  
25.1403-6(4) BUT NEED  
TO CHECK WITH DENVER  
THE MANTRIP CAME OUT  
OF SOUTH CRANDALL AND  
WAS PARKED IN UNDER-  
GROUND PARKING LOT

Inspector's Initials ML  
Supervisor's Initials and Date ATF 53006 Page No. 7

Date 5-21-06

CRANDALL MINE -  
MANTRIP IS USED IN  
BOTH MINES AND NEITHER  
MINE HAS SAFE GUARD  
FOR THIS CONDITION

TOLD CLARK FITWOOD  
THAT SAFE GUARD WOULD  
BE FORTHCOMING

Inspector's Initials ML  
Supervisor's Initials and Date ATF 53006 Page No. 8

Date 5-21-06

Except as previously noted, in all  
areas traveled during today's  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place. Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspector's Initials MS  
Supervisors Initials and Date \_\_\_\_\_ Page No. 9

Genwal Resources, Inc  
PO Box 1077  
Price, UT 84501  
(435) 888-4000

To:  
Vendor No.: 1337  
UNITED CENTRAL INDUSTRIAL  
SUPPLY COMPANY, L.L.C.  
P.O. BOX 8300  
BRISTOL VA 24203

Ship To:  
Genwal Mine  
Milepost 33  
State Highway 31  
Huntington, UT 84528

PO Number: 170412  
PO Date: 04/21/06

Ship Via: 1 - Truck

Part #	Vendor Part #	Description	Quantity	Unit	Cost	Extended Co
SR-100		SCSR UNIT	150.0000	Each	650.0000	97,500.00
516000		<del>REFLECTIVE STRIP - WHITE</del>	<del>50.0000</del>	<del>Each</del>	<del>3.7000</del>	<del>185.00</del>
537474		<del>REFLECTIVE STRIP - RED</del>	<del>50.0000</del>	<del>Each</del>	<del>3.7000</del>	<del>185.00</del>

*150 more this page*

*Total order 400 units*

97,500

Approved by: JM  
Requested by:  
Ordered by: CG

04/21/06  
04/21/06

Total: 97,870.00

~~Handwritten signature~~

53

Genwal Resources, Inc  
PO Box 1077  
Price, UT 84501  
(435) 888-4000

To:  
Vendor No.: 1337  
UNITED CENTRAL INDUSTRIAL  
SUPPLY COMPANY, L.L.C.  
P.O. BOX 8300  
BRISTOL VA 24203

Ship To:

PO Number: 169011  
PO Date: 03/08/06

Ship Via: 1 - Truck

Part #	Vendor Part #	Description	Quantity	Unit	Cost	Extended Co:
090487		NYLON CASES FOR SCE SR-100	25.0000	Each	17.0000	425.0
091225		LEATHER CASES FOR CSE SR-100	20.0000	Each	38.4700	769.4
		SCSR: SR100	15.0000	Each	650.0000	9,750.0
		SCSR: SR100	235.0000	Each	650.0000	152,750.0
		SCSR-100 TRAINING UNITS	10.0000	Each	282.0000	2,820.0

250 Total this page

Approved by:  
Requested by:  
Ordered by:

03/08/06  
03/08/06

Total: 166,514.40

59

**Genwal Resources, Inc**  
PO Box 1077  
Price, UT 84501  
(435) 888-4000

To:  
Vendor No.: 1294  
FAIRMONT SUPPLY COMPANY  
PO BOX 643438  
PITTSBURGH PA 15264-3438

Ship To:  
Genwal Mine  
Milepost 33  
State Highway 31  
Huntington, UT 84528

PO Number: 169013  
PO Date: 03/08/06

Ship Via: 1 - Truck

Part #	Vendor Part #	Description	Quantity	Unit	Cost	Extended Cost
		LIFE LINE	30.0000	Each	156.4560	4,693.68
		SPLIT CONE KITS	14.0000	Each	97.8000	1,369.20

*Life Lines for intake*  
*30 - 1680 foot lengths*

Approved by: JM  
Requested by:  
Ordered by: CG

03/08/06  
03/08/06

Total: 6,062.88

55

DAILY COVER SHEET

Date 5-30-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ALL -  
SALES / BELTS

Accompanied By: Company Representative \_\_\_\_\_

STEVE RADMALL

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

SURFACE

Inspector's Initials ms

Supervisor's Initials and Date TA 6-5-06 Page No. 1

Date 5-30-06

ARRIVED AT MINE -  
CONTACTED STEVE -  
~~XXXXXXXXXXXX~~

CHECKED WITH DAVE MORGAN  
(CRACKER) ABOUT NUZU PICKUP  
NO. 23 -

PICKUP IS TALKED OUT FOR  
MATERIAL ORDERED WHICH  
SOME HAS ARRIVED, SOME  
HASNT ARRIVED -

WILL EXTEND CITATION  
TO 6-5-06 AT 0700

WHILE CHECKING ON  
PARTS AT WAREHOUSE

Inspector's Initials ms

Supervisor's Initials and Date \_\_\_\_\_ Page No. 2

Date 5-30-06

OBSERVED NUZU PICKUP  
COME ACROSS YARD AND  
PARK BY WAREHOUSE WITH  
A MAN SITTING ON SEAT  
ON PASSENGER SIDE, PICKUP  
DOES NOT HAVE A DOOR  
ON PASSENGER SIDE, THERE  
IS A HAPHAZARD CHAIN  
ON DOOR FRAME BUT  
EMPLOYEE WAS NOT USING  
IT TO KEEP HIMSELF FROM  
FALLING OUT UNTIL HE  
SEEN ME AND REACHED  
FOR IT BUT DIDNT GET  
IT HOOKED -

CHAIN IS HOOKED TO

Inspector's Initials W OFF 6/12-06

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

Date 5-30-06

FIRE SUPPRESSION BOTTLE LOOSELY WHICH IF NEEDED WOULD NOT KEEP PERSON FROM FALLING OUT -

I INFORMED STEVE THAT I WOULD NOT ACCEPT CHAIN ATTACHED THAT WAY -

CITATION ISSUED O8C5

TALKED WITH BOTH EMPLOYEES ABOUT THEIR RESPONSIBILITY FOR PERSONNEL SAFETY

SUZUKI PICKUP NO. 36

Inspector's Initials ml Date 5-11-06  
Supervisor's Initials and Date VA 6-5-06 Page No. 4

Date 5-30-06

THE ~~IS~~ HANDHELD FIRE EXTINGUISHER HAD NOT BEEN EXAMINED AND PUNCHED SINCE JUNE OF 05 -

CITATION ISSUED O820

THE PICKUP WAS TAKEN OUT OF SERVICE UNTIL RESTRAINT ON PASSENGER SIDE REPAIRED -

ROOT CAUSE OF BOTH VIOLATIONS IS NEW MINERS PROBABLY NOT

Inspector's Initials ml Date 5-11-06  
Supervisor's Initials and Date VA 6-5-06 Page No. 5

Date 5-30-06

TRAINED ADEQUATELY TRAINED - AND NOT RECOGNIZING CONDITIONS -

CHECKED BOOKS - PRE-SHIFT GENERAL MINING FOR THE DAY SHIFT ON 5-28-06 4AM TO 630 AM WAS CONDUCTED BY TWO EXAMINERS AND THE BOOK FILLED OUT BY BOTH BUT ONLY 1 FILLED THE PRE-SHIFT REPORT -

CITATION ISSUED O850

Inspector's Initials ml Date 5-11-06  
Supervisor's Initials and Date VA 6-5-06 Page No. 6

Date: 5-30-06

INFORMED STEVE RADMALL THAT ANY FURTHER BOOK VIOLATIONS WOULD BE MARKED HIGH NEGLIGENCE DUE TO AMOUNT WRITTEN UP TO NOW -

CHECKED ELECTRICAL MAP FOR CRANDALL - MAP HAS BEEN UPDATED - TERM CIT. - 0905

THE HANDHELD FIRE EXT. ON PICKUP 36 WAS REPAIRED TERM. CIT. 0830

Inspector's Initials ML  
Supervisor's Initials and Date TA 6-5-06 Page No. 7

Date: 5-30-06  
Citation Number: 7283024  
Time violation observed: 0805

What is the violation? EMPLOYEE RIDING IN PICKUP WITH DOOR REMOVED AND NO RESTRAINTS TO KEEP HIM FROM BEING THROWN FROM VEHICLE

Where is the violation located or observed? ON SURFACE TRAVELING TO MINE

Who knew the violation existed? EMPLOYEE KNEW HE SHOULD HAVE USED CHAIN

How long has the violation existed? FEW MINUTES

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut.  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? TOO MANY DOORS & JACKETS HAVE BEEN REMOVED - PEOPLE ARE NOT USING CHAINS AND HIGH POTENTIAL FOR INJURY

Inspector Initials: ML Page No. 8

Date: 5-30-06  
Citation Number: 7283025  
Time violation observed: 0820

What is the violation? HANDHELD FIRE EXTINGUISHER NOT EXAMINED AND TAG PLACED IN DENIED TIME PERIOD.

Where is the violation located or observed? USED PICKUP NO. 36

Who knew the violation existed? OPERATOR HAD NOT OPERATED EQUIPMENT

How long has the violation existed? 5 MONTHS

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut.  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? EXTINGUISHER WAS UNABLE

Inspector Initials: ML Page No. 9

Date: 5-30-06

Citation Number: 7283026

Time violation observed: 0850

What is the violation? PRE-SHIFT RECORD NOT FILLED BY EXAMINER

Where is the violation located or observed? PRE-SHIFT BOOK -

Who knew the violation existed? HAD NOT BEEN CAUGHT BY COUNTER NUMBER

How long has the violation existed? 2 days

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely  Occurred

Why? PAPER VIOLATION

Inspector Initials: MS TA 6-5-06

Date: 5-30-06

Citation Number: 7283029

Time violation observed: 1305

What is the violation? FIRE EXT NOT EXAMINED IN REQUIRED TIME PERIOD.

Where is the violation located or observed? WUZU PICKUP NO. 39

Who knew the violation existed? OPERATOR OF VEHICLE HAD NOT NOTICED CONDITION.

How long has the violation existed? 2 MONTHS

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely  Occurred

Why? EXT WAS OTHERWISE WORKABLE

Inspector Initials: MS

Date: 5-30-06

Citation Number: 7283030

Time violation observed: 1325

What is the violation? INADEQUATE PRE-OP ON PICKUP

Where is the violation located or observed? WUZU PICKUP NO. 36

Who knew the violation existed? OPERATOR HAD NOT NOTICED CONDITION

How long has the violation existed? 2 MONTHS

How many people are exposed to the condition? 2

If an accident should occur how serious would it be?  
 No Lost Work days |  Lost Workday Or Restricted Dut |  Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely |  Reasonably Likely |  Highly Likely  Occurred

Why? FIRE EXT NOT EXAMINED BUT WORKABLE

Inspector Initials: MS

Date: 5-31-06

Citation Number: 72\*3031

Time violation observed: 0455

What is the violation? EMPLOYEES NOT  
RESTRAINED FROM BEING  
TROWN FROM VEHICLES

Where is the violation located or observed? WUZU  
PICKUP NO 32

Who knew the violation existed? PASSENGERS  
IN VEHICLE

How long has the violation existed? Few minutes

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?

No Lost Work days |  Lost Workday Or Restricted Dut  
 Permanently Disabling |  Fatal

What is the likelihood this type of accident will occur at this mine?

No Likelihood |  Unlikely |  Reasonably Likely  
 Highly Likely |  Occurred

Why? EMPLOYEES EXPOSED TO  
FALLING FROM MOVING  
VEHICLES


Inspector Initials: ms

Page No. 1

TA6-5-06

Evaluation for J. KOMAR Date 6-1-06  
 Serial Number 1734 Mine CRANDALL Trial # 1  
 Tape (Y or N)      Type of Unit CSE 100

1. Connect the dots in the diagram below to show the steps the trainee took in donning the SCSR. If a step was started but not finished, dip the line toward the step. Do not touch the dot if the step was not completed or was done incorrectly.

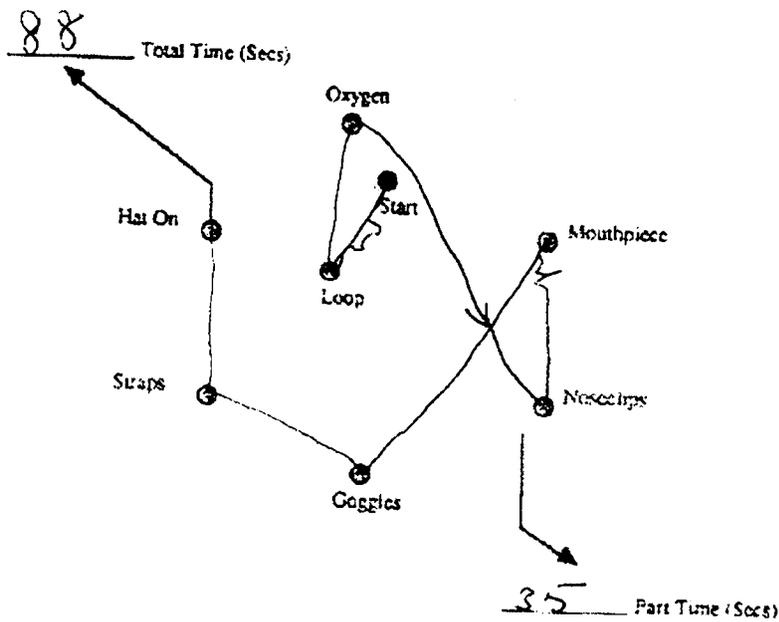

2. After the task is completed, please list any errors that need to be corrected and then review these errors with the trainee.


WRONG SEQUENCE - FROM START HE TRIED TO  
UNLATCH OXYGEN FIRST INSTEAD OF LOOP AROUND  
NECK - THEN WENT TO NOSE CLIPS INSTEAD  
OF MOUTHPIECE FIRST AFTER THAT WENT  
SMOOTH

07.00

*JA*

Evaluation for R. BAEZA Date 6-1-01  
 Serial Number 1015151 Mine CRANDALL Trial # 2  
 Tape (Y or N) \_\_\_\_\_ Type of Unit CSE 100

1. Connect the dots in the diagram below to show the steps the trainee took in donning the SCSR. If a step was started but not finished, dip the line toward the step. Do not touch the dot if the step was not completed or was done incorrectly.

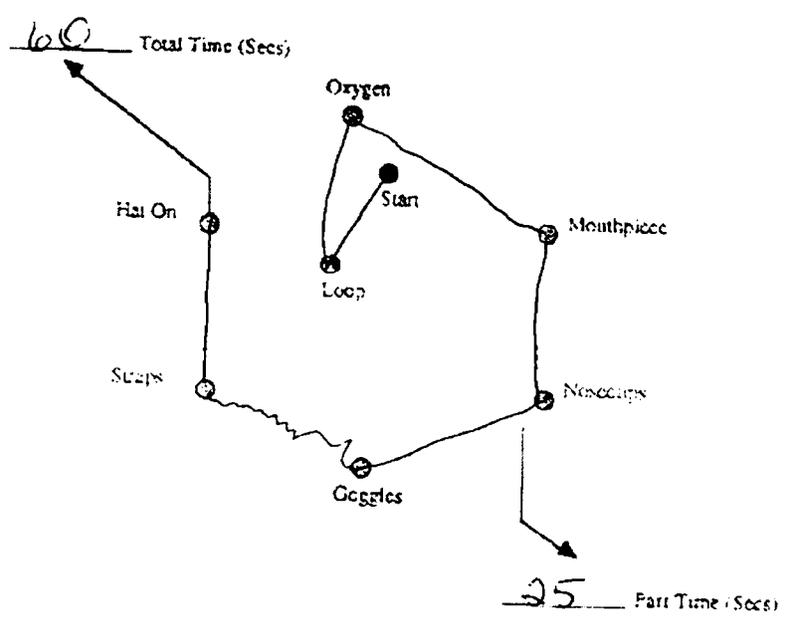


2. After the task is completed, please list any errors that need to be corrected and then review these errors with the trainee.

DIDN'T PUT STRAPS ON - HAD TO FUMBLE  
WITH THEM THEN COMPLETED STRAPS

Evaluation for OLSEN  
 Date 6-1-01  
 Serial Number 101515 I Mine CRANDALL Trial # 3  
 Tape (Y or N) \_\_\_\_\_ Type of Unit CSF 100

1. Connect the dots in the diagram below to show the steps the trainee took in donning the SCSR. If a step was started but not finished, dip the line toward the step. Do not touch the dot if the step was not completed or was done incorrectly.

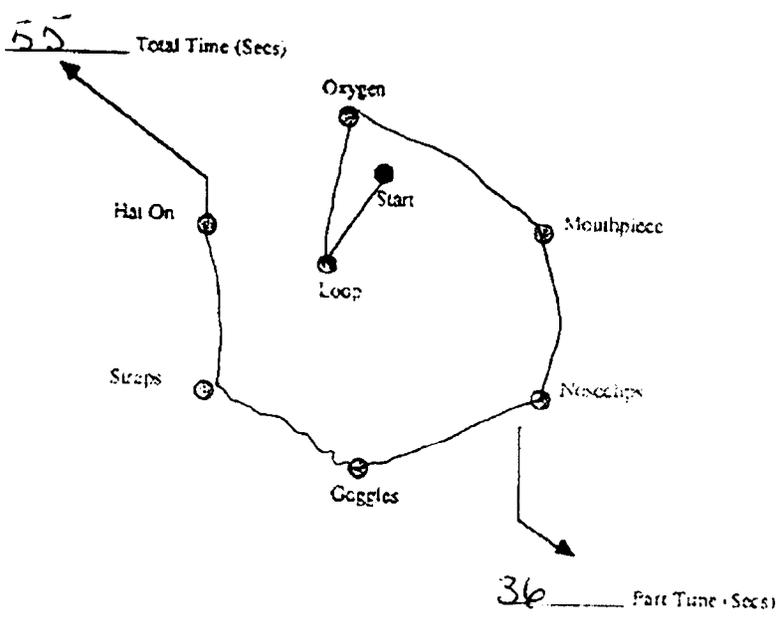

2. After the task is completed, please list any errors that need to be corrected and then review these errors with the trainee.

SEAL STRAP STUCK - QUICKLY TOOK CARE OF  
PROBLEM -  
SHORT WAIST STRAP STUCK UNDER HAIR  
CAUSED SHORT DELAY -

Date 6-1-06

SECTION AND WHEN  
ADDITIONAL JCIP'S ARE  
RECEIVED LOCATION WILL  
BE DETERMINED BY  
LOCATION FROM SURFACE  
TO SECTION -

THE CRANDALL FAN W/IT  
THE BLADES ON CRANDALLS  
CANNOT GO IN MINE YET -

CHECKED RECORDS -

1- SURFACE LOW MED  
VOLTAGE MONTHLY CIRCUIT  
BREAKER TEST -

2- SURFACE MONTHLY

Inspector's Initials MB

Supervisor's Initials and Date MB 6-5-06

Page No. 4

Date 6-1-06

- 1- ELECTRICAL EQUIP TEST -
- 2- SURFACE MONTHLY HIGH VOLTAGE CIRCUIT BREAKER -
- 3- UNDERGROUND MONTHLY TEST OF CIRCUIT BREAKERS
- 4- UNDERGROUND WEEKLY EXAMINATION OF ELECTRICAL EQUIP. -
- 5- YEARLY TEST OF FIRE HYDRANTS, FIRE VALVES, FIRE HOSES -
- 6- SPOKING ARTICLE SEMINA
- 7- 90 DAY JCIP INSP. -
- 8- MINE RESCUE MEDICAL FITNESS & TRAINING -
- 9- DAILY FAN EXAM -

Inspector's Initials MB

Supervisor's Initials and Date MB 6-5-06

Page No. 5

Date 6-1-06

CHECKED SIFT BOOKS -  
THE FRESH AIR 5-28-06  
WAS SIGNED BY SECOND EX-  
AMINER AND HE WAS TALKED  
TO BY COMPANY -  
TERM. CIT. - 0920

TRAVELLED AHEAD TO 1<sup>ST</sup>  
SOUTH -  
ENTERED BLEEDER -

MP 2 - 850 QUANTITY

3 1/2 E. No. 1 REG. 5235

4 1/2 E. No. 2 REG. 10,164

MAINFAN 1 MP1 - 20,675

3<sup>RD</sup> DEPT MP2 - 3152

Inspector's Initials MB

Supervisor's Initials and Date MB 6-5-06

Page No. 6

DAILY COVER SHEET

Date 6-1-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked REL-SHIFT / REL

JAMES / BELLS

Accompanied By: Company Representative \_\_\_\_\_

STEVE RADMALL

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

MINERS ARTICLE CHECKS

3 EMPLOYEES DONNING SCJR'S

BOOKS - SEE NOTES

Inspector's Initials MS TFH/ea

Supervisor's Initials and Date TS 6-5-06 Page No. 1

Date 6-1-06

ARRIVED AT MINE - CONTACTED STEVE -

OBSERVED MINERS ARTICLE CHECKS LAMPROOM -

WENT 3 MINERS AND HAD THEM DO THE SCJR DONNING - TALKED IN DETAIL ABOUT DONNING, EVACUATION THINK, CHECK SENSES, HEARING, SMELL -

CATCHER UNDERGROUND HAVE NOT YET BEEN

Inspector's Initials MS TFH/ea

Supervisor's Initials and Date TS 6-5-06 Page No. 2

Date 6-1-06

ESTABLISHED INTAKE & RETURN DUE TO MFG. SHORTAGE AT TIME - ADDITIONAL SCJR'S HAVE BEEN ORDERED

4 CREWS HAVE BEEN THROUGH DONNING & ESCAPE - SOME DONNED LWE UNITS SOME TRAINERS -

LOCATION OF CATCHES HAVE NOT YET BEEN DETERMINED - MINE HAS ONLY ONE PILLAR

Inspector's Initials MS TFH/ea

Supervisor's Initials and Date \_\_\_\_\_ Page No. 3

65

Date 6-1-06

3<sup>rd</sup> WEST MP 2 - 726  
1<sup>st</sup> WEST MP 3 - 34,608

TRAVELED OUTSIDE -

ISUZU PICKUP NO 23 HAS  
HAD THE CAP ROOF SKIN  
REMOVED AND REPLACED  
WITH SHEET METAL -  
TERM CUT 1230

Inspector's Initials my

Supervisor's Initials and Date TAK-5-06 Page No. 7

Date 6-1-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials my

Supervisors Initials and Date \_\_\_\_\_ Page No. 7

Mine Name Carmichael Canyon Mine ID 42-01715



Seal Location (Name of Set of Seals)	Enter number of seals for each set in these columns.						Last Inspection Date	Comments
	Standard (Mitchell) Seals	Omega Seals	Micon Seals	Pumpable Seals	Wooden Seals	Other		
Main North intake Seals. Total 15					15			
Old Main East Seals Total 4					4			
1st Right <sup>Gate</sup> Seals. 3 Total						strata 3		
2nd Right <sup>Gate</sup> Seals 3 Total						strata 3		
Main North Bleeder Seals (Panel 227) 4 Total			4					
6th West Seals 3 Total						strata 3		

Mine Name

Randall Canyon

Mine ID

42-01715

AA 6-23-06



Seal Location (Name of Set of Seals)	Enter number of seals for each set in these columns.						Last Inspection Date	Comments
	Standard (Mitchell) Seals	Omega Seals	Micon Seals	Pumpable Seals	Wooden Seals	Other		
7th West 2 Total						strata 2		
X-cut 45+46 Main West 2 Total			2					
X-cut 67 intake 1 Total			1					
1st East 3 Total					3			
2nd East 3 Total					3			
8th West 3 Total			3					

Mine Name Mitchell Camp

Mine ID 42-01715



Enter number of seals for each set in these columns.

Seal Location (Name of Set of Seals)	Standard (Mitchell) Seals	Omega Seals	Micon Seals	Pumpable Seals	Wooden Seals	Other	Last Inspection Date	Comments
9th West 3 Total			3					
X-cut 107 1 Total			1					
X-cut 118 Main West 5 Total						strata 5		
1st Right 107-cut 3 Total			3					
1st North 4 Total					4			

DAILY COVER SHEET

Date 6-13-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ON:

SHIFT / BELTS

Accompanied By: Company Representative \_\_\_\_\_

ANGELO KONAKIS - SHIFT FOREMAN

Miners Representative ACONTE

AREAS OF INSPECTION ACTIVITY:

SEAL INSPECTION

Inspector's Initials ms AT THE MINE

Supervisor's Initials and Date (21) 6-23-06 Page No. 1

Date 6-13-06

ARRIVED AT MINE -

CONTACTED JIM BRUNO -

ANGELO WILL TRAVEL WITH ME -

CHECKED BOOKS -

TRAVELED TO SOUTH MAINS -

2<sup>nd</sup> EAST SEALS - WOOD BLOCK

1-20.9.02 Dec 0% CH4

2-20.9.02 Dec 0% CH4

3-20.9.02 Dec 0% CH4

DTI - 6-13-06

9<sup>th</sup> WEST SEALS -

1-20.9.02 Dec 0% CH4

2-20.9.02 Dec 0% CH4

Inspector's Initials ms

Supervisor's Initials and Date (21) 6-23-06 Page No. 2

Date 6-13-06

3-20.9.02 Dec 0% CH4

DTI 6-13-06

1<sup>st</sup> EAST SEALS - WOOD BLOCK

3-20.8.02 Dec 0% CH4

2-20.8.02 Dec 0% CH4

1-20.9.02 Dec 0% CH4

DTI 6-13-06

8<sup>th</sup> WEST SEALS -

1-20.8.02 Dec 0% CH4

2-20.8.02 Dec 0% CH4

3-20.8.02 Dec 0% CH4

DTI - 6-7-06

Inspector's Initials ms

Supervisor's Initials and Date (21) 6-23-06 Page No. 3

Date 6-13-06

MAIN WEST x-cut 107 -

1-20.9oz 0co 0%CH4  
DTI - 6-7-06

MAIN WEST x-cut 118 -

1-20.8oz 2co 0%CH4  
2-20.8oz 2co 0%CH4  
3-20.8oz 2co 0%CH4  
4-20.5oz 2co 0%CH4  
5-20.8oz 2co 0%CH4  
DTI - 6-7-06

MAIN WEST x-cut 107

20.8oz 2co 0%CH4

Inspector's Initials ms  
Supervisor's Initials and Date (1) 6-23-06 Page No. 4

Date 6-13-06

DTI - 6-7-06

MAIN WEST x-cut 106

20.8oz 3co 0%CH4  
DTI - 6-7-06

MAIN WEST x-cut 105

20.8oz 2co 0%CH4  
DTI - 6-7-06

MAIN WEST x-cut 67

20.9oz 0co 0%CH4  
DTI - 6-13-06

Inspector's Initials ms  
Supervisor's Initials and Date (1) 6-23-06 Page No. 5

Date 6-13-06

1<sup>st</sup> NORTH SEALS - WOOD BLOCK

1-20.7oz 3co 0%CH4  
2-20.6oz 3co 0%CH4  
3-20.5oz 3co 0%CH4  
4-20.4oz 3co 0%CH4  
DTI - 6-7-06

NORTH MAINS x-cut 46

20.9oz 0co 0%CH4  
x-cut 45

20.9oz 0co 0%CH4  
DTI - 6-13-06

Inspector's Initials ms  
Supervisor's Initials and Date (1) 6-23-06 Page No. 6

Date 6-13-06

3<sup>rd</sup> NORTH MAINS 7<sup>th</sup> RIBBT

1-20.9.02 Oco 0% CH<sub>4</sub>

2-20.9.02 Oco 0% CH<sub>4</sub>

6<sup>th</sup> RIBBT

1-20.9.02 Oco 0% CH<sub>4</sub>

2-20.9.02 Oco 0% CH<sub>4</sub>

3-20.9.02 Oco 0% CH<sub>4</sub>

2<sup>nd</sup> RIBBT GATE

1-20.9.02 Oco 0% CH<sub>4</sub>

2-20.9.02 Oco 0% CH<sub>4</sub>

3-20.9.02 Oco 0% CH<sub>4</sub>

Inspector's Initials ml

Supervisor's Initials and Date DL 6-23-06 Page No. 7

Date 6-13-06

1<sup>st</sup> RIBBT GATE

1-20.9.02 Oco 0% CH<sub>4</sub>

2-20.9.02 Oco 0% CH<sub>4</sub>

3-20.9.02 Oco 0% CH<sub>4</sub>

TRAVELED OUTSIDE

Inspector's Initials ml

Supervisor's Initials and Date DL 6-23-06 Page No. 8

Date 6-13-06

Except as previously noted, in all areas traveled during today's

inspection, DT&I's sufficient and up to date. No low O<sub>2</sub> or CH<sub>4</sub>

detected beyond normal range.

Roof and Rib support appears

adequate. Ventilation Controls

in place, Air flowing in the proper direction and Velocities are

adequate. Clean up and Rock Dust

adequate with no combustible

materials present. Fire suppression

equipment in place as required.

Inspector's Initials MS

Supervisor's Initials and Date DL 6-23-06 Page No. 9

72

MSHA Form 7000-10k, June 93 (revised)

Date 6-14-06

Except as previously noted, in all  
areas traveled during todays  
inspection, DT&I's sufficient and  
up to date. No low O<sub>2</sub> or CH<sub>4</sub>  
detected beyond normal range.  
Roof and Rib support appears  
adequate. Ventilation Controls  
in place, Air flowing in the proper  
direction and Velocities are  
adequate. Clean up and Rock Dust  
adequate with no combustible  
materials present. Fire suppression  
equipment in place as required.

Inspectors Initials MS

Supervisors Initials and Date MS Page No 7

•U.S. Government Printing Office: 1995 -609-287

DAILY COVER SHEET

Date 6-14-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ONE -  
SHOES / BELTS

Accompanied By: Company Representative \_\_\_\_\_

STEVE RADMALL

Miners Representative - NONE

AREAS OF INSPECTION ACTIVITY:

SOUTH MAINS mmu-009  
MRS PERMITS -  
ROCK DUST SPOT  
JCSR'S

Inspector's Initials ms 6-14-06

Supervisor's Initials and Date DL 6-23-06 Page No. 1

Date 6-14-06

ARRIVED AT MINE -  
CONTACTED STEVE -  
OBSERVED DANA LYONS  
CREW (6) RECEIVING SCSR  
DONNING TRAINING WITH  
CHANGING FROM ONE TO  
THE OTHER WHILE WORKING.

CHECKED BOOKS -

TRAVELLED INTAKE TO SOUTH  
MAINS -

SECTION PULLING FENDERS -  
PERMITS - ON MRS'S -  
#5 -

Inspector's Initials ms

Supervisor's Initials and Date DL 6-23-06 Page No. 2

Date 6-14-06

#6 -  
#8 -  
#7 -

SPOT ROCK DUST SAMPLES -  
#2 X-CUT NO.1 ENTRY  
NO. 2 "  
#3 NO. 3 "  
NO. 4 "  
NO. 5 "

JCSR'S CHECKED - CSE 100'S  
108705 10-04  
59922 7-98  
100072 10-03  
112633 02-05

Inspector's Initials ms

Supervisor's Initials and Date DL 6-23-06 Page No. 3

74

Date 6-14-06

126472 03-06  
94805 08-02

SCSR CACHE -

X-CUT WEST MAINS

CSE 100's -

50020 2-97  
58903 1-98  
50082 2-97  
62409 8-98  
49988 2-97  
50056 2-97  
50071 2-97  
50087 2-97

Inspector's Initials MS

Supervisor's Initials and Date MS 6-23-06 Page No. 4

Date 6-14-06

4th WEST SEALS -  
3-20.802 Oco O70CHY  
2-20.802 Oco O70CHY  
1-20.902 Oco O70CHY

3rd WEST SEALS -

3-20.802 Oco O70CHY  
2-20.902 Oco O70CHY  
1-20.802 Oco O70CHY

2nd WEST SEALS -

3-20.902 Oco O70CHY  
2-20.802 Oco O70CHY  
1-20.802 Oco O70CHY

Inspector's Initials MS

Supervisor's Initials and Date MS 6-23-06 Page No. 5

Date 6-14-06

1st WEST SEALS -  
6-20.802 Oco O70CHY  
5-20.802 Oco O70CHY  
4-20.802 Oco O70CHY  
3-20.802 Oco O70CHY  
2-20.802 Oco O70CHY  
1-20.802 Oco O70CHY

TRAVELED OUTSIDE -

Inspector's Initials MS

Supervisor's Initials and Date MS 6-23-06 Page No. 6

75

DAILY COVER SHEET

Date 6-23-06 Event No 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ONE -  
SHIFT

Accompanied By: Company Representative \_\_\_\_\_

STEVE RADMALL

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

SURFACE

Inspector's Initials ms

Supervisor's Initials and Date FM 6/23/06 Page No 1

Date 6-23-06

ARRIVED AT MINE -  
CONTACTED STEVE -  
CHECKED BOOKS -

CHECKED MINITRAC -  
MACHINE HAS BEEN CLEANED  
TERM CIG - 0710

CHECKED WITH PICKUP  
MECHANIC ONISUZU A030  
HAS HAD WIRE IRON  
WELDED ON TOP OF RED  
RAIL AND HAD A TAIL GATE  
PUT ON -  
TERM, BOTH SAFEGUARDS  
0730

Inspector's Initials ms

Supervisor's Initials and Date FM 6/23/06 Page No 2

Date 6-23-06

CHECKED TRUCK SHOP -  
CHECKED MAINTENANCE  
SHOP -

CHECKED WAREHOUSE -  
CONSPEC -  
CONFERENCE ROOM -

LOWER BATHHOUSE -  
CHECKED COMPRESSED  
GAS BOTTLE STORAGE -

CHECKED EXPLOSIVE &  
CAP MAGAZINE -

CHECKED BULK ROCK DUST -

Inspector's Initials ms

Supervisor's Initials and Date FM 6/23/06 Page No 3

76

Date 6-23-06

CHECKED SUBSTATION -

CHECKED UNDERGROUND  
BATHHOUSE AND OFFICES -

CHECKED CRANDALL FAN,  
FAN CHART AND DAILY  
EXAM. RECORDS -

SILO FEED BELT FROM  
NO. 1 BELT -

SILO FEED BELT HEADHOUSE  
LIGHTING IS OUT - SOMEONE  
HAS TAKEN THE COVER  
LOOSE AND DISCONNECTED

Inspector's Initials hw

Supervisor's Initials and Date TH C 3566 Page No. 4

Date 6-23-06

THE WIRES COME TO  
THE LIGHT - THIS HEAD-  
HOUSE HAS TWO BELT  
HEADROLLERS - AND NUMER-  
OUS OTHER MOVING PARTS  
AND IS VERY DARK IN-  
SIDE - ANYONE COMING  
INTO HEADHOUSE IS EXPOSED  
TO NUMEROUS POSSIBLE HAZ-  
ARDOUS CONDITIONS AND  
EVEN IN DAYTIME INSIDE  
OF HEADHOUSE IS VERY  
DARK WITHOUT THE LIGHT  
WORKING -

CITATION ISSUED - O&SO

Inspector's Initials hw

Supervisor's Initials and Date TH C 3566 Page No. 5

Date 6-23-06

CHECKED TRUCK LOADOUT  
BELT -

CRUSHER BLDG -

RECLAIM BELT -

CHECKED LOADALL 508-40  
FORKLIFT -

CHECKED TRANSFORMER FOR  
CRUSHER BLDG -

CHECKED MEC ROOM FOR  
CRUSHER BLDG -

CHECKED POWER WIRING -

Inspector's Initials hw

Supervisor's Initials and Date TH C 3566 Page No. 6

Date 6-23-06

CHECKED ISUZU SURFACE  
PICKUP -

CHECKED DIESEL FUEL SOURCE -  
AWE -

CHECKED KOMATSU LOADER  
W/450 -

BACKUP LIGHTS DO NOT  
FUNCTION WHEN MACHINE  
PLACED IN REVERSE -

CITATION ISSUED - 0955

KOMATSU LOADER -  
OIL ACCUMULATIONS ON  
ENGINE LEFT SIDE - ON

Inspector's Initials MP

Supervisor's Initials and Date SA 6-23-06 Page No. 7

Date 6-23-06

STARTER INCLUDING POWER  
CABLE CONNECTIONS -  
CITATION ISSUED - 1010

THE BACKUP LIGHTS WERE  
RECHECKED AND DO FUNCTION  
NO CITATION -

KOMATSU LOADER -  
LEFT SIDE OF ENGINE  
COMPARTMENT HAS ONE  
DOOR MISSING WITH A  
PIECE OF EXPANDED METAL  
TAKING THE PLACE OF  
THE DOOR - THE EXPANDED

Inspector's Initials MP

Supervisor's Initials and Date SA 6-23-06 Page No. 8

Date 6-23-06

METAL IS ONLY SECURED  
ON THE TOP EDGE -  
AND IS BENT OUT AWAY  
FROM MACHINE LEAVING  
AN OPENING 18" X 30"  
WITH ALTERNATOR, FAN,  
AND BELT EXPOSED -  
CITATION ISSUED -

1015

CHECKED PUSH CAT -

TALKED WITH THE ELECT-  
RICIAN ABOUT THE LIGHT  
IN THE BLD HEADHOUSE

Inspector's Initials MP

Supervisor's Initials and Date SA 6-23-06 Page No. 9

Date 6-23-06

IT IS WIRED IN WITH ALL THE OTHER LUMPS ON RAISED CATWALK - TALKED WITH JACK MARINES AND TOLD HIM THAT BECAUSE HEADHOUSE IS DARK INSIDE EVEN WITH THE SUN SHINING THE HEADHOUSE IS GOING TO HAVE TO BE LIGHTED - HE SAID THEY WOULD GET AN ELECTRICAL CON- TRACTOR TO LIGHT THE INSIDE OF HEADHOUSE -

Inspector's Initials ms

Supervisor's Initials and Date EM 6/23/06 Page No. 10

Date: 6-23-06

Citation Number: 7283047

Time violation observed: 0850

What is the violation? WORK AREA NOT ADEQUATELY LIGHTED

Where is the violation located or observed? SILO FEED BELT HEADHOUSE

Who knew the violation existed? CONDITION CREATED WHEN HEADHOUSE WAS ENCLOSED

How long has the violation existed? ABOUT A YEAR

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  No Lost Work days  Lost Workday Or Restricted Dut  Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

Why? DARK (VERY) WITH NUMEROUS HAZARDS INCLUDING TRIPPING

Inspector Initials: ms Page No. 10

Date: 6-23-06

Citation Number: 7283048

Time violation observed: 1015

What is the violation? MOVING PARTS OF ENGINE NOT PROPERLY GUARDED

Where is the violation located or observed? ROMATCH LOADER WA 450 LOADER ON SURFACE

Who knew the violation existed? COULD NOT DETERMINE

How long has the violation existed? COULD NOT DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  No Lost Work days  Lost Workday Or Restricted Dut  Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

Why? MOVING BLADES BELTS AND ALTERNATOR EXPOSED

Inspector Initials: ms Page No. 11

Date: 6-23-06

Citation Number: 7283049

Time violation observed: 1010

What is the violation? Oil Accumulations  
on Engine Components

Where is the violation located or observed? KOMATSU  
LOADER WAY 450 SURFACE

Who knew the violation existed? COULD NOT  
DETERMINE

How long has the violation existed?: COULD NOT  
DETERMINE

How many people are exposed to the condition? 1

If an accident should occur how serious would it be?  
 No Lost Work days  Lost Workday Or Restricted Dur  
 Permanently Disabling  Fatal

What is the likelihood this type of accident will occur at this mine?  
 No Likelihood  Unlikely  Reasonably Likely  
 Highly Likely  Occurred

Why? CONDITION COULD CAUSE  
MACHINE FIRE EXPOSING  
OPERATOR TO INJURY OR  
DEATH.

Inspector Initials: mg

Page No: 12

IN CASE

DAILY COVER SHEET

Date 6-27-06 Event No. 4476331

Arrived at the Mine \_\_\_\_\_ Departed from the Mine \_\_\_\_\_

List Records Books Checked PRE-SHIFT / ON-SHIFT / BELTS

Accompanied By Company Representative \_\_\_\_\_

GARY PEACOCK

Miners Representative NONE

AREAS OF INSPECTION ACTIVITY:

SURFACE

CROSSEDT

Inspector's Initials MS

Supervisor's Initials and Date Tom Gifford Page No. 1

Date 6-27-06

ARRIVED AT MINE -  
CONTACTED STEVE BARNAL -  
CHECKED BOOKS -

WALKED TO SILO HEAD -  
HOUSE - ECI CONTRACTORS  
REQUIRED LIGHT SO IT  
WILL STAY ON ALL THE  
TIME -

TERM CIT. 0800

CHECKED THE KOMATSU  
HEADER -  
THE EXPANDED METAL  
GUARDRAIL HAS BEEN RE-  
PLACED WITH A HATCHED

Inspector's Initials MS

Supervisor's Initials and Date Tom Gifford Page No. 2

Date 6-27-06

DOWN -  
TERM CIT. 0820

THE OIL ACCUMULATIONS  
ON THE KOMATSU EXHAUST  
HAVE BEEN CLEANED  
OFF -

TERM CIT. 0830

CHECKED OIL STORAGE -  
CHECKED DIESEL STORAGE -

COAL HAUL TRUCKS -  
KERWIN JENSEN

127 -  
105 -  
100 -

Inspector's Initials \_\_\_\_\_

Supervisor's Initials and Date Tom Gifford Page No. 3

81

Date 6-27-07

114 -

119 -

97 -

HAD CLOSEOUT WITH  
JACK MARINOS -  
GARY PEACOCK -  
STEVE RADMALL -

REVIEWED CERTIFIED &  
QUALIFIED LIST

Inspector's Initials MB

Supervisor's Initials and Date PC 6/27/07

Page No 4



Mine Activity Data

1. Action: a. New Entry  b. Update  2. Activity Code: E01 3. Event Number: 4476331  
 4. Date Event Started: 4/3/2006 5. Date Event Finished: 6/28/2006 6. Mine ID: 42-01715  
 7a. Organization Code (Mine Assignment): 20905 b. Work Group Identifier: 01 9. Company Name: GENWAJ. RESOURCES INC  
 8a. Organization Code (AR Assignment): 20905 b. Work Group: 01 10. Mine Name: CRANDALL CANYON MINE  
 11. Report Type (check): a. First  b. Interim  c. Last  d. Not Applicable   
 c. Outby Areas  d. Shafts/Slopes  e. Surface Areas (UG)  f. Surface Workings  g. Company Records  h. ATF   
 k. Major Construction  (1) Shaft/Slope Sinking: 0 (2) Impoundment Construction: 0 (3) Buildings: 0 (4) Dragline/Shovel: 0 (5) Other: 0  
 12. Area of Inspections: a. Active Sections: 1 b. Idle Sections: 0  
 i. Impoundments: 0 j. Refuse Piles: 0  
 13. Number of Samples Collected: a. Air Samples: 1 b. Rock Dust Spot: 5 c. Rock Dust Survey: 0 d. Respirable Dust: 1 e. Noise: 0 f. Other: 0  
 14. Impoundments/Refuse Piles: a. Number: b. FHC: c. Configuration:  
 15. Prime Independent Contractor Codes (Major Construction):  
 16. Inspection Results:

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
<b>a. This Inspection</b>								
(1) New Issuances	23				1			
(2) Terminations/Vacations	23							
(3) Modifications/Extensions	3							
(4) Left Pending	0				1			
<b>b. Previously Issued</b>								
(1) Modifications/Extensions	0							
(2) Terminations/Vacations	0							

18. Signature and Card Number of Authorized Representative/  
 Right of Entry Person(s) Responsible for Activity

**Signature** Card Number: 23807

17. Remarks:

19. Key Entered By: Date: 6/28/2006

Shift	Sun			Mon			Tue			Wed			Thur			Fri			Sat		
	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3
Week 1 4/2/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 2 4/9/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 3 4/16/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 4 4/30/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 5 5/14/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 6 5/21/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 7 5/28/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 8 6/11/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 9 6/18/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 10 6/25/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

MSHA Form 7000-10H, June 93 (revised)

**GENERAL INFORMATION COVER SHEET**

Inspection Code E01 Event No. 4476331

Company Name GENERAL RESOURCES INC.

Mine Name CANDALL CONYON MINE

Mine I.D. Number 42-01715

Date(s) of Mine File Review 4-3-06

D Status NO Citation/Order No. \_\_\_\_\_ Date \_\_\_\_\_

Dates of Inspection: began 4-3-06 completed \_\_\_\_\_

Pre-Inspection Conference Date 4-7-06

Company Representative(s) JACK MARINOS, BOBIE ALBED, JIM PRUITT, STEVE RADMAL

Miner Representative(s) ALBIE

Post-Inspection Conference Date 6-27-06

Company Representative(s) JACK MARINOS -

Miner Representative(s) ALBIE

Comments: \_\_\_\_\_

Inspector's Initials MS Supervisor's Initials and Date MS 6/25/06

U.S. Government Printing Office: 1997 - 508-470

Mine Information Form

Page 1

Mine Safety and Health Administration



New	All fields are required
Change	The Mine ID Number is required, otherwise fill out only those fields that have changed

1. MSHA Mine ID Number: 42-0117115      2. Operating Company Name: \_\_\_\_\_

3. Mine or Mill Name: CRANDALL CANYON

3a. Mine Emergency Phone No: \_\_\_\_\_      4. Type of Operation: Coal  Metal/Non-Metal       5. Portable Operation       6. Primary Mine Type: Underground  Surface  Facility

7. MSHA Office Code: \_\_\_\_\_      8a. Work Group \_\_\_\_\_      8b. Travel Area \_\_\_\_\_      9. Nearest Town, Landmark, or Post Office: \_\_\_\_\_

10. County Name Where Mine is Located: \_\_\_\_\_      11. State Abbreviation \_\_\_\_\_      12. Cong. Dist. (Coal Only) \_\_\_\_\_      13. Mileage from Field Office: \_\_\_\_\_

14. Directions to Operation from Field Inspection Office: \_\_\_\_\_

15. Total Employees: \_\_\_\_\_      16. Schedule of Operation: a. Hours per Production Shift \_\_\_\_\_ b. Production Shifts per Day \_\_\_\_\_ c. Maint. Shifts per Day \_\_\_\_\_ d. Work Days per Week \_\_\_\_\_

17. Longitude and Latitude: (Coal Only) a. Longitude: Degrees \_\_\_\_\_ Minutes \_\_\_\_\_ Seconds \_\_\_\_\_      b. Latitude: Degrees \_\_\_\_\_ Minutes \_\_\_\_\_ Seconds \_\_\_\_\_

18. Mine Status: New Mine  Active  Intermittent  Non-Producing  Abandoned  Temporarily Idle (Coal Only)  Abandoned & Sealed (Coal Only)

19. Status Date (mm/dd/yyyy): \_\_\_\_\_ / \_\_\_\_\_ / \_\_\_\_\_

20. Types of Minerals being Extracted or Processed:

a. Primary Commodity \_\_\_\_\_ Secondary Commodity (Optional) \_\_\_\_\_  
c. Other Commodities (Optional) \_\_\_\_\_

21. Mine Characteristics: a. Applicable to ALL Mines (check all that apply)  
Auger  Dredge  Laboratory  Mill/Prep Plant/Loading Dock  Open Pit/Strip  Shop or Yard  Remaining Cull Bank/Refuse Pile/Tailings

b. Applicable to Coal Mines Only: Highwall Miner   
c. Applicable to Metal and Non-metal Mines Only: Adit  Block Caving  Cut and Fill  Dimension  Quarry  Longwall   
Shaft  Slope  Heap Leaching  In-situ Leaching  Room and Pillar

22. Other Mine Information: a. Applicable to All Mines (check all that apply)  
103(l) Status: Ignition  Hazard  6 Day  10 Day  15 Day  Removed  Date Entered 103(l) Status: (mm/dd/yyyy) \_\_\_\_\_  
Explosives Used  Explosives Stored on Surface  Explosives Stored Underground  Treasury Permit License   
Government Owned  Government Operated  Mine Rescue Station at Mine  Safety Committee at Mine  Methane Liberation \_\_\_\_\_ 0.03 cubic ft / 24 hrs

b. Applicable to Coal Mines Only: No. of Producing Pits \_\_\_\_\_ No. of Non-Producing Pits \_\_\_\_\_ No. of Drift Openings \_\_\_\_\_ No. of Slope Openings \_\_\_\_\_ No. of Shaft Openings \_\_\_\_\_ Avg. Daily Coal Production 10,000 tons  
Primary Coal Bed Name \_\_\_\_\_ Avg. mine Height (inches) \_\_\_\_\_ Surface Mines: CH4/O2 Tests Required

c. Applicable to Metal and Nonmetal Mines Only: Mine Gas Category: \_\_\_\_\_ Number of Impoundments: \_\_\_\_\_ No. of Escapeways to Surface: \_\_\_\_\_ No. of Hoists: \_\_\_\_\_ No. of Refuse Chambers: \_\_\_\_\_  
Associated Cement Mill  Kins  Electrowinning as Part of Milling  Produces Ground Silica as a Product  Hazardous Waste Burned as Fuel  Channel Burners  Wire Saws   
Metal Refinery as Part of Milling  Retort  Roaster  Mechanical Ventilation for Underground Mine  Natural Ventilation for Underground Mine

85



1. MSHA Office 0905-01 2. Mine ID 42-01715

3. Mine Name CRANDALL CANYON 4. Company Name \_\_\_\_\_

Roof Control

Adequate

Deficiencies In Plan  
(Briefly Describe)

Ventilation

Adequate

Deficiencies In Plan  
(Briefly Describe)

Inspector Signature

Date

Supervisor Signature

Date

**Signature**

6-28-06

**Signature**

G. J. FOX

Report of Violations

16  
 87

**Instructions**

Please write firmly with a ball point pen when completing this form. ATF officers will prepare this form in triplicate. The original copy will be given to the proprietor or a responsible representative. The remaining copies will be submitted with the completed inspection report. Supervisors will detach one copy from the completed report for their files.

Name of Proprietor <b>GENERAL RESOURCES</b>	Street Address	City	State	ZIP Code	County	Page <u>1</u> of <u>1</u> Pages
License/Permit/Registry Number (if any)	Expiration Date	Date(s) or Period of Inspection <b>10-23-06</b>		<b>Signature</b>		

**Inspection Results**

An examination of your premises, records and operations has disclosed the following violations which have been explained to you:

Number	USC or CFR Citation	Nature of Violation	Corrective Action to be Taken (If not corrected immediately)	Date Corrections to be Made (If not corrected immediately)
		<b>No VIOLATIONS ISSUED THIS INSPECTION</b>		

921.DAT

0&110

0(s4B

UNITED STATES DEPARTMENT OF LABOR  
MSHA LABORATORIES - MOUNT HOPE, WEST VIRGINIA  
ANALYSIS OF AIR SAMPLES

0(s0B

Mine: CRANDALL CANYON MINE  
Company: GENWAL RESOURCES INCORPORATED

Mine ID: 4201715  
Inspector: M. SHUMWAY

Date(s) collected: 04/13/2006  
Office: 905

BOTTLE NUMBER	LOCATION IN MINE	CARBON DIOXIDE	OXYGEN	METHANE	ETHANE	CUBIC FEET AIR PER MINUTE	CUBIC FEET METHANE IN 24 HOURS
M4656	100FT INBY RETURN FAN	0.080	20.75	0.000	0.000	224305	0

THE PERCENTAGE OF NITROGEN CAN BE DETERMINED BY SUBTRACTING THE SUM OF THE REPORTED VALUES FROM 100.00

15

Rec. 05/08/2006  
0&100

PAGE: 1

0&110

0(s4B

UNITED STATES DEPARTMENT OF LABOR

28

**Rock Dust Sample Submission Form**

**U.S. Department of Labor**  
 Mine Safety and Health Administration

*0,04*

Spot		Survey	
Collector michael earl shumway (23807)		Field Office Price, UT	
Inspector Email Shumway.Michael@DOL.GOV		Supervisor Email Farmer.Ted@DOL.GOV	
Clerk Email Beacco.Alice@DOL.GOV		Manager Email Davis.Allyn@DOL.GOV	
Mine ID 42-01715	Mine CRANDALL CANYON MINE	Company GENWAL RESOURCES INC	
Event Number 4476331	MMU #1 009-0 (A)	Super-Section No	MMU #2 -
Date Collected 06-14-2006		Zero Point x-cut 12	
Sampling Area x-cut 12/ 1,2,3,4,5 entries South Mains		Collector's Comments	

Advancing  
Retreating

Lab Number	Bag Number	Sample Type	Location in Mine	Intake/Return	Handheld CH4	Bottle No. (If App.)	Bottle Analysis	Dust Analysis	Required	Compliant
696460	1	Rib	x-cut 12 no.1 entry	1	0.0			92.6	65	Yes
696461	2	Rib	x-cut 12 no.2 entry	1	0.0			87.5	65	Yes
696462	3	Rib	x-cut 12 no.3 entry	1	0.0			84.2	65	Yes
696463	4	Rib	x-cut 12 no. 4 entry	1	0.0			82.1	65	Yes
696464	5	Rib	x-cut 12 no. 5 entry	1	0.0			94.6	65	Yes

For Laboratory Use Only

Date Received 06-28-2006	Lab Numbers 696460 to 696464	Date Emailed 07-18-2006
Lab Comments		

**SURVEY IS  
COMPLIANT**

*89*

(b) (7)(C)

*01/04	100748WR			8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*01/04	102121	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*7/98	61372						
*11/03	97083	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*7/98	59922	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/05	112647	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*10/04	106245	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*02/05	112662				11/2-4/05	2/1-8/06	3/6-9/06
*2/04	102623	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*8/04	101349	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*01/02	89628	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*10/04	109186	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	12/2/2004	3/6-9/06
*6/03	97342	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*6/04	105664	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/04	102613	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*8/03	98498	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/05	111000	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/04	102646	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*3/05	113550	NEW		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*11/03	100813	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*3/05	113523	NEW				2/1-8/06	3/6-9/06
*2/05	112655					new	3/6-9/06
*3/04	103181	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*10/04	108789	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*9/04	107331	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/04	101965	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*7/04	105959	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/05	110904	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*3/05	113549	NEW					
*2/05	112699	NEW				2/1-8/06	3/6-9/06
*7/98	61304	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/04	102634	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	49988	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	50020	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	50056	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	50071	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	50082	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/97	50087	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*8/98	62409	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*11/03	97383	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*11/03	100596	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*11/05	107915	NEW			11/2-4/05	2/1-8/06	3/6-9/06
*01/02	89655	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*8/01	86974	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*6/04	105644	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/04	101884	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*6/04	105608	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*8/04	101384	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*10/04	108781	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/05	110928	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*03/05	113524	NEW				2/1-8/06	3/6-9/06
*06/03	97687	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*6/04	108719	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*2/05	112647	6/6/2005		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/05	110974	new	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*10/04	108705	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
*1/05	110972	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06

(b) (7)(C)

7/04	105919	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101227	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	100878	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	97079	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
1/05	110944	new	5/9/2005	8/8-9/2005			
8/04	101238	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
7/04	105988	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
09/01	87903	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
7/98	61390	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
2/04	102635	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101359	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/97	52079	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	97385	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
1/05	110986	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
3/05	113563	NEW					
6/03	99296	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101352	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
03/05	113544	NEW				2/1-8/06	3/6-9/06
7/98	61929	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108717	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	97386	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
01/02	90952	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	100130	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	109181	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
7/04	105978	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
1/05	110946	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
4/00	75003	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
01/05	110913	new	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
2/05	112643						3/6-9/06
01/05	110945	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108729	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/03	98514	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108787	new	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/03	100643	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101262	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
4/03	98841	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108460	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
01/05	110996	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	106269	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
6/04	105567	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	97361	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
6/03	97398	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
7/04	105961	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
02/04	102636	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
02/05	112652	NEW		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
12/04	110632	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
1/00	73551	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
9/04	107231	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
12/04	110774	NEW		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108706	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
2/04	102648	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
02/01	79888			8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
11/03	100868	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/04	108799	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101387	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
3/04	103156	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
10/03	100072	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06

(b) (7)(C)

"12/04	110760	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
	109985	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"11/00	80847	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
	54756	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	113591	NEW					
"7/04	105953	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	113518	NEW					
"11/03	100913	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"8/98	62686	2/16/2005					
"5/97	53803	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	108794	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101319	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101204	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	106219	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/97	50023	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"8/03	98261	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"12/04	110730	new		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	113557	NEW					3/6-9/06
"9/04	107009			8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/04	101863	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	109141	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"02/05	112633	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"11/03	100887	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101261	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102627	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102622	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"02/97	50040	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/04	105958	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/01	83107	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	105649	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	109211	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	107370	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/04	101929	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/05	110926	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"03/05	113530	NEW				2/1-8/06	3/6-9/06
"10/04	109210	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/98	61295	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"5/03	97006	9/16/2005			11/2-4/05	2/1-8/06	3/6-9/06
"11/03	97362	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/05	112634	new			11/2-4/05	2/1-8/06	3/6-9/06
"10/97	55579	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"9/04	107308	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/05	111972	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101164	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	108733	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/05	110920	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"03/05	113565	NEW			11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102612	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
8/04	101360	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/98	58896	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102617	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"4/03	98829	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	108771	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
	88828	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	113531	NEW					
"2/97	49995	2/16/2005					

(b) (7)(C)

"7/04	105803	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/98	61251	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/04	105902	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/04	102135	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"5/03	97602	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"01/05	110903	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102620	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/04	105956	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	113508	NEW			11/2-4/05	2/1-8/06	3/6-9/06
"01/05	110943			8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/02	91662	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"11/02	95949	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"6/03	99488	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/02	91832	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/00	71930	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	107622	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:8/04	101292	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/05	110957	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"11/03	100812	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"12/03	102060	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/98	60357	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:8/04	101216	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"8/03	94805	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"5/05	113517	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"6/04	105637		5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/02	95023	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/97	54077	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:8/04	101245	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"9/04	107312	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/05	112773						3/6-9/06
"1/05	110907	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"9/04	107311	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/05	"113551	6/6/2005		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"6/03	98101	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	109230	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:8/04	101251	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"12/03	102006	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/05	112668					new	3/6-9/06
"11/03	100888	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:6/04	105537	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"2/04	102630	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/98	61275	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/98	58903	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/04	105967	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/97	56863	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/98	61283	2/16/2005					
"2/04	102619	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	
"12/04	110783	NEW		8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"1/05	110977	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"9/04	107364	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"7/04	105921	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"10/04	108703	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"9/04	107390	NEW	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
:8/04	101222	2/16/2005	5/9/2005	8/8-9/2005	11/2-4/05	2/1-8/06	3/6-9/06
"3/06	126477						NEW
"3/06	126479						NEW

Diesel Equipment Inventory

U.S. Department of Labor  
Mine Safety and Health Administration



Mail To 	Approval and Certification Center P.O. Box 251, RR No. 1 Industrial Park Boulevard Triadelphia, WV 26059  (Attn: Mine Equipment Branch)		Attention—For additional information contact the "Mine Equipment Branch" at (304) 547-0400 or (F TS) 723-1417.	
	1. Verify Type (check one) <input type="checkbox"/> Active Machine <input type="checkbox"/> Delete Machine		2. Date Prepared 6-28-06	
3. Name of Inspector M. SHUMWAY		4. AR Number 23807		5. Field Office ID 0405-01
6. Mine Name CRANDALL CANYON		7. Mine ID 42-01715		
8. Equipment Approval Number (if applicable)		9. Equipment Manufacturer		
10. Equipment Model Number		11. Equipment Type		
12. Serial Number		13. Date Manufactured		
14. Engine Manufacturer		15. Engine Model		
16. Machine Features (check type(s) applicable)				
<input type="checkbox"/> Methane Monitor <input type="checkbox"/> 2G Electrical Components <input type="checkbox"/> Rail-Mounted				
17. Type of Mine (check one)				
<input type="checkbox"/> Coal <input type="checkbox"/> Metal/Nonmetal				
18. Comments:				
NO NEW EQUIPMENT THIS QUARTER				

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 04/11/2006	2. Time (24 Hr. Clock) 0900	3. Citation/ Order Number 7282925
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A permanent splice in the trailing cable for Joy shuttle car no.9 had the tape and splice boot with worn off surfaces down to the exposed inner leads of the trailing cable. No exposed wires could be observed. All electrical connections or splices in insulated wire shall be reinsulated at least to the same degree of protection as the remainder of the wire.

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.514
--------------	--	----------------------	--

See Continuation Form (MSHA Form 7000-3a)

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001		
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action	104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>				
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment						

16. Termination Due	A. Date Mo Da Yr 04/11/2006	B. Time (24 Hr. Clock) 1000
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The splice covering was cut off and replaced.

18. Terminated	A. Date Mo Da Yr 04/11/2006	B. Time (24 Hr. Clock) 0940
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form established enforcement enforcement  
Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has regional Fairness Boards to receive comments from small businesses about federal agency each agency's responsiveness to small business. If you wish to comment on the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 04/11/2006	2. Time (24 Hr. Clock) 0930	3. Citation/ Order Number 7282926
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715
8. Condition or Practice		(Contractor) 8a. Written Notice (103g) <input type="checkbox"/>

The Stamler feeder located on South Mains mmu-009 company no. 2919 was observed with accumulations of oil and oil soaked coal. A fitting was leaking on the off walkway side and oil was leaking from the tram valve bank. The accumulations were on the frame and no ignition sources were in contact with accumulations.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.400
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No

D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 04/11/2006	B. Time (24 Hr. Clock) 1300
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established enforcement enforcement  
Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has 10 Regional Fairness Boards to receive comments from small businesses about federal agency rules each agency's responsiveness to small business. If you wish to comment on the Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue)	Mo Da Yr 04/11/2006	3. Citation/ Order Number	7282926 - 01
4. Served To Clark Atwood - Safety			5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

The gap on the controller cover was closed.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date	Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------	----------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476331
-----------------------	-----	------------------	---------

**Signature**

AR Number	12. Date	Mo Da Yr	13. Time (24 Hr. Clock)
23807		04/12/2006	0700

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 04/11/2006	3. Citation/ Order Number 7282926 - 02
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Change From To

8. Condition Or Practice

Reason Wrong condition addressed on first termination.

Termination should have read leaks were repaired and feeder cleaned.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331	
AR Number 23807	12. Date Mo Da Yr 04/12/2006	13. Time (24 Hr. Clock) 1205

**Signature**

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration

7-14-06  


Section I--Violation Data

1. Date Mo Da Yr 04/11/2006	2. Time (24 Hr. Clock) 1000	3. Citation/ Order Number 7282927
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

The controller cover on the Long Airdox battery scoop company no. 17-2 located on South Mains mmu-009 was observed with a gap in the lid that was observed with a .005 feeler gauge, a .007 feeler gauge would also fit into the gap the full length of the blade which was 2 1/2 inches, the length of the gap was about 2 inches. This machine is used inby the last open x-cut and this condition could possibly lead to the ignition of float coal dust in the air. The scoop was removed from service until condition corrected.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other: <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.512
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				D. Number of Persons Affected: 006
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 04/11/2006	B. Time (24 Hr. Clock) 1200
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

MSHA Form established enforcement

**Signature**

Business Regulatory Enforcement Fairness Act of 1998, the Small Business Administration has regional Fairness Boards to receive comments from small businesses about federal agency... the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) 04/11/2006	3. Citation/ Order Number 7282927 - 01
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The gap in the controller cover was closed.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331		
Signature	AR Number 23807	12. Date Mo Da Yr 04/12/2006	13. Time (24 Hr. Clock) 0705

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 04/11/2006	2. Time (24 Hr. Clock) 1055	3. Citation/ Order Number 7282928
4. Served To Clark Atwood - Safety	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g)

The power disconnect switch for the battery charging station located on South Mains mmu-009 had an improper cover on the switch box, a weather proof cover had been adapted and installed which left a hole in in the cover about 1 1/2 inches across exposing the connection terminals inside.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.512
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number		F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 04/11/2006	B. Time (24 Hr. Clock) 1300
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form established a enforcement enforcement

Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has regional Fairness Boards to receive comments from small businesses about federal agency's each agency's responsiveness to small business. If you wish to comment on the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

(01)

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 04/11/2006	3. Citation/ Order Number 7282928 - 01
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

A new cover was put on switch box.

See Continuation Form [ ]

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 04/12/2006	13. Time (24 Hr. Clock) 0645
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 04/12/2006	2. Time (24 Hr. Clock) 0920	3. Citation/ Order Number 7282929
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The set of double doors nearest the return entry located in x-cut 50 on Main West between the belt entry and the return had been damaged by a machine leaving the return after rock dusting.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.333(h)
--------------	--	-------------------	--

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or Illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No  D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 04/13/2006	B. Time (24 Hr. Clock) 0600
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
---	-----------------------------	---------------------

22. Signature	23. AR Number 23807
---------------	------------------------

**Signature**

MSHA Form 7000-3a established a enforcement enforcement enforcement Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

103

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 04/12/2006	3. Citation/ Order Number 7282929 - 01
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Doors have been repaired.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 04/13/2006	13. Time (24 Hr. Clock) 0920
--------------------	---------------------------------	---------------------------------



Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 04/18/2006	2. Time (24 Hr. Clock) 1705	3. Citation/ Order Number 7282931
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The South Main pillar section mmu-009 did not have a sanitary toilet supplied for the section. A portable chemical toilet was located on the section but was being kept in the First Aid trailer, it was dirty from dust, did not have any chemical in it nor was any located on the section, nor was any toilet paper.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1712-6(a)	See Continuation Form (MSHA Form 7000-3a) <input type="checkbox"/>
--------------	---	-------------------	---	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 006	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action	104(a)		13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/> Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/Order Number
15. Area or Equipment	F. Dated Mo Da Yr				

16. Termination Due	A. Date Mo Da Yr 04/18/2006	B. Time (24 Hr. Clock) 1815
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The toilet was taken outside and cleaned and charged with chemical and placed on section for use.

18. Terminated	A. Date Mo Da Yr 04/18/2006	B. Time (24 Hr. Clock) 2045
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form 7000-3a established a Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration

*7-11-06*

Section I--Violation Data

1. Date Mo Da Yr 05/04/2006	2. Time (24 Hr. Clock) 0720	3. Citation/ Order Number 7282933
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g)

The fire deluge (water) system did not function properly when tested. There was not sufficient water pressure to knock the rubber caps off of 6 of the suppression sprays. It was later found that this condition was created by a hole in the water hose going from the drive take-up to the spray located at the belt headroller. There were 20 sprays on the deluge system at the drive, take-up.  
The belt was taken out of service until deluge system was operating properly.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1101-1(a)
--------------	---	-------------------	---

See Continuation Form (MSHA Form 7000-3a)

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one)	A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action	104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action	A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr					
15. Area or Equipment					

16. Termination Due	A. Date Mo Da Yr 05/04/2006	B. Time (24 Hr. Clock) 1000
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The sprays were cleaned and the hose replaced. When checked again the system did function properly.

18. Terminated	A. Date Mo Da Yr 05/04/2006	B. Time (24 Hr. Clock) 0920
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established enforcement Street, SW

Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has regional Fairness Boards to receive comments from small businesses about federal agency's each agency's responsiveness to small business. If you wish to comment on the Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW, Washington, DC 20541. For more information, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/04/2006	3. Citation/ Order Number 7282933 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Change	From	To
--------	------	----

8. Condition Or Practice

Reason The fire deluge system was on the South Main belt.

Add to body of citation.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/04/2006	13. Time (24 Hr. Clock) 1045
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/04/2006	2. Time (24 Hr. Clock) 0910	3. Citation/ Order Number 7282934
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

Air was observed leaking from the intake overcast to the belt entry at x-cut 90 on the South Main intake, this condition was created by an inadequate repair of the overcast wall where a 4 inch pipe went through the wall. Spray foam had been used to seal around the pipe which had shrunk and allowed the air leak.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.333(h)
--------------	---	-------------------	--

Section II--Inspector's Evaluation

10. Gravity:					
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input checked="" type="checkbox"/>	Lost Workdays Or Restricted Duty <input type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001		
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action	104(a)		13. Type of Issuance (check one)		
			Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment					

16. Termination Due	A. Date Mo Da Yr 05/04/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate
-------------------------

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form established enforcement enforcement Street, SW Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/04/2006	3. Citation/Order Number 7282934 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The hole in the overcast has been properly repaired.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/15/2006	13. Time (24 Hr. Clock) 0830
--------------------	------------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/15/2006	2. Time (24 Hr. Clock) 0925	3. Citation/ Order Number 7282937
4. Served To Jack Marinos	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

The no.4 Crandall Canyon belt conveyor was not being maintained in safe working condition. A total of 6 bottom rollers were turning in accumulations. One top middle roller was turning on the roller shaft with the bearings gone, and the roller frame was very warm to the touch. Accumulations of coal on the top roller frames with the rollers turning in contact with the accumulations, most of which were compacted and dry. This condition existed from x-cut 90 to 73 a distance of about 3450 feet with a roller every 5 feet with the accumulations on about 90% of the rollers for a total of about 621 rollers. These conditions could contribute to a belt fire. The belt was removed from service until conditions corrected.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	---	-------------------	---

See Continuation Form (MSHA Form 7000-3a)

Section II--Inspector's Evaluation

10. Gravity:			
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input type="checkbox"/>	Permanently Disabling <input checked="" type="checkbox"/>
C. Significant and Substantial:	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 007
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>
12. Type of Action	104(a)		
13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>
15. Area or Equipment	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr

16. Termination Due	A. Date Mo Da Yr 05/15/2006	B. Time (24 Hr. Clock) 1430
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate
-------------------------

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code)	E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807		

**Signature**

MSHA Form 7 established a enforcement a enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

111

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/15/2006	3. Citation/ Order Number 7282937 - 01
4. Served To Jack Marinos	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The conditions were corrected.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/16/2006	13. Time (24 Hr. Clock) 0950
--------------------	------------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/15/2006	2. Time (24 Hr. Clock) 0925	3. Citation/ Order Number 7282938
4. Served To Jack Marinos	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

When checked the water deluge fire suppression system would not function properly, a total of 10 of the deluge sprays did not blow the rubber caps off of the spray nozzles to cover the belt area as required. This belt is Crandall Canyon no.4 which was also cited for accumulations, and other conditions which could contribute to a conveyor fire see Citation no. 7282937.

This belt was removed from service until conditions corrected.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1101-1(a)	See Continuation Form (MSHA Form 7000-3a)
--------------	---	-------------------	---	---

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input checked="" type="checkbox"/> Fatal <input type="checkbox"/>			
	C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		D. Number of Persons Affected: 007	

11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
----------------------------	----------------------------------	---------------------------------	---	----------------------------------	--

12. Type of Action 104(a)	13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
------------------------------	----------------------------------	--	--------------------------------	------------------------------------

14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr
--------------------	--------------------------------------	-----------------------------------	---------------------------------------	--	------------------------------	----------------------

15. Area or Equipment
-----------------------

16. Termination Due	A. Date Mo Da Yr 05/15/2006	B. Time (24 Hr. Clock) 1430
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate
-------------------------

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
--	-----------------------------	---------------------

22. Signature	23. AR Number 23807
---------------	------------------------

**Signature**

MSHA Form established enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 400 2nd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/15/2006	3. Citation/ Order Number 7282938 - 01
4. Served To Jack Marinos	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The conditions were corrected.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/16/2006	13. Time (24 Hr. Clock) 0940
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/22/2006	2. Time (24 Hr. Clock) 1530	3. Citation/ Order Number 7282940
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g)

The Eimco 975 no.4 being operated on North Mains intake roadway was observed with a steel plate placed between the filter housing and the operators compartment. By putting the plate in the dry chemical powder nozzle for the battery was blocked, if the system was discharged the battery would not have been sprayed with chemical.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1911(a)(4)	See Continuation Form (MSHA Form 7000-3a)
--------------	---	-------------------	--	---

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>			
	C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		D. Number of Persons Affected: 001	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>
12. Type of Action 104(a)	13. Type of Issuance (check one)		Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/> Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>
15. Area or Equipment	E. Citation/ Order Number		F. Dated Mo Da Yr	

16. Termination Due	A. Date Mo Da Yr 05/22/2006	B. Time (24 Hr. Clock) 1545
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate	The plate was removed.
-------------------------	------------------------

18. Terminated	A. Date Mo Da Yr 05/22/2006	B. Time (24 Hr. Clock) 1545
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form established enforcement enforcement  
Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has 10 Regional Fairness Boards to receive comments from small businesses about federal agency rates each agency's responsiveness to small business. If you wish to comment on the Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/22/2006	3. Citation/Order Number 7282940 - 01
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)

Section II—Justification for Action

Change	From	To
1. Issue Date Reason wrong issue date	05/22/2006	05/23/2006
16. A. Termination Due Date Reason wrong date	05/22/2006	05/23/2006
18. A. Terminated Date Reason wrong date.	05/22/2006	05/23/2006

Change the date in boxes 1/16A.and 18A.

Section III—Subsequent Action Taken

See Continuation Form


8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	--	---

Section IV—Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/23/2006	13. Time (24 Hr. Clock) 2020
--------------------	------------------------------------	---------------------------------

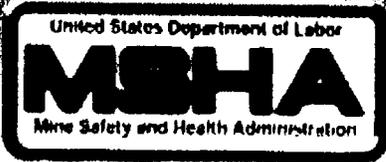

The information contained herein is protected under the Privacy Act and should be handled accordingly.

- Home
- MSIS Help
- Logout
- E Documents
- Batch Reports
- Status
- Report Viewer
- Diesel Inventory
  - Manage Inventory
- Enforcement
  - Complaints
  - Weekly Activity
- Reports
- Hazardous Conditions
  - Complaints
- Impound't & Refuse Pile
  - Inventory
- Legal Identification
  - Manage Entities
- Mine Plan Tracking
  - Mine Plan Tracking
  - Reports
- Part 50
- Penalty Assessments
  - Complaint Management
  - Reports
- Q & C
  - Instructor Management
  - Miner Management
  - Q&C Reports
- Samples
  - Complaints
  - Reports
- Utilities and Tools
  - Manage Mine Groups
  - Manage Users

(\* required field)

Issuance Information (This is a Draft Issuance) (Source is IPAL)				
Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Auto
Complete	Complete	Error	Error	C

<--Previous

**Subsequent Action**


<p><b>Subsequent Action Number</b> 7282940 - 01</p> <p><b>*Subsequent Action Date</b> 05/23/2006</p> <p><b>*Subsequent Action Event Number</b> 4476331</p> <p><b>Vacate Date</b>  </p> <p><b>Subsequent Action Mine ID</b> 4201715</p> <p><b>*Subsequent Action Served To</b> Clark Atwood - Safety</p> <p><b>Justification Text</b></p>	<p><b>Subsequent Action Type</b> --Select-- <input checked="" type="checkbox"/> Modify</p> <p><b>*Subsequent Action Time</b> 2020</p> <p><b>*Subsequent Action AR Nu</b> 23807</p> <p><b>Vacate Time</b>  </p> <p><b>Subsequent Action Activity</b> E01</p> <p><input type="checkbox"/> Conference Result</p>
--	---

Change the date in boxes 1/16A.and 18A.1. Issue Datewrong issue date16. A. Termination Due Datewrong date18. A. Terminated Datewrong date.

<--Previous

Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Auto
Complete	Complete	Error	Error	C

117

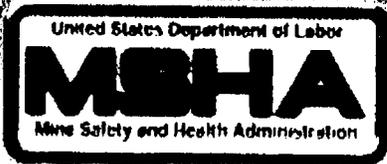

The information contained herein is protected under the Privacy Act and should be handled accordingly.

- Home
- MSIS Help
- Logout
- E Documents
- Batch Reports
- Status
- Report Viewer
- Diesel Inventory
  - Manage Inventory
- Enforcement
  - Reports
- Hazardous Conditions
  - Complaints
- Impound't & Refuse Pile
  - Inventory
- Legal Identification
  - Manage Entities
- Mine Plan Tracking
  - Mine Plan Tracking
  - Reports
- Part 50
- Penalty Assessments
  - Reports
- Q & C
  - Instructor Management
  - Miner Management
  - Q&C Reports
- Samples
  - Reports
- Utilities and Tools
  - Manage Mine Groups
  - Manage Users

(\* required field)

Issuance Information (This is a Draft Issuance) (Source is IPAL)				
Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Action
Complete	Complete	Error	Error	C

<--Previous

**Inspector Evaluation**

**Gravity**

Injury or illness (has) (is)

Injury or illness could reasonably be expected to be

Significant And Substantial

No Of Persons Affected

**Negligence**

Type Of Action   Type Of Issuance

**Initial Action**

Initial Action Type   Initial Action Date

Initial Action Number  Related Order

**Area Or Equipment**


Due Date/Time must be after Issue Date/Time

Termination Due Date(mm/dd/yyyy)

Termination Due Time(hhmm)

<--Previous

Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Action
Complete	Complete	Error	Error	C

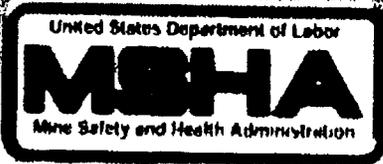

The information contained herein is protected under the Privacy Act and should be handled accordingly.

- Home
- MSIS Help
- Logout
- E Documents
- Batch Reports
- Status
- Report Viewer
- Diesel Inventory
  - Manage Inventory
- Enforcement
  - Forms
  - Inspections
  - Activity Reports
- Reports
- Hazardous Conditions
  - Complaints
- Impound't & Refuse Pile
  - Inventory
- Legal Identification
  - Manage Entities
- Mine Plan Tracking
  - Mine Plan Tracking
  - Reports
- Part 50
- Penalty Assessments
  - Citation Management
  - Reports
- Q & C
  - Instructor Management
  - Miner Management
  - Q&C Reports
- Samples
  - Clear Noise
  - Reports
- Utilities and Tools
  - Manage Mine Groups
  - Manage Users

(\* required field)

Issuance Information (This is a Draft Issuance) (Source is IPAL)				
Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Auto
Complete	Complete	Error	Error	C

< Previous

**Termination Action**

**Action To Terminate**

The plate was removed.

Terminate Date/Time must be after Issue Date/Time

Termination Date(mm/dd/yyyy)

Termination Time(hhmm)

< Previous

Subsequent Action	Violation Data	Inspector Evaluation	Termination Action	Auto
Complete	Complete	Error	Error	C

Mine Citation/Order

U.S. Department of Labor  
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/23/2006	2. Time (24 Hr. Clock) 1710	3. Citation/ Order Number 7283021
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The handheld fire extinguisher on Isuzu pickup 23 had not been examined since 06/2005, these are required to be examined every 6 months.

9. Violation	A. Health Safety Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.1100-3
--------------	------------------------	-------------------	--

See Continuation Form (MSHA Form 7000-3a)

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or Illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No  D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 05/23/2006	B. Time (24 Hr. Clock) 1715
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The extinguisher was examined and the tag punched.

18. Terminated	A. Date Mo Da Yr 05/23/2006	B. Time (24 Hr. Clock) 1715
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established a enforcement enforcement  
 all Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has  
 Regional Fairness Boards to receive comments from small businesses about federal agency  
 rates each agency's responsiveness to small business. If you wish to comment on the  
 the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd  
 Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including  
 the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 05/23/2006	2. Time (24 Hr. Clock) 1720	3. Citation/ Order Number 7283022
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

The Isuzu pickup was observed with numerous sharp edges that could cause injury to a miner. Several cuts with sharp edges on the cab from contact with the roof, sharp edges on both side edges on tailgate, and across the top rail of tailgate. These conditions could cause injury by people contact these edges while putting equipment or material in bed of pickup. While getting something out of bed of pickup, or getting into the bed of pickup to be transported.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	---	-------------------	---

See Continuation Form (MSHA Form 7000-3a)

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No

D. Number of Parsons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice

E. Citation/Order Number

F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 05/24/2006	B. Time (24 Hr. Clock) 1430
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form 7000-3a established a National Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established 10 Regional Fairness Boards to receive comments from small businesses about federal agency actions. The Small Business Administration rates each agency's responsiveness to small business. If you wish to comment on the actions of the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation ✓	2. Dated (Original Issue) 05/23/2006	Mo Da Yr	3. Citation/ Order Number 7283022 - 01
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

Material is needed and has been ordered but not all received to correct condition.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date 06/05/2006	Mo Da Yr	B. Time (24 Hr. Clock) 0700	C. Vacated	D. Terminated	E. Modified
----------------	-----------------------	----------	--------------------------------	------------	---------------	-------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date 05/30/2006	Mo Da Yr	13. Time (24 Hr. Clock) 0800
--------------------	------------------------	----------	---------------------------------

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/23/2006	3. Citation/ Order Number 7283022 - 02
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The roof skin was removed and replaced with sheet metal, all other sharp edges were repaired.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/01/2006	13. Time (24 Hr. Clock) 1230
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration

*United States*  
*MSHA*

Section I-Violation Data

1. Date Mo Da Yr 05/23/2006	2. Time (24 Hr. Clock) 1910	3. Citation/ Order Number 7283023
4. Served To Clark Atwood - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The Electrical min map has not been kept up to date. When checked the map was not current as to some equipment locations, the map posted was last dated 02/22/2006 and shows an electric air compressor located in x-cut 15 of 1st Right Gate which was sealed on 11/12/2005.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.508
--------------	---	-------------------	---

Section II-Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input type="checkbox"/> D. High <input checked="" type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number		F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 05/24/2006	B. Time (24 Hr. Clock) 1500
---------------------	-----------------------------------	--------------------------------

Section III-Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV-Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established enforcement actions of MSHA, you may call 1-800-REG-FAIR (1-800-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

125

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/23/2006	3. Citation/ Order Number 7283023 - 01
4. Served To Clark Atwood - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The map has been updated.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
---------------------------	--------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 05/30/2006	13. Time (24 Hr. Clock) 0905
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/30/2006	2. Time (24 Hr. Clock) 0805	3. Citation/ Order Number 7283024
4. Served To Steve Radmall - Safety	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g)

Isuzu pickup no.36 was observed with a passenger riding across the yard without any restraint to keep him from being expelled from the vehicle. The pickup does not have a door on the passenger side, and although there was a chain on that side it was not being used and would not have been adequate to contain him because one end of the chain was only run through a hole and not secured and the hook end of the chain was not hooked. The pickup was removed from service until condition corrected.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1914(a)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input checked="" type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 1200
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate
-------------------------

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established a enforcement enforcement  
 all Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has Regional Fairness Boards to receive comments from small businesses about federal agency rates each agency's responsiveness to small business. If you wish to comment on the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/30/2006	3. Citation/Order Number 7283024 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The pickup was removed from property for being junked.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331		
Signature	AR Number 23807	12. Date Mo Da Yr 06/01/2006	13. Time (24 Hr. Clock) 0725

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/30/2006	2. Time (24 Hr. Clock) 0820	3. Citation/ Order Number 7283025
4. Served To Steve Radmall - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		Ba. Written Notice (103g)

The handheld fire extinguisher on Isuzu pickup no. 36 had not been examined since June of 2005, exceeding the required six month period. The extinguisher was otherwise usable.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1100-3
--------------	--	----------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No  D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/  
Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 0830
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The extinguisher was replaced with an examined one.

18. Terminated	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 0830
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form 7000-3a established a small business enforcement system. Under the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established Regional Fairness Boards to receive comments from small businesses about federal agency actions. Each agency's responsiveness to small business. If you wish to comment on the actions of the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/30/2006	2. Time (24 Hr. Clock) 0850	3. Citation/ Order Number 7283026
4. Served To Steve Radmall - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The pre-shift record for the day shift on 05/28/2006 was conducted by 2 examiners and recorded in the book, one of the examiners did not sign the report.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.360(f)	See Continuation Form (MSHA Form 7000-3a) <input type="checkbox"/>
--------------	---	-------------------	--	--

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No  D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation  Order  Safeguard

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 05/31/2006	B. Time (24 Hr. Clock) 0700
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form 7000-3a (Rev. 10-2005) is required to be filed with the citation. The Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business Ombudsman to receive comments from small businesses about federal agency actions that affect each agency's responsiveness to small business. If you wish to comment on the actions of the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

130

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/30/2006	3. Citation/ Order Number 7283026 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The examiner has signed pre-shift record.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/01/2006	13. Time (24 Hr. Clock) 0920
--------------------	------------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/30/2006	2. Time (24 Hr. Clock) 1305	3. Citation/ Order Number 7283029
4. Served To Jim Pruitt - Safety		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

Isuzu pickup no.23 was cited for an outdated fire extinguisher examination tag 06/2005 on 05/23/2006.

Had the operator of the pickup done an adequate pre-operation examination the outdated fire extinguisher tag should have been observed by him and the condition corrected. The fire extinguisher was otherwise usable.

This citation issued for an inadequate pre-operation examination.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.1914(e)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:			
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>			
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input type="checkbox"/> D. High <input checked="" type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>			
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>	
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment			

16. Termination Due	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 1310
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate	An examination was made and the tag punched.
-------------------------	--

18. Terminated	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 1320
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established enforcement enforcement  
Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established 10 Regional Fairness Boards to receive comments from small businesses about federal agency actions and rates each agency's responsiveness to small business. If you wish to comment on the actions of the Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 05/30/2006	2. Time (24 Hr. Clock) 1325	3. Citation/ Order Number 7283030
4. Served To Jim Pruitt - Safety		5. Operator GENVAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715
8. Condition or Practice		8a. Written Notice (103g)

Isuzu pickup no.36 was cited for the handheld fire extinguisher not being examined in the time required, see Citation 7283025, the fire extinguisher was otherwise usable. Had an adequate pre-operation examination been conducted this condition would have been found and corrected. Instead it was observed by CMI as the employees were ready to go into mine. This citation issued for an inadequate pre-operation examination.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.1914(e)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>			
	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		D. Number of Persons Affected: 002	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input type="checkbox"/>	D. High <input checked="" type="checkbox"/>
	E. Reckless Disregard <input type="checkbox"/>			
12. Type of Action	104(a)			
13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>			
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>
	E. Citation/Order Number		F. Dated Mo Da Yr	
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 1335
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate	A new fire extinguisher was mounted on pickup.
-------------------------	--

18. Terminated	A. Date Mo Da Yr 05/30/2006	B. Time (24 Hr. Clock) 1335
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature		23. AR Number 23807

**Signature**

MSHA Form established enforcement enforcement  
 all Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has Regional Fairness Boards to receive comments from small businesses about federal agency rates each agency's responsiveness to small business. If you wish to comment on the Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 05/31/2006	2. Time (24 Hr. Clock) 0455	3. Citation/ Order Number 7283031
4. Served To Jim Pruitt - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		(Contractor)

8a. Written Notice (103g)

On 05/21/2006 Isuzu pickup no.30 was observed traveling from South Crandall to the underground parking in Crandall. This mantrip was loaded to the end of the bed with crew members, the tailgate had been removed and the chain restraint was not being used to prevent personnel from being thrown from such carriers. This Safeguard is issued for the safety of employees being transported in self propelled personnel carriers, in cabs or beds:  
( doors or tailgates removed ) be equipped with guards of sufficient strength and height to prevent personnel from being thrown from such carriers.

9. Violation	A. Health Safety Other	B. Section of Act	C. Part/Section of Title 30 CFR	See Continuation Form (MSHA Form 7000-3a) 75.1403
--------------	------------------------	-------------------	---------------------------------	--

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or Illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No

D. Number of Persons Affected:

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 314(b)

13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 06/05/2006	B. Time (24 Hr. Clock) 0700
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

Signature

MSHA Form 7 established a enforcement a enforcement a Street, SW MC 2120, Washington, DC 20416 Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 05/31/2006	3. Citation/ Order Number 7283031 - 01
4. Served To Jim Pruitt - Safety	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The tailgate was reinstalled and fixed so it could not be opened.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/23/2006	13. Time (24 Hr. Clock) 0730
--------------------	------------------------------------	---------------------------------



Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 06/23/2006	3. Citation/ Order Number 7283047 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The light power source has been changed for the light to stay on.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	C. Vacated	<input checked="" type="checkbox"/> D. Terminated	E. Modified
----------------	------------------	------------------------	------------	---	-------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
---------------------------	--------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/27/2006	13. Time (24 Hr. Clock) 0800
--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 06/23/2006	2. Time (24 Hr. Clock) 1015	3. Citation/ Order Number 7283048
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g) (Contractor)

The guarding (expanded metal in place of the door) on the left side of the Komatsu loader WA450 engine compartment was bent and only secured on the top exposing an opening 18 inches by 30 inches where the alternator, belt, and fan blades are easily accessible and could cause serious injury while the engine is running.

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR	See Continuation Form (MSHA Form 7000-3a) 77.400(a)
--------------	--	-------------------	---------------------------------	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>					
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input checked="" type="checkbox"/> Fatal <input type="checkbox"/>					
	C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		D. Number of Persons Affected: 001			
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action	104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>			
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/Order Number	F. Dated Mo Da Yr
15. Area or Equipment						

16. Termination Due	A. Date Mo Da Yr 06/23/2006	B. Time (24 Hr. Clock) 1500
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate
-------------------------

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476331	21. Primary or Mill
22. Signature	23. AR Number 23807	

**Signature**

MSHA Form 7000-3a (Rev. 10-2004) If the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established 10 Regional Fairness Boards to receive comments from small businesses about federal agency activities and rates each agency's responsiveness to small business. If you wish to comment on the activities of the Mine Safety and Health Administration, please contact the Office of the National Ombudsman, 409 3rd Street, SW, MC 2120, Washington, DC 20415. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

140

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration

11



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) 06/23/2006	Mo Da Yr	3. Citation/ Order Number 7283048 - 02/
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715		(Contractor)

Section II--Justification for Action

The guarding has been repaired.

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	C. Vacated	<input checked="" type="checkbox"/> D. Terminated	E. Modified
----------------	---------------------	------------------------	------------	---	-------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/27/2006	13. Time (24 Hr. Clock) 0820
--------------------	------------------------------------	---------------------------------

141

Mine Citation/Order Continuation

U.S. Department of Labor  
Mine Safety and Health Administration

*Deleted*



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 06/23/2006	3. Citation/Order Number 7283048 - 01
4. Served To Steve Radmall - Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Accumulations have been removed.

*Delete -  
Incorrect  
Guarding  
been Addressed.*

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476331
------------------------------	-----------------------------

**Signature**

AR Number 23807	12. Date Mo Da Yr 06/27/2006	13. Time (24 Hr. Clock) 0830
--------------------	---------------------------------	---------------------------------

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation ✓	2. Dated (Original Issue)	Mo Da Yr 06/23/2006	3. Citation/ Order Number	7283049 - 01
4. Served To Steve Radmall - Safety			5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

The accumulations were removed.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date	Mo Da Yr	B. Time (24 Hr. Clock)	C. Vacated	✓ D. Terminated	E. Modified
----------------	---------	----------	------------------------	------------	-----------------	-------------

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476331		
AR Number	23807	12. Date	Mo Da Yr 06/27/2006	13. Time (24 Hr. Clock)	0830

**Signature**

144