



## Section I--Violation Data

1. Date Mo Da Yr 12/06/2011	2. Time (24 Hr. Clock) 0800	3. Citation/ Order Number 4900517
4. Served To Berman Cornett (Safety Director)	5. Operator Performance Coal Company, et al.	
6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The shearer is not maintained in permissible condition on the Headgate 21 section (050 MMU). The following conditions were observed during an ongoing investigation of a fatal accident that occurred on April 5, 2010:

- 1) One bolt is missing from the shearer XP enclosures retaining bar on the first compartment.
- 2) Lock washers are not being used for any of the bays of the shearer control panel XP.
- 3) There is a terminating diode in the shearer cable junction box that is partially terminated inside the box.
- 4) The incoming 4160 volt shearer cables gland nut is not supplied with a securing wire tie.
- 5) The shearer cable junction box has 10.9 bolts installed, while 12.9

See Continuation Form (MSHA Form 7000-3a) ☒

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1002(a)
--------------	--	----------------------	--

## Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input checked="" type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 008
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/> Written Notice <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number		F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 01/05/2012	B. Time (24 Hr. Clock) 0800
---------------------	--------------------------------	--------------------------------

## Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

## Section IV--Automated System Data

19. Type of Inspection (activity code) E16	20. Event Number 4440348	21. Primary or Mill
22. Signature Keith McElroy		23. AR Number 24153

MSHA Form 7000-3, Apr 08 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order  
Continuation

U.S. Department of Labor  
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input type="checkbox"/> <input checked="" type="checkbox"/>	2. Dated (Original Issue) 12/06/2011 Mo Da Yr	3. Citation/ Order Number 4900517
4. Served To Berman Cornett (Safety Director)	5. Operator Performance Coal Company, et al.	
6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436 (Contractor)	

Section II--Justification for Action

Continuation of 8. Condition or Practice

bolts are the approved type.

6) A piece of flatbar (not attached) is keeping the shearer termination box in place. The mounting bolts are removed.

7) The left shearer cutter motor RTD is not connected as shown in the approval. The wiring from the RU1 (RTD unit) was connected to the two white wires of the motor and reads 0.6 ohms.

8) The gland nut for the left cutter motor does not have a retaining screw to hold the gland nut in place.

9) The methane monitor lens retaining strap has one bolt missing and the strap is bent.

10) The haulage motor's ground fault protection circuitry was disabled on the JNA0 controller.

This citation is being issued to the following entities as a unitary operator: Performance Coal Company, Massey Coal Services, Inc., A.T. Massey Coal Company, Inc., and Massey Energy Company.

See Continuation Form ☐

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E16	10. Event Number 4440348		
11. Signature Keith McElroy	AR Number 24153	12. Date Mo Da Yr 12/06/2011	13. Time (24 Hr. Clock) 0800