



Section I--Violation Data

1. Date Mo Da Yr 12/06/2011	2. Time (24 Hr. Clock) 0800	3. Citation/ Order Number 8258559
4. Served To Berman Cornett (Safety Director)		5. Operator PERFORMANCE COAL COMPANY, et al
6. Mine UPPER BIG BRANCH MINE-SOUTH		7. Mine ID 46-08436 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

Adequate overload/short-circuit protection is not being provided for these circuits on the Fairchild scoop (serial #T339-224);
 (1) a 140 amp fuse is provided for the pump motor. A 100 amp fuse is required.
 (2) a 10 amp fuse is provided for the UVR (under voltage release) for the main breaker. A 5 amp is required.
 (3) one of the 5 amp fuses inside the XP enclosure for the circuit breaker is missing,
 (4) 20 amp fuses are provided for the brake solenoid circuit. 10 amp fuses are required.
 (5) a 15 amp fuse is provided for the lighting circuit. A 10 amp fuse is required.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.518
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:			
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>			
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 008
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input type="checkbox"/> D. High <input checked="" type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>			
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/> Written Notice <input type="checkbox"/>	
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 01/05/2012	B. Time (24 Hr. Clock) 0800
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E16	20. Event Number 4440348	21. Primary or Mill
22. Signature Patrick Alan Stanfield		23. AR Number 23908

MSHA Form 7000-3, Apr 08 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input type="checkbox"/> <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 12/06/2011	3. Citation/Order Number 8258559
---	---	-------------------------------------

4. Served To Berman Cornett (Safety Director)	5. Operator PERFORMANCE COAL COMPANY, et al
--	--

6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436 (Contractor)
--	--

Section II—Justification for Action

Continuation of 8. Condition or Practice

(6) the amperage rating of the tram fuse is not legible.
The Fairchild scoop is located 30 feet outby spad #24301, #3 entry of HG22. This area was affected by an explosion on 04.05.2010. The machine was in use on this date.

This citation is being issued to the following entities as a unitary operator: Performance Coal Company, Massey Coal Services, Inc., A.T. Massey Coal Company, Inc., and Massey Energy Company.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	--------------------------------------

Section IV—Inspection Data

9. Type of Inspection E16	10. Event Number 4440348
------------------------------	-----------------------------

11. Signature Patrick Alan Stanfield	AR Number 23908	12. Date Mo Da Yr 12/06/2011	13. Time (24 Hr. Clock) 0800
---	--------------------	---------------------------------	---------------------------------