

E01

Reg Safety Health Insp.

07-05-2006 - 09-22-2006



Mine Activity Data

1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247
 4. Date Event Started: 7/5/2006 5. Date Event Finished: 9/22/2006 6. Mine ID: 42-01715
 7a. Organization Code (Mine Assignment) 20905 b. Work Group Identifier 01 9. Company Name UTAH AMERICAN ENERGY, INC.
 8a. Organization Code (AR Assignment) 20905 b. Work Group 01 10. Mine Name CRANDALL CANYON MINE
 11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections 1 b. Idle Sections 0
 c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATF i. Impoundments j. Refuse Piles
 k. Major Construction (1) Shaft/Slope Sinking 0 (2) Impoundment Construction 0 (3) Buildings 0 (4) Dragline/Shovel 0 (5) Other 0 l. Miscellaneous
 m. MMU/Pit Number (1) 009

13. Number of Samples Collected a. Air Samples 1 b. Rock Dust Spot 1 c. Rock Dust Survey 0 d. Respirable Dust 0 e. Noise 0 f. Other 0

14. Impoundments/Refuse Piles: a. Number b. FHC c. Configuration
 15. Prime Independent Contractor Codes (Major Construction)
 16. Inspection Results

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
a. This Inspection								
(1) New Issuances	35		1-2					
(2) Terminations/Vacations	35							
(3) Modifications/Extensions	4							
(4) Left Pending								
b. Previously Issued								
(1) Modifications/Extensions								
(2) Terminations/Vacations								

18. Signature and Card Number of Authorized Representative/Right of Entry Person(s) Responsible for Activity
 17. Remarks:
 Card Number
 a. 23988
 b.  23799
 c.
 d.

19. Key Entered By _____ Date _____



Mine Activity Data

1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247
 4. Date Event Started: 7/5/2006 5. Date Event Finished: 6. Mine ID: 42-01715
 7a. Organization Code (Mine Assignment) 20905 b. Work Group Identifier 01 9. Company Name UTAHAMERICAN ENERGY
 8a. Organization Code (AR Assignment) 20905 b. Work Group 01 10. Mine Name CRANDALL CANYON MINE
 11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections 1 b. Idle Sections 0
 c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATF i. Impoundments j. Refuse Piles
 k. Major Construction (1) Shaft/ Slope Sinking 0 (2) Impoundment Construction 0 (3) Buildings 0 (4) Dragline/ Shovel 0 (5) Other 0 l. Miscellaneous
 m. MMU/Pit Number (1) 009

13. Number of Samples Collected a. Air Samples 0 b. Rock Dust Spot 1 c. Rock Dust Survey 0 d. Respirable Dust 0 e. Noise 0 f. Other 0

14. Impoundments/Refuse Piles:
 a. Number b. FHC c. Configuration

15. Prime Independent Contractor Codes (Major Construction)

16. Inspection Results

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
a. This Inspection								
(1) New Issuances		2						
(2) Terminations/Vacations		2/0						
(3) Modifications/Extensions		1/0						
(4) Left Pending		0						
b. Previously Issued								
(1) Modifications/Extensions		0/0						
(2) Terminations/Vacations		0/3						

18. Signature and Card Number of Authorized Representative/ Right of Entry Person(s) Responsible for Activity

Card Number
 a. 23988
 b. **Signature** 24125
 c.
 d.

17. Remarks:
 Traveled return and inspected return seals.

19. Key Entered By Date

Activity Calendar

Event Number: 4476247

Mine ID: 4201715

Shift	Sun			Mon			Tue			Wed			Thur			Fri			Sat		
	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3
Week 1 7/23/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>				
Week 2 8/6/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 3 8/13/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>				
Week 4 8/20/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Week 5 8/28/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>				
Week 6 9/3/2006	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Mine Activity Data



1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247

4. Date Event Started: 7/5/2006 5. Date Event Finished: 6. Mine ID: 42-01715

7a. Organization Code (Mine Assignment) 20905 b. Work Group Identifier 01 9. Company Name GENWAL RESOURCES INC

8a. Organization Code (AR Assignment) 20905 b. Work Group 01 10. Mine Name CRANDALL CANYON MINE

11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections 0 b. Idle Sections 0

c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATP i. Impoundments j. Refuse Piles

k. Major Construction (1) Shaft/ Slope Sinking 0 (2) Impoundment Construction 0 (3) Buildings 0 (4) Dragline/ Shovel: 0 (5) Other 0 l. Miscellaneous

m. MMU/Pit Number

13. Number of Samples Collected a. Air Samples 0 b. Rock Dust Spot 0 c. Rock Dust Survey 0 d. Respirable Dust 0 e. Noise 0 f. Other 0

14. Impoundments/Refuse Piles: a. Number b. FHC c. Configuration

15. Prime Independent Contractor Codes (Major Construction)

16. Inspection Results

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
a. This Inspection								
(1) New Issuances		1						
(2) Terminations/Vacations		1/0						
(3) Modifications/Extensions								
(4) Left Pending		0						
b. Previously Issued								
(1) Modifications/Extensions								
(2) Terminations/Vacations								

18. Signature and Card Number of Authorized Representative/ Right of Entry Person(s) Responsible for Activity

a.  Card Number 23988

b. _____

c. _____

d. _____

17. Remarks:

19. Key Entered By _____ Date _____

Activity Calendar

Event Number: 4476247

Mine ID: 4201715

Shift	Sun			Mon			Tue			Wed			Thur			Fri			Sat		
	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3	1	2	3
Week 1 7/2/2006																					
Week 2 7/9/2006																					
Week 3 7/16/2006					X																
Week 4 7/23/2006																					
Week 5 7/30/2006																					
Week 6 8/6/2006																					
Week 7 8/13/2006																					
Week 8 8/20/2006																					
Week 9 8/27/2006																					
Week 10 9/3/2006																					
Week 11 9/10/2006																					
Week 12 9/17/2006																					
Week 13 9/23/2006																					

Mine Activity Data



1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247
 4. Date Event Started: 7/5/2006 5. Date Event Finished: 6. Mine ID: 42-01715
 7a. Organization Code (Mine Assignment) 20905 b. Work Group Identifier 01 9. Company Name GENWAL RESOURCES INC
 8a. Organization Code (AR Assignment) 20905 b. Work Group 01 10. Mine Name CRANDALL CANYON MINE
 11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections 1 b. Idle Sections
 c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATP i. Impoundments j. Refuse Piles
 k. Major Construction (1) Shaft/Slope Sinking (2) Impoundment Construction (3) Buildings (4) Dragline/Shovel: (5) Other I. Miscellaneous
 m. MMU/Pit Number (1) 009

13. Number of Samples Collected a. Air Samples b. Rock Dust Spot c. Rock Dust Survey d. Respirable Dust e. Noise f. Other

14. Impoundments/Refuse Piles:
 a. Number b. FHC c. Configuration

15. Prime Independent Contractor Codes (Major Construction)

16. Inspection Results

a. This Inspection	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
(1) New Issuances		11						
(2) Terminations/Vacations	10	0						
(3) Modifications/Extensions	0	1						
(4) Left Pending			1					
b. Previously Issued								
(1) Modifications/Extensions	0	0						
(2) Terminations/Vacations	0	0						

RECEIVED
 SEP - 5 2006
 PRICE UTAH

18. Signature and Card Number of Authorized Representative/ Right of Entry Person(s) Responsible for Activity

a. **Signature** _____ Card Number 23988
 b. _____ Card Number 24125
 c. _____
 d. _____

17. Remarks:
 Surface electrical inspection. Electrical inspection on MMU 009

File this with ORIGINAL Report
 8/28/06 **Signature**

19. Key Entered By _____ Date _____



Mine Activity Data

1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247
 4. Date Event Started: 7/5/2006 5. Date Event Finished: 6. Mine ID: 42-01715
 7a. Organization Code (Mine Assignment): 20905 b. Work Group Identifier: 01 9. Company Name: GENWAL RESOURCES INC
 8a. Organization Code (AR Assignment): 20905 b. Work Group: 01 10. Mine Name: CRANDALL CANYON MINE
 11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections 1 b. Idle Sections
 c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATF i. Impoundments j. Refuse Piles
 k. Major Construction (1) Shaft/Slope Sinking (2) Impoundment Construction (3) Buildings (4) Dragline/Shovel (5) Other I. Miscellaneous
 m. MMU/Pit Number (1) 009

13. Number of Samples Collected a. Air Samples b. Rock Dust Spot c. Rock Dust Survey d. Respirable Dust e. Noise f. Other

14. Impoundments/Refuse Piles: a. Number b. FHC c. Configuration 15. Prime Independent Contractor Codes (Major Construction)

16. Inspection Results

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
a. This Inspection								
(1) New Issuances			3					
(2) Terminations/Vacations			3/0					
(3) Modifications/Extensions			0/0					
(4) Left Pending			0					
b. Previously Issued								
(1) Modifications/Extensions			0/0					
(2) Terminations/Vacations			1/0					

RECEIVED
 SEP - 5 2006
 PRICE, UTAH

18. Signature and Card Number of Authorized Representative/
 Right of Entry Person(s) Responsible for Activity

a. **Signature** Card Number: 23988
 b. **Signature** Card Number: 24125
 c. **Signature**
 d. **Signature**

17. Remarks:
 Inspect electrical components of underground belt line.
 file this with the Original Report
Signature 8/29/06

19. Key Entered By _____ Date _____

Mine Activity Data



1. Action: a. New Entry b. Update 2. Activity Code: E01 3. Event Number: 4476247

4. Date Event Started: 7/5/2006 5. Date Event Finished: 6. Mine ID: 42-01715

7a. Organization Code (Mine Assignment): 20905 b. Work Group Identifier: 01 9. Company Name: GENWAL RESOURCES INC

8a. Organization Code (AR Assignment): 20905 b. Work Group: 01 10. Mine Name: CRANDALL CANYON MINE

11. Report Type (check) a. First b. Interim c. Last d. Not Applicable 12. Area of Inspections a. Active Sections: 1 b. Idle Sections

c. Outby Areas d. Shafts/Slopes e. Surface Areas (UG) f. Surface Workings g. Company Records h. ATF i. Impoundments j. Refuse Piles

k. Major Construction (1) Shaft/Slope Sinking (2) Impoundment Construction (3) Buildings (4) Dragline/Shovel (5) Other I. Miscellaneous

m. MMU/Pit Number (1) 009


13. Number of Samples Collected a. Air Samples b. Rock Dust Spot c. Rock Dust Survey d. Respirable Dust e. Noise f. Other

14. Impoundments/Refuse Piles: a. Number b. FHC c. Configuration

15. Prime Independent Contractor Codes (Major Construction)

16. Inspection Results

	Citations		Orders		Safeguards		Other	
	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con	Coal Opr	Ind Con
a. This Inspection								
(1) New Issuances		3						
(2) Terminations/Vacations		5/0						
(3) Modifications/Extensions		0/0						
(4) Left Pending		0						
b. Previously Issued								
(1) Modifications/Extensions		0/0						
(2) Terminations/Vacations		2/0						

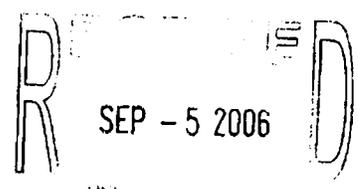

18. Signature and Card Number of Authorized Representative/ Right of Entry Person(s) Responsible for Activity

a. Card Number: 23988

b. Card Number: 24125

c.

d.

17. Remarks:
Surface electrical inspection. Electrical inspection on MMU 009

File this with original Report 8/30/06

19. Key Entered By _____ Date _____

Mine Information Form

Page 1

Mine Safety and Health Administration



<input type="checkbox"/> New	All fields are required
<input checked="" type="checkbox"/> Change	The Mine ID Number is required, otherwise fill out only those fields that have changed

1. MSHA Mine ID Number: 42-01715 2. Operating Company Name: UTAH AMERICAN ENERGY, INC

3. Mine or Mill Name: CANDLER CANYON MINE

3a. Mine Emergency Phone No: 	4. Type of Operation Coal <input type="checkbox"/> Metal/Non-Metal <input type="checkbox"/>	5. Portable Operation <input type="checkbox"/>	6. Primary Mine Type Underground <input type="checkbox"/> Surface <input type="checkbox"/> Facility <input type="checkbox"/>
7. MSHA Office Code:	8a. Work Group	8b. Travel Area	9. Nearest Town, Landmark, or Post Office:
10. County Name Where Mine is Located:		11. State Abbreviation	12. Cong. Dist. (Coal Only)
13. Mileage from Field Office:			

14. Directions to Operation from Field Inspection Office:

15. Total Employees: | | | | | 60 16. Schedule of Operation:
 a. Hours per Production Shift 8 b. Production Shifts per Day 3 c. Maint. Shifts per Day 3 d. Work Days per Week 7

17. Longitude and Latitude: (Coal Only)
 a. Longitude: Degrees | | | | | Minutes | | | | | Seconds | | | | |
 b. Latitude: Degrees | | | | | Minutes | | | | | Seconds | | | | |

18. Mine Status: New Mine Active Intermittent Non-Producing Abandoned Temporarily Idle (Coal Only) Abandoned & Sealed (Coal Only)

19. Status Date (mm/dd/yyyy): ____/____/____

20. Types of Minerals being Extracted or Processed:
 a. Primary Commodity _____ Secondary Commodity (Optional) _____
 c. Other Commodities (Optional) _____

21. Mine Characteristics: a. Applicable to ALL Mines (check all that apply)
 Auger Dredge Laboratory Mill/Prep Plant/Loading Dock Open Pit/Strip Shop or Yard Remaining Culf Bank/Refuse Pile/Tailings

b. Applicable to Coal Mines Only Highwall Miner <input type="checkbox"/>	c. Applicable to Metal and Non-metal Mines Only Adit <input type="checkbox"/> Block Caving <input type="checkbox"/> Cut and Fill <input type="checkbox"/> Dimension <input type="checkbox"/> Quarry <input type="checkbox"/> Longwall <input type="checkbox"/> Shaft <input type="checkbox"/> Slope <input type="checkbox"/> Heap Leaching <input type="checkbox"/> In-situ Leaching <input type="checkbox"/> Room and Pillar <input type="checkbox"/>
---	--

22. Other Mine Information: a. Applicable to All Mines (check all that apply)
 103(l) Status: Ignition Hazard 6 Day 10 Day 15 Day Removed Date Entered 103(l) Status: (mm/dd/yyyy) _____
 Explosives Used Explosives Stored on Surface Explosives Stored Underground Treasury Permit License
 Government Owned Government Operated Mine Rescue Station at Mine Safety Committee at Mine Methane Liberation _____ cubic ft / 24 hrs

b. Applicable to Coal Mines Only No. of Producing Pits _____ No. of Non-Producing Pits _____	No. of Drift Openings _____	No. of Slope Openings _____	No. of Shaft Openings _____	Avg. Daily Coal Production <u>3200</u> tons
Primary Coal Bed Name _____ Avg. mine Height (inches) _____				Surface Mines: <input type="checkbox"/> CH4/O2 Tests Required <input type="checkbox"/>

c. Applicable to Metal and Nonmetal Mines Only
 Mine Gas Category: _____ Number of Impoundments: _____ No. of Escapeways to Surface: _____ No. of Hoists: _____ No. of Refuse Chambers: _____

Associated Cement Mill <input type="checkbox"/>	Kilns <input type="checkbox"/>	Electrowinning as Part of Milling <input type="checkbox"/>	Produces Ground Slimes as a Product <input type="checkbox"/>	Hazardous Waste Burned as Fuel <input type="checkbox"/>	Channel Burners <input type="checkbox"/>	Wire Saws <input type="checkbox"/>
Metal Refractory as Part of Milling <input type="checkbox"/>	Refract <input type="checkbox"/>	Roaster <input type="checkbox"/>	Mechanical Ventilation for Underground Mine <input type="checkbox"/>	Natural Ventilation for Underground Mine <input type="checkbox"/>		



MSHA Office

PRICE

2 Mine ID

42-01715

1 Mine Name

CRANDALL CANYON MINE

4 Company Name

UTAH AMERICAN ENERGY, INC.

3 Location (No. and Street, City or Town, State, & Zip code)

Roof Control (briefly describe)

Adequate

Deficiencies In Plan

Ventilation (briefly describe)

Adequate

Deficiencies In Plan

Issuing Inspector Signature

Date

Supervisor Signature

Date

Signature

9-22-06

Signature

9-26-06

Rock Dust Sample Submission Form

U.S. Department of Labor
Mine Safety and Health Administration

Spot Survey

Collector Richard J. Boyle (24125)		Field Office Price Utah		F. O. Code 9050	
Inspector Email boyle.richard@dol.gov		Supervisor Email Farmer.Ted@DOL.GOV		Clerk Email Beacco.Alice@DOL.GOV	
Manager Email boyle.richard@dol.gov					
Mine ID 42-01715	Mine CRANDALL CANYON MINE		Company UTAHAMERICAN ENERGY		
Event Number 4476247	MMU #1 001-0 (A)	Super-Section No	MMU #2 -	Date Collected 09-05-2006	
Sampling Area 2 X cuts outby main north #1 seal			Zero Point 2X cuts outby main north #1 seal		
Collector's Comments					
<input type="checkbox"/> Advancing					
<input checked="" type="checkbox"/> Retreating					

Lab Number	Bag Number	Sample Type	Location in Mine	Intake/Return	Handheld CH4	Bottle No. (If App.)	Bottle Analysis	Dust Analysis	Required	Compliant
700920	a-1	Floor	2 x cuts outby # 1 Main north seal	R	0.0			75.6	80	No

For Laboratory Use Only		
Date Received 09-14-2006	Lab Numbers 700920 to 700920	Date Emailed 09-19-2006
Lab Comments		SURVEY IS NON- COMPLIANT

Self-Rescuer
Survey Data Form

U.S. Department of Labor
Mine Safety and Health Administration

1. Dates of Survey: Start: 9/18/06 End: 9/18/06
2. MSHA Office Code: 905
3. Inspector's AR Number: 23277
4. Supervisor Initial: CTOF
5. Mine ID Number: 42-01715
6. Mine Name: CRANDALL CANYON MINE
7. Company Name: UTAH AMERICAN
8. Total Number of Underground Miners, Including Contractor Employees: 108; and By Shift:
(a) Midnight/Owl/1st: 15 Start Time: 10: PM Quit Time: 6: AM
(b) Day/2nd: 18 Start Time: 6: AM Quit Time: 2: PM
(c) Aft/Eve/3rd: 15 Start Time: 2: PM Quit Time: 10: PM
(d) Staggered/Overlapping/Extended Shifts: enter maximum number of miners underground at any given time: 33; and average length of shift in hours: 8 Hrs.
(e) Scheduled production days: 1) Mon. 2) Tue. 3) Wed. 4) Thur. 5) Fri.
6) Sat. and 7) Sun.
9. For each type of self-rescue device provided for use at the mine, enter the quantity in the appropriate block:
- | | |
|------------------------------|----------------------|
| (a) CSE: SR-100 SCSR | Quantity: <u>150</u> |
| (b) MSA: Life Saver 60 SCSR | Quantity: _____ |
| (c) Draeger: OXY K Plus SCSR | Quantity: _____ |
| (d) Ocenco: EBA 6.5 SCSR | Quantity: _____ |
| (e) MSA: W65 FSR | Quantity: _____ |
| (f) Ocenco: M-20 SCSR | Quantity: _____ |
| (g) Other: Specify _____ | Quantity: _____ |
10. Is a record available at the mine to document that the mine operator is conducting the required 90-day inspections on each of the self-rescue devices provided for use at the mine? Y N
11. Does the mine have an approved SCSR storage plan in effect allowing miners to be further than 25 feet from their 1-hour SCSR? Y N If Yes:
(a) distance from the face to the storage cache in feet; _____ ft.; and
(b) are devices stored in accordance with the manufacturer's approved requirements?
Y N

108
65
43

Side 1 of 2

12. Are self-rescue devices stored on mining equipment? Y N If Yes, check each appropriate block to identify the type of mining equipment. Further, using Items 9 (a) through (g) above, identify the type of self-rescue devices observed on the mining equipment.

<u>Type(s) Of Mining Equipment</u>	<u>Type(s)Of Self-Rescue Devices</u>
(a) <u> </u> Continuous Miner	_____
(b) <u> </u> Shuttle Car	_____
(c) <u> </u> Roof Bolter	_____
(d) <u> </u> Scoop Car	_____
(e) <u> </u> Longwall Shield	_____
(f) <u> </u> Personnel Carrier	_____
(g) <u> </u> Locomotive	_____
(h) <u> </u> Other: Specify _____	_____

Are Self-Rescue Devices:

- (i) Secured on the mining equipment? Y N ;
 (j) Protected from accidental damage? Y N ; and
 (k) Left on equipment between shifts? Y N .

13. What is the average mining height, in inches, of the primary escapeway? 896 inches.
 14. Using the primary escapeway what is the distance, in feet, from the deepest working section in the mine to the surface or bottom of an emergency escape facility? 1500 feet.
 15. Does the mine provide SCSRs at strategic locations for the purpose of providing protection to the surface or a safe location? Check Y N If yes: (a) is the location of these SCSRs approved by the district manager? Y N

Comments: _____

Report of Violations

Instructions

Please write firmly with a ball point pen when completing this form. ATF officers will prepare this form in triplicate. The original copy will be given to the proprietor or a responsible representative. The remaining copies will be submitted with the completed inspection report. Supervisors will detach one copy from the completed report for their files.

Name of Proprietor Crandall Canyon Mine	Street Address Huntington Canyon	City Huntington	State Utah	ZIP Code 84528	County Emery	Page 1 of 1 Pages
License/Permit/Registry Number (if any)		Expiration Date	Date(s) or Period of Inspection 09/11/2006			

Inspection Results

An examination of your premises, records and operations has disclosed the following violations which have been explained to you:

Number	USC or CFR Citation	Nature of Violation	Corrective Action to be Taken <i>(If not corrected immediately)</i>	Date Corrections to be Made <i>(If not corrected immediately)</i>
		No violation observed Signature 9-11-2006		

I Have Received a Copy of This Report of Violations <i>(Proprietor's signature and title)</i>	Date
Signature and Title of ATF Officer	Date

Mine Operator's Respirable
Dust Sampling Program Survey

U. S. Department of Labor
Mine Safety and Health Administration



1. Date: 9-22-06
 2. District: 9
 3. Mine ID Number: 42-01715
 4. Mine Name: CRANDALL Canyon mine
 5. Company: UTAH AMERICAN ENERGY
 6. Name (person responsible for calibration and maintenance of approved sampling devices):
 7. Name (person qualified to conduct sampling program):
 8. Number of Dust Pumps (in use at mine):
 9. All Dust Pumps Have Been Calibrated within Last 200 Hours
 Yes No

10. Name(s) of Person(s) Assigned to Check Pumps During Sampling

11. Results of at Least Six Checks by Soap Film Calibrator

Check	Pump Number													
1														
2														
3														
4														
5														
6														
7														
8														
9														
10														
Avg														

No Pumps Checked

12. Reverse May Be Used for Remarks

Signature

13. Person Conducting Survey



Section I--Violation Data		
1. Date Mo Da Yr 07/17/2006	2. Time (24 Hr. Clock) 0735	3. Citation/ Order Number 7283155
4. Served To Jim Pruitt, Safety Manager		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		

A compressed gas cylinder containing carbon dioxide that was located within the surface storage area was not provided with a protective cap over the valve assembly.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.208(e)
--------------	---	-------------------	--

Section II--Inspector's Evaluation						
10. Gravity:						
A. Injury or Illness (has) (is):		No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:		No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input type="checkbox"/>	Permanently Disabling <input checked="" type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:			Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 001	
11. Negligence (check one)						
A. None <input type="checkbox"/>		B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action 104(a)			13. Type of Issuance (check one)			
			Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number		F. Dated Mo Da Yr	
A. Citation <input type="checkbox"/>			B. Order <input type="checkbox"/>		C. Safeguard <input type="checkbox"/>	
D. Written Notice <input type="checkbox"/>						
15. Area or Equipment						

16. Termination Due	A. Date Mo Da Yr 07/17/2006	B. Time (24 Hr. Clock) 0740
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate A protective cap was provided over the cylinder's valve assembly.

18. Terminated	A. Date Mo Da Yr 07/17/2006	B. Time (24 Hr. Clock) 0738
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data		
19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature		23. AR Number 23988

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW, MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I—Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 0845	3. Citation/ Order Number 7285660
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input checked="" type="checkbox"/>

Fire boss truck number 11 was inspected on the surface and found the main battery connection to the starter was not insulated. There was no evidence of this connection being insulated and battery voltage could be read at this connection.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1910(f)
--------------	--	-------------------	---

Section II—Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	D. Number of Persons Affected: 001
C. Significant and Substantial:	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		
11. Negligence (check one)	A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>		
12. Type of Action 104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated	Mo Da Yr
15. Area or Equipment			

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1215
---------------------	-----------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate This connection has been insulated.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1215
----------------	-----------------------------------	--------------------------------

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature	23. AR Number 24125	

MSHA Form 7000-3, Mar 03 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Enforcement Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I—Violation Data			
1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 0920	3. Citation/ Order Number	7285669
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice			

8a. Written Notice (103g)

The electrical controls located in the Crandall belt portal were covered in coal dust. The tops of the boxes had coal accumulations measuring up to 3/8 of an inch deep. The inside of these electrical boxes also had coal dust accumulations up to 1/8 of an inch deep.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR	75.400
--------------	--	----------------------	------------------------------------	--------

Section II—Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 010	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action		13. Type of Issuance (check one)		
104(a)		Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action				F. Dated
A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>				Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock)	1100
---------------------	-----------------------------------	------------------------	------

Section III—Termination Action

17. Action to Terminate These boxes have been cleaned inside and out.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock)	1100
----------------	-----------------------------------	------------------------	------

Section IV—Automated System Data

19. Type of Inspection (activity code)	E01	20. Event Number	4476247	21. Primary or Mill	
22. Signature	Signature			23. AR Number	24125

MSHA Form 7000-3, Mar 05 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 0945	3. Citation/ Order Number 7285670
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice 8a. Written Notice (103g) <input type="checkbox"/>		

The electrical controls located in the Crandall belt portal were not all labeled and or labeled correctly. When inspected the circuit breaker that was labeled "fuel tanks, oil tanks, and lower yard" stopped the number 1 belt when the power was switched off. Also a disconnect box on the end of the step down transformer was not marked. This could result in a electrocution if a person was working on this belt and power was switched on. Also this complication will cause problems with locking and tagging while working on this belt.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1904
--------------	--	----------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				D. Number of Persons Affected: 010
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) / In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 07/26/2006		3. Citation/ Order Number 7285670 - 01	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II--Justification for Action

Change	From	To
9. C. Part/Section	75.1904	75.904

Reason The wrong section of law was listed on citation this action corrects that problem.

This citation was mistakenly issued under the wrong section of the law. This action will correct this problem and terminate the citation as a result of the problem being corrected.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	---

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476247
11. Signature	Signature	AR Number	24125
		12. Date Mo Da Yr	07/27/2006
		13. Time (24 Hr. Clock)	1326



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1000	3. Citation/ Order Number 7285671
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The weather head fitting supplying power to a junction box at the belt portal was missing the required cover. The missing cover was not to be found and a replacement had to be found and installed.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.515
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The missing cover was replaced.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1025	3. Citation/ Order Number 7285672
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The 12-5 cable supplying power to the number 2 magnet being used on the number 1 belt was missing the guards on the belt drive motor. The belts were rubbing on the cable and had rubbed through the outer jacket and into one of the phase leads. There was not any copper showing. This damaged cable was 12 feet above the ground. The magnet was not being used when inspected.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.517
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This cable was moved away from the belts and was re-insulated and guarded.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1120	3. Citation/ Order Number 7285673
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The liquid tite fitting installed in the bottom of the disconnect for the water heater used on the silo belt was broken out of the bottom of the box. Also the liquid tite conduit was broken where it entered the top of the water heater exposing insulated wires. A 1/2 HP circulating pump was also being used with this water heater and it also had the liquid tite entrance gland damaged and not secured in the electric motor. Insulated wires were exposed. The power was turned on.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.505
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>			
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>			
	C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>		D. Number of Persons Affected: 001	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>
12. Type of Action 104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>			
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number		F. Dated Mo Da Yr	

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature	23. AR Number 24125	

MSHA Form 7000-3a with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 07/26/2006		3. Citation/ Order Number 7285673 - 01	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II—Justification for Action

The conduits have been fixed and the bad entrance glands have been replaced.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV—Inspection Data

9. Type of Inspection E01		10. Event Number 4476247			
11. Signature	Signature	AR Number 24125	12. Date Mo Da Yr 07/27/2006	13. Time (24 Hr. Clock) 1337	

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1005	3. Citation/ Order Number 7285674
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A area light mounted to the center of the bulk oil storage area had the conduit and entrance gland smashed and bare electrical conductors had been in contact with the metal support structure. The wires were connected inside the weatherhead fitting and there was power in the box that supplies power to other electrical components being supplied with electricity also in the same conduit. We were not able to read power on the light and also were not able to find where and how it was disconnected. There was no record of a inspection on this light. This light should have been maintained or removed from service. This condition looked as if it has been this way for a long time.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.502
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1115
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This light has been removed.

18. Terminated	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1115
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 65 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1035	3. Citation/ Order Number 7285675
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A electrical box that had been removed from service and had the line side power conductors removed from it had a 1 1/2 opening in the bottom of the box that was not plugged. When checked this obsolete circuit breaker that used to supply power to a reclaim belt had 240 volts on the line side of the breaker. There was no record of any inspections being done on this breaker. A person could not contact power through this opening.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.502
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1055
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The opening has been plugged and this box will be included in future permissibility inspections.

18. Terminated	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1055
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3a, 10/05 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1150	3. Citation/ Order Number 7285676
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A 480 Volt circuit breaker was installed in a plastic enclosure inside the sub station. The breaker was not secured inside this box and was only being held in place by the line side power wires. This circuit breaker had the load side power wires disconnected. The opening in the box where the switch was intended to come through was loosely and partially covered by a danger tag that was not signed or written on, I believe the tag was intended to be a cover. The energized 480 volt line side of this circuit breaker could be contacted through this opening. There was no record of any permissibility inspections being made on this circuit breaker.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.516
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/28/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or MHI
22. Signature Signature		23. AR Number 24125

Under the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call a MHA HELPLINE (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/27/2006	3. Citation/ Order Number 7285676 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

This circuit breaker and box has been removed and all wiring has been properly terminated.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247
---------------------------	--------------------------

11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/07/2006	13. Time (24 Hr. Clock) 1121
-----------------------------------	--------------------	---------------------------------	---------------------------------



Section I--Violation Data			
1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1150	3. Citation/ Order Number 7285677	
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice			8a. Written Notice (103g) <input type="checkbox"/>

Two energized 480 Volt AC circuit breakers in the surface sub station were not labeled or identified as to what they were controlling. There was no record of any inspections being done on these circuit breakers.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.904
--------------	--	----------------------	--

Section II--Inspector's Evaluation				
10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/28/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action		
17. Action to Terminate		

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data		
19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 05 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 07/27/2006		3. Citation/ Order Number 7285677 - 01	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II—Justification for Action

Change	From	To
10. C. Significant and Substantial	Yes	No

Reason With the load side wires removed there was no hazardous exposure to people.

When these circuit breakers were further inspected it was found that the load side wiring had been removed. These breakers were energized, but there was no exposure to people. Breaker has been switched off and will be listed for required inspections, also inspectors have been instructed to switch all unused circuit breakers off.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	---

Section IV—Inspection Data

9. Type of Inspection E01		10. Event Number 4476247			
11. Signature	Signature	AR Number	12. Date Mo Da Yr	13. Time (24 Hr. Clock)	
		24125	08/07/2006	1128	

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 07/27/2006		3. Citation/ Order Number 7285677 - 02	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II--Justification for Action

Change	From	To
10. A. Injury or Illness	Reasonably Likely	Unlikely

Reason This citation has been changed from S/S to Non S/S. The gravity needed to be changed to reflect this change.

This citation was modified from S/S to non-S/S. The Gravity of the citation has to change to reflect this change.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476247
11. Signature	Signature	AR Number	24125
12. Date	Mo Da Yr	13. Time (24 Hr. Clock)	08/16/2006 0607



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1250	3. Citation/ Order Number 7285678
4. Served To Jim Pruitt, Safety Director	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

Nine electrical citations have been written during the surface inspection conducted on 07-26 and 27-2006. Six of these citations have been S&S. These conditions were not noted in the required inspections or were marked as being OK. The referred to citations are 7285669, 7285670, 7285672, 7285673, 7285676 and 7285677.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.502
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
	C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input type="checkbox"/>	D. High <input checked="" type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action 104(d)(1)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>				
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number			F. Dated Mo Da Yr	

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/02/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/27/2006	3. Citation/ Order Number 7285678 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Change	From	To
--------	------	----

8. Condition Or Practice

Reason To justify the long abatement date and time listed on this citation it needs to be noted that the operator will need to modify there weekly and monthly electrical inspection check lists. All required inspections will need to be listed on the check lists to assure a complete inspection has been done , and to provide the required records of such examinations. Also people doing electrical inspections will need to be trained in the use of these inspection sheets.

To justify the long abatement date and time listed on this citation it needs to be noted that the operator will need to modify there weekly and monthly electrical inspection check lists. All required inspections will need to be listed in these check lists to assure a complete inspection has been done, and to provide the required records of such examinations. Also people doing electrical inspections will need to be trained in the use of these inspection sheets.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 07/28/2006	13. Time (24 Hr. Clock) 1052

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 07/27/2006		3. Citation/ Order Number 7285678 - 02	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II--Justification for Action

Change From To

8. Condition Or Practice

Reason It is intended that this citation better define that it was written because of inadequate electrical inspections and records of these inspections that have taken place over a long period of time.

It is intended that this citation better define that it was written because of inadequate electrical inspections and records of these inspections that have taken place over a long period of time.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476247		
11. Signature	Signature		AR Number	12. Date Mo Da Yr	13. Time (24 Hr. Clock)
			24125	08/07/2006	0608

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/27/2006	3. Citation/ Order Number 7285678 - 03
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

A permissibility check list has been developed and the electricians have been instructed with regards to using this to do the required inspections. Retention of this checklist will fulfill the record keeping portion of this citation.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/07/2006	13. Time (24 Hr. Clock) 1141



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 0920	3. Citation/ Order Number 7285669
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The electrical controls located in the Crandall belt portal were covered in coal dust. The tops of the boxes had coal accumulations measuring up to 3/8 of an inch deep. The inside of these electrical boxes also had coal dust accumulations up to 1/8 of an inch deep.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.400
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 010	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number		F. Dated Mo Da Yr
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate These boxes have been cleaned inside and out.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1100
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 0945	3. Citation/ Order Number 7285670
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g)

The electrical controls located in the Crandall belt portal were not all labeled and or labeled correctly. When inspected the circuit breaker that was labeled "fuel tanks, oil tanks, and lower yard" stopped the number 1 belt when the power was switched off. Also a disconnect box on the end of the step down transformer was not marked. This could result in a electrocution if a person was working on this belt and power was switched on. Also this complication will cause problems with locking and tagging while working on this belt.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1904
--------------	---	-------------------	--

Section II--Inspector's Evaluation

10. Gravity:						
A. Injury or illness (has) (is):		No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:		No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:		Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 010		
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>						
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>			F. Dated Mo Da Yr	
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>		E. Citation/ Order Number			F. Dated Mo Da Yr	
15. Area or Equipment						

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3a (Rev. 05-05-05) With the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/26/2006	3. Citation/ Order Number 7285670 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II—Justification for Action

Change	From	To
9. C. Part/Section	75.1904	75.904

Reason The wrong section of law was listed on citation this action corrects that problem.

This citation was mistakenly issued under the wrong section of the law. This action will correct this problem and terminate the citation as a result of the problem being corrected.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	---

Section IV—Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 07/27/2006	13. Time (24 Hr. Clock) 1326

REPRODUCIBLE COPY ONLY



Section I—Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1000	3. Citation/ Order Number 7285671
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The weather head fitting supplying power to a junction box at the belt portal was missing the required cover. The missing cover was not to be found and a replacement had to be found and installed.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.515
--------------	--	----------------------	--

Section II—Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001
11. Negligence (check one)	A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>	12. Type of Action 104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>	
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr		
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
---------------------	-----------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate The missing cover was replaced.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
----------------	-----------------------------------	--------------------------------

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature	23. AR Number 24125	

MSHA Form 7000-5, with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1025	3. Citation/ Order Number 7285672
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The 12-5 cable supplying power to the number 2 magnet being used on the number 1 belt was missing the guards on the belt drive motor. The belts were rubbing on the cable and had rubbed through the outer jacket and into one of the phase leads. There was not any copper showing. This damaged cable was 12 feet above the ground. The magnet was not being used when inspected.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.517
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:						
A. Injury or Illness (has) (is):		No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:		No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:			Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001	
11. Negligence (check one)		A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action		104(a)		13. Type of Issuance (check one)		Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number		F. Dated Mo Da Yr	
A. Citation <input type="checkbox"/>			B. Order <input type="checkbox"/>		C. Safeguard <input type="checkbox"/>	
D. Written Notice <input type="checkbox"/>			15. Area or Equipment			

16. Termination Due	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This cable was moved away from the belts and was re-insulated and guarded.

18. Terminated	A. Date Mo Da Yr 07/26/2006	B. Time (24 Hr. Clock) 1045
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code)	E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature			23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I—Violation Data

1. Date Mo Da Yr 07/26/2006	2. Time (24 Hr. Clock) 1120	3. Citation/ Order Number 7285673
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The liquid tite fitting installed in the bottom of the disconnect for the water heater used on the silo belt was broken out of the bottom of the box. Also the liquid tite conduit was broken where it entered the top of the water heater exposing insulated wires. A 1/2 HP circulating pump was also being used with this water heater and it also had the liquid tite entrance gland damaged and not secured in the electric motor. Insulated wires were exposed. The power was turned on.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.505
--------------	---	-------------------	---

Section II—Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	D. Number of Persons Affected: 001
11. Negligence (check one)	A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>	12. Type of Action 104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr	

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature	23. AR Number 24125	

MSHA Form 7000-3, Mar 05 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

REFERENCE COPY ONLY

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/26/2006	3. Citation/ Order Number 7285673 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

The conduits have been fixed and the bad entrance glands have been replaced.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 07/27/2006	13. Time (24 Hr. Clock) 1337



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1005	3. Citation/ Order Number 7285674
4. Served To Jim Pruitt, Safety Director	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A area light mounted to the center of the bulk oil storage area had the conduit and entrance gland smashed and bare electrical conductors had been in contact with the metal support structure. The wires were connected inside the weatherhead fitting and there was power in the box that supplies power to other electrical components being supplied with electricity also in the same conduit. We were not able to read power on the light and also were not able to find where and how it was disconnected. There was no record of a inspection on this light. This light should have been maintained or removed from service. This condition looked as if it has been this way for a long time.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.502
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could rea- sonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	D. Number of Persons Affected: 001
C. Significant and Substantial:	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>		

11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
----------------------------	----------------------------------	---------------------------------	---	----------------------------------	--

12. Type of Action 104(a)	13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
------------------------------	----------------------------------	--	--------------------------------	------------------------------------

14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr
--------------------	--------------------------------------	-----------------------------------	---------------------------------------	--	------------------------------	----------------------

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1115
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This light has been removed.

18. Terminated	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1115
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
--	-----------------------------	---------------------

22. Signature	Signature	23. AR Number 24125
---------------	------------------	------------------------

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

REFERENCE COPY ONLY



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1035	3. Citation/ Order Number 7285675
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

A electrical box that had been removed from service and had the line side power conductors removed from it had a 1 1/2 opening in the bottom of the box that was not plugged. When checked this obsolete circuit breaker that used to supply power to a reclaim belt had 240 volts on the line side of the breaker. There was no record of any inspections being done on this breaker. A person could not contact power through this opening.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.502
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:						
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>	
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>		
C. Significant and Substantial:	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001			
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action	104(a)		13. Type of Issuance (check one)	Citation <input checked="" type="checkbox"/>	Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr
15. Area or Equipment						

16. Termination Due	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1055
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The opening has been plugged and this box will be included in future permissibility inspections.

18. Terminated	A. Date Mo Da Yr 07/27/2006	B. Time (24 Hr. Clock) 1055
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, March 2003 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

INTERNAL COPY ONLY

U.S. Department of Labor
Mine Safety and Health Administration



Section I-Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1150	3. Citation/ Order Number 7285676
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

A 480 Volt circuit breaker was installed in a plastic enclosure inside the sub station. The breaker was not secured inside this box and was only being held in place by the line side power wires. This circuit breaker had the load side power wires disconnected. The opening in the box where the switch was intended to come through was loosely and partially covered by a danger tag that was not signed or written on, I believe the tag was intended to be a cover. The energized 480 volt line side of this circuit breaker could be contacted through this opening. There was no record of any permissibility inspections being made on this circuit breaker.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.516
--------------	---	-------------------	---

Section II-Inspector's Evaluation

10. Gravity:					
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 001		
11. Negligence (check one)					
A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action 104(a)		13. Type of Issuance (check one)			
		Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number	F. Dated Mo Da Yr	
A. Citation <input type="checkbox"/>			B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/28/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III-Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV-Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call SMALL BUSINESS FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 07/27/2006	2. Time (24 Hr. Clock) 1150	3. Citation/ Order Number 7285677
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

Two energized 480 Volt AC circuit breakers in the surface sub station were not labeled or identified as to what they were controlling. There was no record of any inspections being done on these circuit breakers.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.904
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 07/28/2006	B. Time (24 Hr. Clock) 1100
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 05 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 408 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order Continuation

REFERENCE COPY ONLY

U.S. Department of Labor Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/27/2006	3. Citation/Order Number 7285677 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Change	From	To
10. C. Significant and Substantial	Yes	No

Reason With the load side wires removed there was no hazardous exposure to people.

When these circuit breakers were further inspected it was found that the load side wiring had been removed. These breakers were energized, but there was no exposure to people. Breaker has been switched off and will be listed for required inspections, also inspectors have been instructed to switch all unused circuit breakers off.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/07/2006	13. Time (24 Hr. Clock) 1128



8-16-06 MSL

Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 07/27/2006	3. Citation/Order Number 7285677 - 02
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID (Contractor) 42-01715	

Section II--Justification for Action

Change	From	To
10. A. Injury or Illness	Reasonably Likely	Unlikely

Reason This citation has been changed from S/S to Non S/S. The gravity needed to be changed to reflect this change.

This citation was modified from S/S to non-S/S. The Gravity of the citation has to change to reflect this change.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/16/2006	13. Time (24 Hr. Clock) 0607

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/07/2006	2. Time (24 Hr. Clock) 1030	3. Citation/ Order Number 7285679
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Both the East and South side equipment doors leading into the shop were being powered by extension cords. The East side door had a 14' extension cord supplying power to the electric motor that opens and closes the door. The South side door had a extension cord that was 12' long. Permanent installations cannot have extension cords no longer than 6' long.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 77.516
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No

D. Number of Persons Affected: 001

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice

E. Citation/Order Number

F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/09/2006	B. Time (24 Hr. Clock) 0900
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/07/2006	3. Citation/ Order Number 7285679 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II—Justification for Action

Conduits have been installed and this issue has been resolved.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV—Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/10/2006	13. Time (24 Hr. Clock) 1406

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration

114 ✓


Section I--Violation Data

1. Date Mo Da Yr 08/10/2006	2. Time (24 Hr. Clock) 1100	3. Citation/ Order Number 7285684
4. Served To Jim Kulow, safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

South main section miner S/N 5062 was being operated in the face when we arrived in the section and inspected the machine. Found both packing glands on the right side area lights had the packing glands tightened to where there was not the minimum clearance of 1/8 the of a inch between the light assembly and the packing nut. The same condition was found on the left side spot light.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.503
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 007	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/10/2006	B. Time (24 Hr. Clock) 1300
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The three packing glands have been repacked and are now in permissible condition.

18. Terminated	A. Date Mo Da Yr 08/10/2006	B. Time (24 Hr. Clock) 1300
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/10/2006	2. Time (24 Hr. Clock) 1305	3. Citation/ Order Number 7285685
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

South main section Joy Shuttle Car, approval number 2G3948A-00 was being operated and used in the production of coal. When inspected a 1/4 inch hole was found in the trailing cable. This opening in the cable was arcing and sparking could be seen through this opening.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.606
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/10/2006	B. Time (24 Hr. Clock) 1330
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate	This cable has been repaired and now is in safe operating condition.
-------------------------	--

18. Terminated	A. Date Mo Da Yr 08/10/2006	B. Time (24 Hr. Clock) 1305
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 08/15/2006	2. Time (24 Hr. Clock) 0950	3. Citation/ Order Number 7285686
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Joy Shuttle Car, company number 12-9, S/N 16849A was being operated on the South Mains section. When inspected this machine was found to have a 1/4 inch brake line supplying oil to the cab side brakes crushed and bent flat. When tested the machine brakes worked well. When reparse were attempted the line broke. Machine was removed from service by the operator until repairs could be made.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:					
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 001		
11. Negligence (check one)					
A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action 104(a)		13. Type of Issuance (check one)			
		Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number	F. Dated Mo Da Yr	
A. Citation <input type="checkbox"/>			B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/16/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 03 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) 08/15/2006 Mo Da Yr	3. Citation/ Order Number 7285686 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II—Justification for Action

The brake line has been replaced with new parts. Problem is corrected.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV—Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/17/2006	13. Time (24 Hr. Clock) 1231

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration

*Terminated by
 Order 7285687*



Section I--Violation Data

1. Date Mo Da Yr 08/15/2006	2. Time (24 Hr. Clock) 1020	3. Citation/ Order Number 7285687
4. Served To Jim Pruitt, Safety Director	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		

8a. Written Notice (103g)

Section scoop company number 17-2 , S/N 2478 was being operated in the South Mains section. When inspected this machine was found to have the packing gland on the right rear of this machine damaged and could be wobbled back and forth about 3/8 of a inch at the rear of the tube that the conduit connects to. Also the permissible enclosure that the main circuit breaker is installed in had a .007 inch opening in it. This feeler gauge could be inserted about 1/2 of a inch into the flame path of this enclosure. Machine has been removed from service by the operator until repairs can be completed.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.503
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 007	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/16/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) / In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/15/2006	2. Time (24 Hr. Clock) 1120	3. Citation/ Order Number 7285688
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

Gehl skid steer loader company number 5 was being operated at the South Main section feeder breaker. When inspected this machine did not have a filter installed in the exhaust filter housing. There was not a new filter in the section and the old filter could not be found. Operating in this condition exposes others in this section to Diesel Particulate Mater in excess of the 2.5 grams per hour standard.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input checked="" type="checkbox"/> Safety <input type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 72.501(c)
--------------	--	----------------------	---

Section II--Inspector's Evaluation

10. Gravity:					
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 007		
11. Negligence (check one)					
A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action 104(a)		13. Type of Issuance (check one)			
		Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number		F. Dated Mo Da Yr
A. Citation <input type="checkbox"/>			B. Order <input type="checkbox"/>		C. Safeguard <input type="checkbox"/>
D. Written Notice <input type="checkbox"/>					
15. Area or Equipment					

16. Termination Due	A. Date Mo Da Yr 08/16/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) / In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I—Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) 08/15/2006	3. Citation/ Order Number 7285688 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II—Justification for Action

Machine has been inspected and a filter has been installed.

See Continuation Form

Section III—Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV—Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/17/2006	13. Time (24 Hr. Clock) 1237

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/15/2006	2. Time (24 Hr. Clock) 1125	3. Citation/ Order Number 7285689
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Gehl skid steer loader company number 5 was being operated at the South Main feeder breaker. When inspected this machine was found to have the rear actuator and fire suppression propellant bottles not securely mounted. These bottles were only attached to the machine by the hoses that they were connected to. Also the fuel shut off switch had the reset shaft and knob broken off. In this condition the required test could not be done.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.1911(a)(1)
--------------	--	-------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 007
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/16/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/15/2006	3. Citation/ Order Number 7285689 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Gehl skid steer loader #5 has been inspected and the actuator bottle and propellant bottle have been secured.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/17/2006	13. Time (24 Hr. Clock) 1241



Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 0850	3. Citation/ Order Number 7285690
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g)

Section scoop, 17-2, S/N 2478, was under citation for a excessive gap in the main circuit breaker enclosure. When the enclosure was checked to abate this citation a gap of .012 was found. This machine had been placed back in service after the initial attempt to fix it had been done.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.503
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
	C. Significant and Substantial: Yes <input type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected:	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action 104(b)	13. Type of Issuance (check one)		Citation <input type="checkbox"/>	Order <input checked="" type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action	A. Citation <input checked="" type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number 7285687
					F. Dated Mo Da Yr 08/15/2006

15. Area or Equipment South Main section scoop was under citation for a excessive gap in the main circuit braker permissable enclosure. After a attempt to fix this problem the machine was placed back in service. When this

16. Termination Due	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock)
---------------------	-----------------------------------	------------------------

Section III--Termination Action

17. Action to Terminate This cover was removed and dirt was cleaned from the flange. Cover was reinstalled and when gaps were checked a problem could not be found.

18. Terminated	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1007
----------------	-----------------------------------	--------------------------------

Section IV Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

Under the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 18 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the actions of any federal agency, you may contact the Ombudsman by mail (800/833-6847), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, S.W., M.C. 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action Is: Continuation ✓	2. Dated (Original Issue) 08/17/2006	3. Citation/ Order Number 7285690
4. Served To Jim Pruitt, Safety Director	5. Operator GENVAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Continuation of 15. Area or Equipment

enclosure was inspected a .012 inch opening was found in this enclosure.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247
------------------------------	-----------------------------

11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/17/2006	13. Time (24 Hr. Clock) 0850
-----------------------------------	--------------------	------------------------------------	---------------------------------

Termination
2006 7285687



Section I--Violation Data

1. Date Mo Da Yr 08/15/2006	2. Time (24 Hr. Clock) 1020	3. Citation/ Order Number 7285687
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Section scoop company number 17-2 ,S/N 2478 was being operated in the South Mains section. When inspected this machine was found to have the packing gland on the right rear of this machine damaged and could be wobbled back and forth about 3/8 of a inch at the rear of the tube that the conduit connects to. Also the permissible enclosure that the main circuit breaker is installed in had a .007 inch opening in it. This feeler gauge could be inserted about 1/2 of a inch into the flame path of this enclosure. Machine has been removed from service by the operator until repairs can be completed.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.503
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No D. Number of Persons Affected: 007

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/
Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/16/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated

A. Date Mo Da Yr	B. Time (24 Hr. Clock)
---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 0925	3. Citation/ Order Number 7285691
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

South Main section man trip, a Isuzu, company number 1 was parked at section transformer. When inspected it was found to have three 12 volt light assemblies that had wires entering through metal brackets without the use of required bushings. These light assemblies were made of rubber with metal mounting brackets. Where the wire entered the light assembly they passed through metal mounting brackets and the rubber light assembly had been cut away and provided no protection for the wire.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1910(i)
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 007	
11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
12. Type of Action	104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>			
14. Initial Action	A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1000
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The wires were entered through the rubber portion of the light assembly.

18. Terminated	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 0935
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 0935	3. Citation/ Order Number 7285692
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

South Main section man trip, a Isuzu, company number 1 was parked at section transformer. When inspected it was found to have no insulation on the starter lead from the battery where the positive terminal attaches to the starter. Battery voltage was measured at this connection.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1910(f)
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 007	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1000
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The connection was properly insulated.

18. Terminated	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1015
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I—Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 0945	3. Citation/ Order Number 7285693
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

South Main section man trip, a Isuzu, company number 1 was parked at section transformer. When inspected on a slight grade the applied park brake made no attempt to hold the machine from moving.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1910(d)
--------------	---	-------------------	---

Section II—Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>				D. Number of Persons Affected: 007
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
14. F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1310
---------------------	--------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate Rear brake lining has been replaced and the park break works well now.

18. Terminated	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1330
----------------	--------------------------------	--------------------------------

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-5, March 2003 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20418. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 0952	3. Citation/ Order Number 7285694
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice 8a. Written Notice (103g)		

Isuzu pickup, company number 30 was inspected in Main South near the section transformer, When inspected this machine was found to have excessive play in the steering. The steering wheel could be moved 1/4 of a turn without moving the wheels. Further inspection revealed the steering idler on the right side of the machine had about 3/4 of a inch of looseness in it and the pitman arm also had about 3/4 of a inch of looseness in it.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.1914(a)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No D. Number of Persons Affected: 001

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a) 13. Type of issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/19/2006	B. Time (24 Hr. Clock) 1200
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised). In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation ✓	2. Dated (Original Issue) Mo Da Yr 08/17/2006	3. Citation/ Order Number 7285694 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The needed parts to repair the front end of this truck will not be available for ten days. This truck has been removed from service by the operator until repairs can be made.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr 08/29/2006	B. Time (24 Hr. Clock) 0800	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	-----------------------------------	--------------------------------	-------------------------------------	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/18/2006	13. Time (24 Hr. Clock) 0830

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/17/2006	3. Citation/ Order Number 7285694 - 02
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Isuzu truck company number #30, S/N 4S1CL11L8N4229506 has been removed from service and is to be sent to Kwick Lube to be junked out. This truck will not be used at this or any other mine in the future. The engine in this truck may be used to power another truck. Engine S/N 939674.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/21/2006	13. Time (24 Hr. Clock) 1412

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 1000	3. Citation/ Order Number 7285695
4. Served To Jim Pruitt, Safety Director		5. Operator GENVAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Isuzu pickup, company number 30 was inspected in Main South near the section transformer, When inspected this machine was found to have no insulation on the battery connection where it attaches to the starter.

See Continuation Form (MSHA Form 7000-3a) []

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1910(f)
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
14. F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/19/2006	B. Time (24 Hr. Clock) 1200
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This connection has been properly insulated.

18. Terminated	A. Date Mo Da Yr 08/17/2006	B. Time (24 Hr. Clock) 1018
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration

07/17


Section I--Violation Data

1. Date Mo Da Yr 08/17/2006	2. Time (24 Hr. Clock) 1030	3. Citation/ Order Number 7285696
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g)

Eimco 955, company number 10 was parked at crosscut number 1 in South Mains. When inspected this machine was found to have a accumulation of coal and diesel fuel measuring 1 1/2 inch deep X 4 inches wide X 7 inches long. The fuel had been leaking from the banjo fitting in the front of the fuel transfer pump, and the hose connected to it was washed clean for 7 inches.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.400
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input type="checkbox"/> Reasonably Likely <input checked="" type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			F. Dated Mo Da Yr	

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/18/2006	B. Time (24 Hr. Clock) 1200
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate		
18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/17/2006	3. Citation/ Order Number 7285696 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The fuel and oil leaks on this machine have been repaired and the accumulations have been cleaned.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/18/2006	13. Time (24 Hr. Clock) 0838

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration

Handwritten initials and signature

Section I--Violation Data

1. Date Mo Da Yr 08/21/2006	2. Time (24 Hr. Clock) 1035	3. Citation/ Order Number 7285697
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g)

Fire deluge system installed on South Main #1 belt drive had 6 each nozzles that did not activate and blow off the protective caps when tested. This system had 21 nozzles installed in it. Also the nozzle pointed at the outby motor did not provide protection for this motor in that the spray nozzle was not secured and the spray was missing the motor.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1101-1(a)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:						
A. Injury or Illness (has) (is):		No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:		No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:			Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 007	
11. Negligence (check one)						
A. None <input type="checkbox"/>		B. Low <input type="checkbox"/>		C. Moderate <input checked="" type="checkbox"/>		D. High <input type="checkbox"/>
E. Reckless Disregard <input type="checkbox"/>						
12. Type of Action 104(a)			13. Type of Issuance (check one)			
			Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action				E. Citation/ Order Number		F. Dated Mo Da Yr
A. Citation <input type="checkbox"/>		B. Order <input type="checkbox"/>		C. Safeguard <input type="checkbox"/>		D. Written Notice <input type="checkbox"/>

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/21/2006	B. Time (24 Hr. Clock) 1200
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate Rust and dirt were cleaned from two nozzles and balloons were installed in place of the protective covers. When tested this worked well.

18. Terminated	A. Date Mo Da Yr 08/21/2006	B. Time (24 Hr. Clock) 1130
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/21/2006	2. Time (24 Hr. Clock) 1200	3. Citation/ Order Number 7285698
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The inby motor tray at the number 4 drive, located at X cut 69 on Main West, had a 2'3" square accumulation of oil that had leaked out of the fluid coupler. The depth of this oil was not determined, but was wet and could be seen as liquid trapped in side this containment. Also there was a covering of oil and coal on the vertical surfaces of this enclosure for the fluid coupler, and oil had leaked down the structure supporting this motor tray. A motor was not being used in this motor tray but the fluid coupler and gear box were being driven by the other drive motor.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.400
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:						
A. Injury or illness (has) (is):		No Likelihood <input type="checkbox"/>	Unlikely <input type="checkbox"/>	Reasonably Likely <input checked="" type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:		No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:			Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	D. Number of Persons Affected: 007	
11. Negligence (check one)						
A. None <input type="checkbox"/>		B. Low <input type="checkbox"/>		C. Moderate <input checked="" type="checkbox"/>		D. High <input type="checkbox"/>
E. Reckless Disregard <input type="checkbox"/>						
12. Type of Action 104(a)		13. Type of Issuance (check one)				
		Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>	
14. Initial Action			E. Citation/ Order Number		F. Dated Mo Da Yr	
A. Citation <input type="checkbox"/>		B. Order <input type="checkbox"/>		C. Safeguard <input type="checkbox"/>		D. Written Notice <input type="checkbox"/>

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/21/2006	B. Time (24 Hr. Clock) 1300
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The motor tray was washed out.

18. Terminated	A. Date Mo Da Yr 08/21/2006	B. Time (24 Hr. Clock) 1210
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) // In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 08/24/2006	2. Time (24 Hr. Clock) 1000	3. Citation/ Order Number 7285699
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		

8a. Written Notice (103g)

At the head roller of number 3 drive, at crosscut number 38, a exposed power lead was found where the feed through feature of a remote belt switch had been improperly terminated. This box had been terminated by cutting the cable off flush and not taping the exposed leads. The 14-3 cable had exposed power leads and 19 volts AC to ground was measured on these leads.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.517
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>			D. Number of Persons Affected: 001	
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
F. Dated Mo Da Yr				
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 08/24/2006	B. Time (24 Hr. Clock) 1200
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The power conductors have been taped up.

18. Terminated	A. Date Mo Da Yr 08/24/2006	B. Time (24 Hr. Clock) 1010
----------------	--------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 85 (revised) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/29/2006	2. Time (24 Hr. Clock) 0915	3. Citation/ Order Number 7285700
4. Served To Gale Anderson, Shift foreman		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		

8a. Written Notice (103g)

Found a bottom roller that was bound up and not turning. This roller had a 1 inch wide flat spot wore in it as a result of not turning as the conveyor belt slid across the top of it. This roller was about 60 feet in by the # 6 drive. The belt was very wet and excessive heat was not detectable.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 007
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/29/2006	B. Time (24 Hr. Clock) 1500
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate This roller has been replaced.

18. Terminated	A. Date Mo Da Yr 08/29/2006	B. Time (24 Hr. Clock) 1325
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3a (Rev. 10/2005) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 08/29/2006			3. Citation/ Order Number 7285700 - 01	
4. Served To Gale Anderson, Shift foreman				5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE				7. Mine ID 42-01715 (Contractor)		

Section II--Justification for Action

This citation is being vacated because the operator was not required to remove the belt from service immediately as required by 75.1725(a).

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input checked="" type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	--	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection	E01	10. Event Number	4476247
11. Signature	Signature	AR Number	24125
		12. Date Mo Da Yr	09/07/2006
		13. Time (24 Hr. Clock)	1324

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 08/29/2006	2. Time (24 Hr. Clock) 1200	3. Citation/ Order Number 7285701
4. Served To Gale Anderson , Shift foreman	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The number 1 belt tailpiece is missing all the bottom rollers and also the first stand on the outby side of the tailpiece does not have a bottom roller. As a result of these missing bottom rollers the bottom belt is contacting three cross members and is not being supported where it goes through the tailpiece. There is enough heat being generated by the belt rubbing the metal structure to dry out the steel cross members in a area that all else is wet, but no excessive heat could be detected.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	---	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:	A. Injury or Illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>	B. Injury or illness could reasonably be expected to be: No Lost Workdays <input type="checkbox"/> Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>	C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 007
--------------	---	--	--	---------------------------------------

11. Negligence (check one)	A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>
----------------------------	----------------------------------	---------------------------------	---	----------------------------------	--

12. Type of Action 104(a)	13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>
------------------------------	--

14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>	E. Citation/ Order Number	F. Dated Mo Da Yr
---	------------------------------	----------------------

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/30/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature	23. AR Number 24125	

MSHA Form 7000-3, Mar 05 (revised) - In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/29/2006	3. Citation/ Order Number 7285701 - 01
4. Served To Gale Anderson , Shift foreman	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Two bottom rollers have been installed in this tailpiece and the bottom belt is no longer contacting the cross members in the tailpiece.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 08/31/2006	13. Time (24 Hr. Clock) 1035

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/> <input type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/29/2006	3. Citation/ Order Number 7285701 - 02
4. Served To Gale Anderson, Shift foreman	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

This citation is being vacated because the operator was not required to remove the belt from service immediately as required by 75.1725 (a).

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input checked="" type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	--	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 09/07/2006	13. Time (24 Hr. Clock) 1336



Section I—Violation Data

1. Date Mo Da Yr 08/29/2006	2. Time (24 Hr. Clock) 1235	3. Citation/ Order Number 7285702
4. Served To Gale Anderson, Shift foreman		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The center toughing roller at crosscut 16, along the number 1 belt had the bearing missing and had wobbled a three inch diameter hole in the end of the roller where the bearing used to be. There were small chunks of iron inside the roller from the disintegration of the bearing. This roller was stuck and not rotating at the time of inspection but could brake loose and begin rotating again at any time.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety Other <input checked="" type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1725(a)
--------------	--	-------------------	---

Section II—Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No

D. Number of Persons Affected: 007

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice

E. Citation/Order Number

F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 08/29/2006	B. Time (24 Hr. Clock) 1400
---------------------	--------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate This roller has been replaced.

18. Terminated	A. Date Mo Da Yr 08/29/2006	B. Time (24 Hr. Clock) 1350
----------------	--------------------------------	--------------------------------

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 80 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 08/29/2006	3. Citation/ Order Number 7285702 - 01
4. Served To Gale Anderson , Shift foreman	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

This citation is being vacated because the operator was not required to remove the belt from service immediately as required by 75.1725(a).

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input checked="" type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	--	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 09/07/2006	13. Time (24 Hr. Clock) 1340



Section I—Violation Data

1. Date Mo Da Yr 09/05/2006	2. Time (24 Hr. Clock) 1325	3. Citation/ Order Number 7285703
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	
8. Condition or Practice		8a. Written Notice (103g)

Main east seals number 3 and 4 were observed to be leaking air. These air leaks were detectable by both sight and sound. The seals had air leaking from them that could be detected by holding your hand in front of several places on both seals and feeling a substantial amount of air leaking from the seals. Many of the problem areas had foam sealant applied to them but were still leaking. Gas checks did not detect any deficiencies of oxygen or any amount of CO or CH4.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.335(a)(1)(iv)
--------------	---	-------------------	---

Section II—Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No D. Number of Persons Affected: 007

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 09/16/2006	B. Time (24 Hr. Clock) 0900
---------------------	--------------------------------	--------------------------------

Section III—Termination Action

17. Action to Terminate

18. Terminated A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section IV—Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mili
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 05 (revision) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 2002, the United States Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Farmers Friends to receive comments from small business about federal regulatory enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the Director of Fairness, 1200 G Street, NE, Washington, DC 20003. However, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>		2. Dated (Original Issue) Mo Da Yr 09/05/2006		3. Citation/ Order Number 7285703 - 01	
4. Served To Jim Pruitt, Safety Director			5. Operator GENWAL RESOURCES INC		
6. Mine CRANDALL CANYON MINE			7. Mine ID 42-01715		(Contractor)

Section II--Justification for Action

Additional coating has been applied to seals and leaks have been controlled.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01		10. Event Number 4476247			
11. Signature	Signature	AR Number 24125	12. Date Mo Da Yr 09/08/2006	13. Time (24 Hr. Clock) 0842	

10-10-06

Section I--Violation Data

1. Date Mo Da Yr 09/05/2006	2. Time (24 Hr. Clock) 0225	3. Citation/ Order Number 7285704
4. Served To Jim Pruitt, Safety Director		5. Operator GENWAL RESOURCES INC
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The return escape way was obstructed by the fall of loose top. A area of the escape way about 100 feet inby the main mine fan had fallen and had been allowed to accumulate for a distance of 13 feet long by 5 feet wide and about 8 inches deep. This obstruction was comprised of slate and top rock, the size of the pieces were 1 to 2 feet long and about 1 foot wide.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.380(d)(1)
--------------	--	----------------------	--

Section II--Inspector's Evaluation

10. Gravity:					
A. Injury or illness (has) (is):	No Likelihood <input type="checkbox"/>	Unlikely <input checked="" type="checkbox"/>	Reasonably Likely <input type="checkbox"/>	Highly Likely <input type="checkbox"/>	Occurred <input type="checkbox"/>
B. Injury or illness could reasonably be expected to be:	No Lost Workdays <input type="checkbox"/>	Lost Workdays Or Restricted Duty <input checked="" type="checkbox"/>	Permanently Disabling <input type="checkbox"/>	Fatal <input type="checkbox"/>	
C. Significant and Substantial:	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>	D. Number of Persons Affected: 007		
11. Negligence (check one)					
A. None <input type="checkbox"/>	B. Low <input type="checkbox"/>	C. Moderate <input checked="" type="checkbox"/>	D. High <input type="checkbox"/>	E. Reckless Disregard <input type="checkbox"/>	
12. Type of Action 104(a)		13. Type of Issuance (check one)			
		Citation <input checked="" type="checkbox"/>		Order <input type="checkbox"/>	Safeguard <input type="checkbox"/>
14. Initial Action			E. Citation/ Order Number		F. Dated Mo Da Yr
A. Citation <input type="checkbox"/>	B. Order <input type="checkbox"/>	C. Safeguard <input type="checkbox"/>	D. Written Notice <input type="checkbox"/>		
15. Area or Equipment					

18. Termination Due	A. Date Mo Da Yr 09/05/2006	B. Time (24 Hr. Clock) 0300
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate The escape way has been moved to go around this area and uses another cross cut. All signs and lifeline has been moved.

18. Terminated	A. Date Mo Da Yr 09/05/2006	B. Time (24 Hr. Clock) 0245
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 24125

MSHA Form 7000-3, Mar 95 (revised) - in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration

7-26-06-1435 

Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 09/05/2006	3. Citation/ Order Number 7285704 - 01
4. Served To Bodee Allred, Safety	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715 (Contractor)	

Section II--Justification for Action

Change	From	To
2. Issue Time	02:25	14:00
Reason		
16. B. Termination Due Time	03:00	14:35
Reason		
18. B. Terminated Time	02:45	14:20
Reason		

Change item #2 from 0225 to 1400
Change item #16B from 0300 to 1435
Change item #18B from 0245 to 1420

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247
---------------------------	--------------------------

11. Signature Signature	AR Number 23799	12. Date Mo Da Yr 09/22/2006	13. Time (24 Hr. Clock) 0600
-----------------------------------	-----------------	------------------------------	------------------------------

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 09/05/2006	3. Citation/ Order Number 7285704 - 01
4. Served To Jim Pruitt, Safety Director	5. Operator GENWAL RESOURCES INC	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

Change	From	To
2. Issue Time	02:25	14:00

Reason The time was incorrectly input on the original citation.

The issue time was entered incorrectly.

*Replaced
with corrected
OI.*

Section III--Subsequent Action Taken

See Continuation Form

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input checked="" type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	---

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247
---------------------------	--------------------------

11. Signature Signature	AR Number 24125	12. Date Mo Da Yr 09/08/2006	13. Time (24 Hr. Clock) 0848
-----------------------------------	--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor
 Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 09/11/2006	2. Time (24 Hr. Clock) 1040	3. Citation/ Order Number 7282823
4. Served To Jimm Pruitt, Safety Manager	5. Operator UTAHAMERICAN ENERGY	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	
8. Condition or Practice		8a. Written Notice (103g)

Transformer number 29 located in the West Mains Continuous Miner Section, MMU - 002-0 was energized and no pre-shift examination for the day shift (09-11-2006) had been done as verified by the time, date and initial record kept at this location to record that the examination had been done. Last date recorded was for the graveyard shift on 09-10-2006.

Main West Section has been idle since Saturday (09-09-2006).

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.360(b)(9)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No

D. Number of Persons Affected: 001

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a)

13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice

E. Citation/Order Number

F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 09/11/2006	B. Time (24 Hr. Clock) 1050
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate Jim Pruitt, Safety Manager checked the area for hazards and found none. He signed the record book then deenergized the transformer.

18. Terminated	A. Date Mo Da Yr 09/11/2006	B. Time (24 Hr. Clock) 1045
----------------	-----------------------------------	--------------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 23277

MSHA Form 7000-3, March 2003 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Violation Data

1. Date Mo Da Yr 09/11/2006	2. Time (24 Hr. Clock) 1230	3. Citation/ Order Number 7282824
4. Served To Jimm Pruitt, Safety Manager		5. Operator UTAHAMERICAN ENERGY
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

Accumulations of coal and coal fines were allowed to exist at the feeder breaker located on the South Mains Continuous Miner Section, MMU - 009-0. From the feeder breaker inby for a distance of 25 feet the accumualtions ranged in depth of 1/2 inch up to 2 feet and was 18 feet wide. In this area the shuttle cars were running over the accumulations and at the dumping point the accumulations were being used as a ramp so the battery shuttle car could get enough height to dump on the feeder breaker. From the dumping point of the feeder breaker outby the accumulations on both sides of the feeder breaker ranged indepth from 2 feet to 6 feet for a distance of about 10 feet and 2 feet wide.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.400
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or Illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No D. Number of Persons Affected: 006

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation Order Safeguard

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due	A. Date Mo Da Yr 09/12/2006	B. Time (24 Hr. Clock) 0600
---------------------	--------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 23277

MSHA Form 7000-1 (Rev. 05/05) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 09/11/2006	3. Citation/ Order Number 7282824 - 01
4. Served To Jimm Pruitt, Safety Manager	5. Operator UTAHAMERICAN ENERGY	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The accumulations of coal and coal fines were cleaned up.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input checked="" type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247
---------------------------	--------------------------

11. Signature Signature	AR Number 23277	12. Date Mo Da Yr 09/12/2006	13. Time (24 Hr. Clock) 0920
-----------------------------------	--------------------	---------------------------------	---------------------------------

Mine Citation/Order

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Violation Data

1. Date Mo Da Yr 09/20/2006	2. Time (24 Hr. Clock) 1145	3. Citation/ Order Number 7282809
4. Served To Bodee Allred, Safety		5. Operator UTAH AMERICAN ENERGY
6. Mine CRANDALL CANYON MINE		7. Mine ID 42-01715 (Contractor)
8. Condition or Practice		8a. Written Notice (103g)

The result of the rock dust survey collected on 09-05-2006 2 x-cuts outby main north #1 seal showed non-compliant.

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health Safety <input checked="" type="checkbox"/> Other	B. Section of Act	C. Part/Section of Title 30 CFR 75.403
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:				
A. Injury or illness (has) (is): No Likelihood <input type="checkbox"/> Unlikely <input checked="" type="checkbox"/> Reasonably Likely <input type="checkbox"/> Highly Likely <input type="checkbox"/> Occurred <input type="checkbox"/>				
B. Injury or illness could reasonably be expected to be: No Lost Workdays <input checked="" type="checkbox"/> Lost Workdays Or Restricted Duty <input type="checkbox"/> Permanently Disabling <input type="checkbox"/> Fatal <input type="checkbox"/>				
C. Significant and Substantial: Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>				D. Number of Persons Affected: 001
11. Negligence (check one) A. None <input type="checkbox"/> B. Low <input type="checkbox"/> C. Moderate <input checked="" type="checkbox"/> D. High <input type="checkbox"/> E. Reckless Disregard <input type="checkbox"/>				
12. Type of Action 104(a)		13. Type of Issuance (check one) Citation <input checked="" type="checkbox"/> Order <input type="checkbox"/> Safeguard <input type="checkbox"/>		
14. Initial Action A. Citation <input type="checkbox"/> B. Order <input type="checkbox"/> C. Safeguard <input type="checkbox"/> D. Written Notice <input type="checkbox"/>			E. Citation/ Order Number	
15. Area or Equipment				

16. Termination Due	A. Date Mo Da Yr 09/22/2006	B. Time (24 Hr. Clock) 0800
---------------------	-----------------------------------	--------------------------------

Section III--Termination Action

17. Action to Terminate

18. Terminated	A. Date Mo Da Yr	B. Time (24 Hr. Clock)
----------------	---------------------	------------------------

Section IV--Automated System Data

19. Type of Inspection (activity code) E01	20. Event Number 4476247	21. Primary or Mill
22. Signature Signature		23. AR Number 23799

MSHA Form 7000-3, (Rev. 03/03) in accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.

Mine Citation/Order
Continuation

U.S. Department of Labor
Mine Safety and Health Administration



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 09/20/2006	3. Citation/ Order Number 7282809 - 01
4. Served To Bodee Allred, Safety	5. Operator UTAH AMERICAN ENERGY	
6. Mine CRANDALL CANYON MINE	7. Mine ID 42-01715	(Contractor)

Section II--Justification for Action

The area has been rock dusted.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	C. Vacated <input type="checkbox"/>	D. Terminated <input checked="" type="checkbox"/>	E. Modified <input type="checkbox"/>
----------------	------------------	------------------------	-------------------------------------	---	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E01	10. Event Number 4476247		
11. Sig. Signature	AR Number 23799	12. Date Mo Da Yr 09/21/2006	13. Time (24 Hr. Clock) 0820